

PRE-REPAIR SURVEY REPORT NTUC Income Insurance Co-operative Ltd 73 Bras Basah Road #05-01 NTUC Trade Union House Singapore 189556 Attention: Mr Yon Kai Jie **Assign Date:** 04/03/2020 **Survey Date:** 05/03/2020 **Adjustment Date:** 14/09/2020 **Accident Date:** 02/03/2020 **TP Policy No:** SD19V12865/VMS/R00 **Our Ref:** AVS2020-23017/AT Place of Survey: H L Cycle Pte Ltd **Your Ref:** MT/1086640-003 1 Kaki Bukit Avenue 6 #02-58 Autobay **Claim Type:** Third Party Singapore 417883 Claimant: Kong Moon Teng **Description of Vehicle:** Veh. No: FBK3707T Make/Model: Kawasaki ZX1000N Colour: Chrome/ Green Engine No: ZXT00NE002371 Sum Insured (S\$): Market Value **Engine Capacity:** 998cc **Chassis No:** JKAZXTOONNA002080 Mkt Value (S\$): \$29,600.00 **Odometer:** 5696 Reg. Date: 25/07/2015 Excess (S\$): NA **Condition of Vehicle:** General: Good Modification: No Steering: Affected Handbrake: Yes Footbrake: Yes Paint work: Good **Bridgestone** Tvre Make: Front Tyre Size: **Front Side:** 120/70R17 7_{mm} **Rear Tyre Size:** 200/55R17 **Rear Side:** 7_{mm} **Description of Damage:** The vehicle sustained damage on the front and left portions. Remarks: Our recommended amount for the cost of contract lumpsum repair is \$\$6,000.00 with approximately four (4) working days

to complete. However, no finalisation was agreed with the repairer.



COMPLETEU 2 | gep 2029

Adjuster:

Mohamad Affandi **Motor Appraiser**

Date

Note: This report is confidential and solely for the use of the client. The survey was conducted on a "Without Prejudice" basis,



Inspection Services Pte Ltd

adjustment of Repair Cost for Vehicle:			FBK3707T Our Ref: AVS2020-23017/AT		
No.	Qty	Description of Parts	Condition	Third Party Surveyor's Estimate S\$	Our Recommendation S\$
ist Iter	ms				
1	1	Front fender	Cracked	1,899.00	669.80
2	1	Front fork tube assy	Repair	15,500.00	
3	1	Front brake disc	Not Necessary	2,400.00	
4	1	Front sport rim	Not Necessary	4,000.00	
5	1	Top cowling	Cracked	3,950.00	1,830.60
6	1	Lampstay	Bent	509.00	509.00
7	1	Headlamp	Grazed	4,250.00	1,693.40
8	1	N/s side mirror	Grazed	850.00	554.20
9	1	N/s handle bar	Bent	355.00	355.00
10	1	N/s handle bar end	Grazed	90.00	90.00
11	1	Clutch end	Grazed	155.00	155.00
12	1	N/s side fairing	Grazed	2,450.00	1,684.80
13	1	Front n/s footrest	Not Necessary	285.00	
14	1	Front n/s footrest bracket	Not Necessary	435.00	
15	1	Gear pedal	Not Necessary	385.00	
16	1	N/s engine cover	Not Necessary		
			Sub Total:	37,513.00	7,541.80
		1	Discount (less 10%):	3,751.30	754.18
				33,761.70	6,787.62
pecial	Nett Ite	ms	-		
1	2	Fork oils	Necessary	40.00	40.00
2	1	Fork oil seals	Necessary	76.00	76.00
3	1 set	Steering cone	Necessary	180.00	120.00
			Sub Total:	296.00	236.00
			Total Parts Price:	34,057.70	7,023.62
abour	Cost				
1	1	de towing service.	50.00		
2	1 '	k electircal system, wire harness and focos h	50.00	30.00	
3	To provi	ide labour charges, workmanship to dismanted align body structrure and damaged consist	500.00	450.00	
	1, ,,,,,		Sub Total:	600.00	480.00
			Grand Total:		7,503.62

Note: This report is confidential and solely for the use of the client. The survey was conducted on a "Without Prejudice" basis.



Our Ref: AVS2020-23017/AT Your Ref: MT/1086640-002 Pre-repair survey - 05/03/2020













Note: This report is confidential and solely for the use of the client. The survey was conducted on a "Without Prejudice" basis.

AJAX Inspection Services Pte Ltd

120 Lower Delta Road, #08-08, Cendex Centre, Singapore 169208. Tel: +65 6255 0808 Fax: +65 6849 9155 Email: info@ajaxinspection.com Website:www.ajaxadjusters.com Co. Reg. No.: 201318067R



Pre-repair survey














Note: This report is confidential and solely for the use of the client. The survey was conducted on a "Without Prejudice" basis.

AJAX Inspection Services Pte Ltd



Pre-repair survey

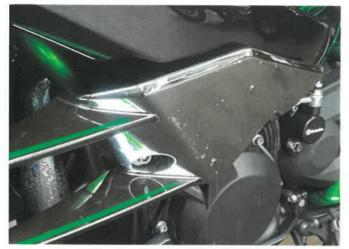











Note: This report is confidential and solely for the use of the client. The survey was conducted on a "Without Prejudice" basis.

AJAX Inspection Services Pte Ltd

120 Lower Delta Road, #08-08, Cendex Centre, Singapore 169208. Tel: +65 6255 0808 Fax: +65 6849 9155 Email: info@ajaxinspection.com Website:www.ajaxadjusters.com Co. Reg. No.: 201318067R



Pre-repair survey













Note: This report is confidential and solely for the use of the client. The survey was conducted on a "Without Prejudice" basis.

AJAX Inspection Services Pte Ltd



Our Ref: AVS2020-23017/AT Your Ref: MT/1086640-002 Re-survey items - 09/03/2020













Note: This report is confidential and solely for the use of the client. The survey was conducted on a "Without Prejudice" basis.

AJAX Inspection Services Pte Ltd



Re-survey items













Note: This report is confidential and solely for the use of the client. The survey was conducted on a "Without Prejudice" basis.

AJAX Inspection Services Pte Ltd



Re-survey items













Note: This report is confidential and solely for the use of the client. The survey was conducted on a "Without Prejudice" basis.

AJAX Inspection Services Pte Ltd

AJAX Inspection Services Pte Ltd

Our Ref: AVS2020-23017/AT Your Ref: MT/1086640-002

Re-survey items













Note: This report is confidential and solely for the use of the client. The survey was conducted on a "Without Prejudice" basis.

AJAX Inspection Services Pte Ltd

120 Lower Delta Road, #08-08, Cendex Centre, Singapore 169208. Tel: +65 6255 0808 Fax: +65 6849 9155 Email: info@ajaxinspection.com Website:www.ajaxadjusters.com Co. Reg. No.: 201318067R



Re-survey items







Note: This report is confidential and solely for the use of the client. The survey was conducted on a "Without Prejudice" basis.

AJAX Inspection Services Pte Ltd