



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

CHINA TAIPING INSURANCE (S) PTE LTD

INV No. AC2300459

3 ANSON ROAD #16-00
SPRINGLEAF TOWER
SINGAPORE 079909

INV Date 20/01/2023
Reference CC6/CTI22008532/Upa3q2
Code CTI

PROFESSIONAL SERVICE FEE

Vehicle No. SLZ 5684P
Insured Veh. SMP 2437Y
Claim No. SNM22D206205/C02
Policy No. DMHCNSA00003712200
Accident Date 30/08/2022
Inspection Date 01/09/2022

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (8%)	32.00
Grand Total	432.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
CHINA TAIPING INSURANCE (S) PTE LTD 3 ANSON ROAD #16-00 SPRINGLEAF TOWERSINGAPORE 079909			Ref: CC6/CTI22008532/Upa3q2 Date: 20/01/2023 Code: CTI	
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	SMP 2437Y	Veh. Inspected	SLZ 5684P	
Policy No.	DMHCNSA00003712200	Coverage (\$)	0.00	
Claim No.	SNM22D206205/C02	Excess (\$)	0.00	
Assign From		Assign Date	01/09/2022	
2. Vehicle Particulars & Condition				
Make & Model	LEXUS ES300H (A)	c.c	2494	
Engine No.	HIDDEN	Year of Reg.	2014	
Chassis No.	JTHBW1GG102053518	Colour	RED	
Odometer	187753 KM	Steering	IN ORDER	
Brakes	IN ORDER	Modification	SPORTS RIM	
General	GOOD			
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre	215/55 R17	YOKOHAMA	7 mm	
L/H Front Tyre	215/55 R17	YOKOHAMA	7 mm	
R/H Rear Tyre	215/55 R17	YOKOHAMA	7 mm	
L/H Rear Tyre	215/55 R17	YOKOHAMA	7 mm	
4. Description of Damages				
THE VEHICLE SUSTAINED DAMAGES AT THE REAR PORTION. DAMAGES SEE DETAILS.				
5. General Information				
Accident Date	30/08/2022	Inspection Date	01/09/2022	
Survey held at	NPH AUTO SERVICE BLK 9005 TAMPINES STREET 93 #01-246/254 SINGAPORE 528839			
5a. Remarks				
A) THE INSPECTION WAS CONDUCTED ON A "WITHOUT PREJUDICE" BASIS. B) IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
5b. Estimate Days of Repair				
ESTIMATED NORMAL PERIOD FOR REPAIR:			5 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SLZ 5684P

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	REAR BOOT (N)	DENTED / BENT	815.60	815.60
1	REAR BOOT SPOILER (N)	TO REPAIR SEE LABOUR	1,600.50	-
1	REAR BOOT LEXUS EMBLEM (N)	NECESSARY	69.60	69.60
1	REAR BOOT ES300H EMBLEM (N)	NECESSARY	75.00	75.00
1	REAR BOOT CHROME MOULDING (N)	NOT NECESSARY	348.00	-
1	REAR BOOT LOGO (N)	NECESSARY	173.70	173.70
2	REAR BOOT LAMP L & R @\$562.30 (N)	N/S CUT	1,124.60	562.30
2	REAR LAMP L & R @\$985.00 (N)	N/S CUT	1,970.00	985.00
11	REAR BOOT INNER SPONGE CLIPS @\$5.50 (N)	NOT NECESSARY	60.50	-
1	REAR BOOT LOCK TOP (N)	TWISTED / BENT	472.00	472.00
1	REAR BOOT LOCK CATCH LOWER (N)	NOT NECESSARY	47.10	-
2	REAR BOOT HINGE L & R @\$224.70 (N)	NOT NECESSARY	449.40	-
1	REAR BUMPER (N)	DISTORTED	999.40	999.40
2	REAR BUMPER SIDE RETAINER L & R @\$100.00 (N)	NECESSARY	200.00	200.00
2	REAR LAMP LOWER BUMPER RETAINER L & R @\$118.00 (N)	NECESSARY	236.00	236.00
4	REAR BUMPER PARKING SENSOR @\$490.80 (N)	SHORTED (2PCS ONLY)	1,963.20	981.60
2	REAR BUMPER REFLECTOR LAMP L & R @\$59.00 (N)	NOT NECESSARY	118.00	-
1	REAR BUMPER LOWER CENTER COWLING (N)	DISTORTED	420.80	420.80
8	REAR BUMPER LOWER CENTER COWLING CLIPS @\$6.50 (N)	NECESSARY	52.00	52.00
1	REAR BUMPER SPONGE (N)	TORN	149.90	149.90
1	REAR BUMPER REINFORCEMENT (N)	BENT	621.00	621.00
1	REAR END PANEL (N)	DENTED / BENT	752.00	752.00
1	REAR BOOT RUBBER (N)	TWISTED	226.00	226.00
1	REAR END PANEL INNER CENTER GARNISH (N)	TWISTED	382.10	382.10
1	REAR BUMPER PROTECTOR (N)	DISTORTED	185.70	185.70
4	REAR PARKING SENSOR CUP HOLDER @\$19.20 (N)	NECESSARY	76.80	76.80
1	REAR PARKING SENSOR WIRE (N)	SHORTED	840.00	840.00
1	REAR BUMPER INNER KEYLESS SENSOR (N)	SHORTED	262.20	262.20

Report Ref No. CC6/CTI22008532/Upa3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	LESS 10% DISCOUNT		-1,469.11	-953.87
			13,221.99	8,584.83
	LABOUR			
	REMOVE AND INSTALL REAR BOOT, REAR LAMP, REAR BUMPER, CUT OUT AND RENEW REAR END PANEL, KNOCKING SPARE TYRE PANEL & RESTRAIGHTEN BODY AND CHASSIS. INCLUSIVE OF THE REPAIR OF REAR BOOT SPOILER.		1,400.00	800.00
	SPRAY PAINTING PEARL RED.		1,200.00	1,080.00
	CHECK WIRING SYSTEM.		25.00	25.00
	REMOVE AND INSTALL REAR PARKING SENSOR AND RESET.		180.00	50.00
	REMOVE AND INSTALL REAR BOOT CARPET.		120.00	80.00
			2,925.00	2,035.00
	GRAND TOTAL		16,146.99	10,619.83
RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)				8,450.00

Report Ref No. CC6/CTI22008532/Upa3q2

CHUA KANG SENG

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SLZ 5684P

INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

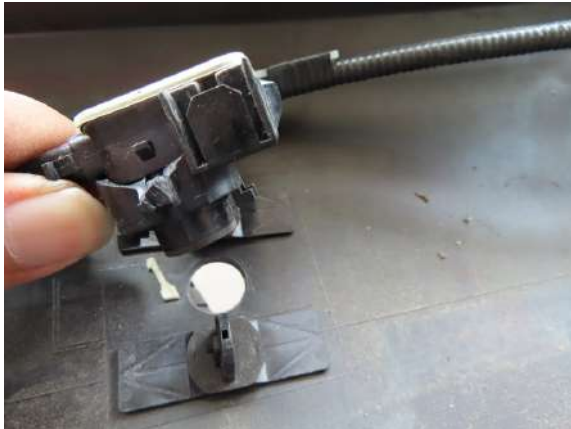




LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

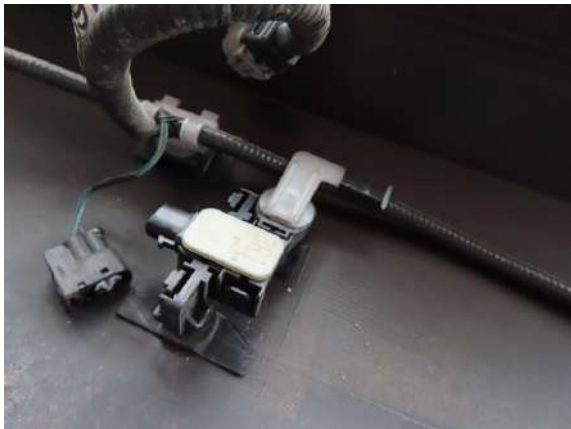



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SLZ 5684P

RE-INSPECTION

