

PAR Automotive Consultancy

Regn. No: 52986974L

Mailing Address : Blk 310 Shunfu Road #07-213, Singapore 570310. Tel : 645 31173, Fax : 645 36131.

Report No: 0057-22-SHLM

15 June 2022

ACCIDENT VEHICLE SURVEY REPORT

Lim Tiong Huang
Blk 121 Pending Road #05-160
Singapore 670121

VEHICLE INFORMATION:

<i>Vehicle Reg No.:</i>	SLM6702H	<i>Odometer:</i>	105168km
<i>Make & Model:</i>	Honda Vezel	<i>Colour:</i>	Blue
<i>Chassis number:</i>	RU11117549	<i>Date of accident:</i>	09/05/2022
<i>Year of Regn.:</i>	05/04/2017	<i>Date inspected:</i>	11/05/2022
<i>Repairer at:</i>	Sin Heng Long Motor Work	<i>Date inspected (After Repair):</i>	24/05/2022
	Blk 5032 Ang Mo Kio Ind Pk 2 #01-287/305		
	Singapore 569535		

STATIC CHECKS, where applicable:

<i>Steering :</i>	serviceable
<i>Footbrake :</i>	serviceable
<i>Handbrake :</i>	serviceable
<i>Paintwork :</i>	Good
<i>General condition :</i>	Good

TIRE CONDITION:

	<u>LH / Make</u>	<u>RH / Make</u>	<u>Size</u>
<i>Front:</i>	4mm/Kumho	4mm/Kumho	215/55R17
<i>Rear:</i>	4mm/Kumho	4mm/Kumho	215/55R17

POINT OF IMPACT AND DAMAGE, where applicable:

Impact on the RH portion.
Please see details as described in the Annex for parts and labour.

REMARKS:

We have inspected the above-mentioned vehicle on a "Without Prejudice" basis.

Parts and Labour Assessment

Report No: 0057-22-SHLM

Vehicle No: SLM6702H

Description of part	Qty	Condition as inspected	Repairer's estimate	Our adjustment
Front headlamp (HID) RH	1	fractured	1,859.40	1,859.40
Front headlamp lower bracket RH	1	bent	35.00	35.00
Front bumper	1	distorted/deformed	927.50	927.50
Front bumper lower defuser	1	fractured/deformed	351.30	351.30
Front bumper fog lamp cover RH	1	reuse	45.00	0.00
Front bumper fog lamp RH	1	reuse	327.70	0.00
Front bumper side retainer RH/LH	2	necessary	46.00	46.00
Front fender RH	1	buckled	580.00	580.00
Front fender protector RH	1	abraded/fractured	153.00	153.00
Front fender inner shield RH	1	fractured/deformed	107.90	107.90
Front fender inner shield clip RH	10	necessary	38.00	38.00
Front door RH	1	buckled	950.00	950.00
Front door lower hinge RH	1	bent	48.50	48.50
Front door frame black sticker RH	1	necessary	18.50	18.50
Front door glass outer moulding RH	1	necessary	60.00	60.00
Front door glass regulator and motor RH	1	bent/shorted	382.90	382.90
Front door inner lock RH	1	jammed	262.30	262.30
Front door weatherstrip RH	1	deformed	235.60	235.60
Front door outer handle RH	1	reuse	245.00	0.00
Front door lower weatherstrip RH	1	deformed	12.50	12.50
Rear fender RH	1	buckled	893.40	893.40
Rear fender arch protector	1	abraded	150.00	150.00
Rear door LH	1	buckled	954.70	954.70
Rear door frame black sticker RH	1	necessary	33.90	33.90
Rear door glass outer moulding RH	1	necessary	65.10	65.10
Rear door inner lock RH	1	jammed	253.30	253.30
Rear door lower weatherstrip RH	1	deformed	18.60	18.60
Rear door glass regulator/motor RH	1	shorted	445.60	445.60
Rear door glass channel weatherstrip RH	1	necessary	56.00	56.00
Rocker panel garnish RH	1	fractured	225.40	225.40
Rear shock absorber RH	1	bent	262.60	262.60
Rear wheel hub c/w bearing RH	1	dislodged	387.20	387.20
Rear axle assy	1	distorted	1,513.20	1,513.20
Rear bumper	1	grazed/deformed	863.00	863.00
Rear bumper side RH	1	abraded/deformed	195.00	195.00
Rear bumper retainer RH/LH	2	necessary	195.00	195.00

Rear tail lamp RH	1	fractured	460.00	460.00
Front shock absorber RH	1	bent	371.20	371.20
Front shock absorber top mounting RH	1	necessary	45.90	45.90
Front knuckle arm RH	1	bent	350.00	350.00
Front knuckle arm bearing RH	1	dislodged	165.90	165.90
Front lower arm RH	1	bent	300.10	300.10
Front lower arm ball joint RH	1	dislodged	98.70	98.70
Front tie rod end RH	1	dislodged	80.00	80.00
Front ABS RH	1	reuse	125.00	0.00
Front stabiliser linkage RH	1	bent	85.00	85.00

Subtotal before discount 15,279.90 14,537.20

Percentage discount 0% and 20% 0.00 2,907.44

Sub-total 1 15,279.90 11,629.76

Front bumper clip	10	necessary	35.00	35.00
Door visor RH - set	1	necessary	180.00	180.00
Front sport rim RH	1	abraded	680.00	680.00
Front tyre RH	1	abraded	350.00	350.00
Rear sport rim RH	1	abraded	680.00	680.00
Rear tyre RH	1	abraded	350.00	350.00

Subtotal before discount 2,275.00 2,275.00

Percentage discount 0% and 0% 0.00 0.00

Sub-total 2 2,275.00 2,275.00

Parts-total 17,554.90 13,904.76

LABOUR

1. To straighten and panel beating front pillar RH, center pillar LH, rocker panel RH and RH frame members. To cut and weld rear fender RH. To remove and refit above parts.	2,000.00	1,500.00
2. To putty, re-spray painting and polish affected areas.	2,200.00	1,840.00
3. To check and rectify wiring system.	80.00	50.00
4. To rust proof affected areas.	150.00	120.00
5. To remove and refit rear and front door RH components.	300.00	240.00
6. To remove and refit front suspension RH	400.00	350.00
7. To remove and refit rear suspension RH		
8. To remove and refit front and rear rim/tyre RH.	120.00	80.00
9. To conduct electronic wheel alignment test.	180.00	150.00
10. To remove and refit rearboot garnish, speaker board, roof lining and fitting.	200.00	150.00
11. To rust proof affected areas	150.00	90.00

Labour total 5,780.00 4,570.00

Parts & Labour total 23,334.90 18,474.76

Results of inspection of the accident vehicle are as shown above.

We have taken into consideration the age and condition of the vehicle in our recommendation.

Hence, the recommended cost of repairs based on LUMP SUM repairs is :
and the recommended number of working days for the repairs is :

\$14,700.00

13



B J Loi (I Eng. MIMI, AIRTE)

Automotive Appraiser






























































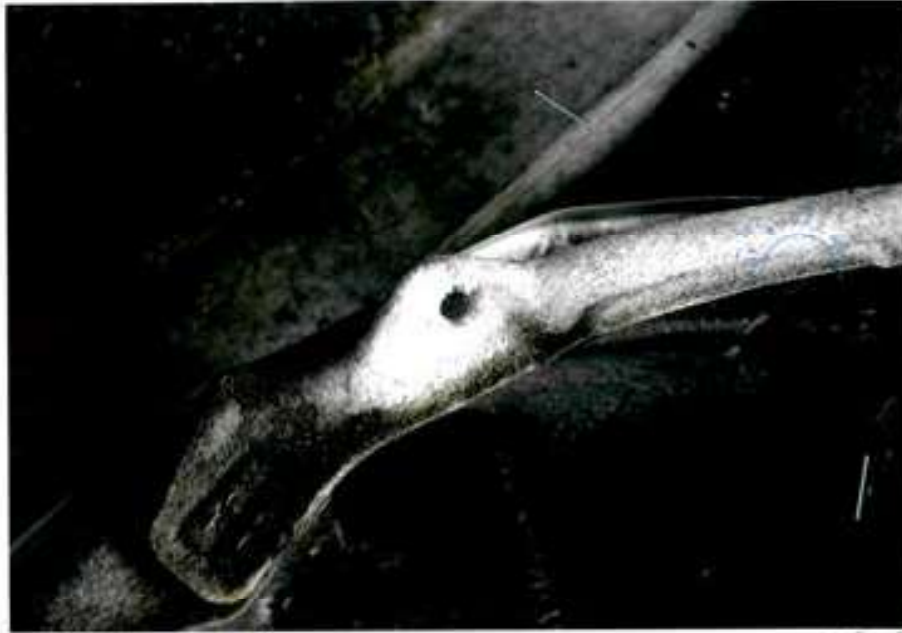












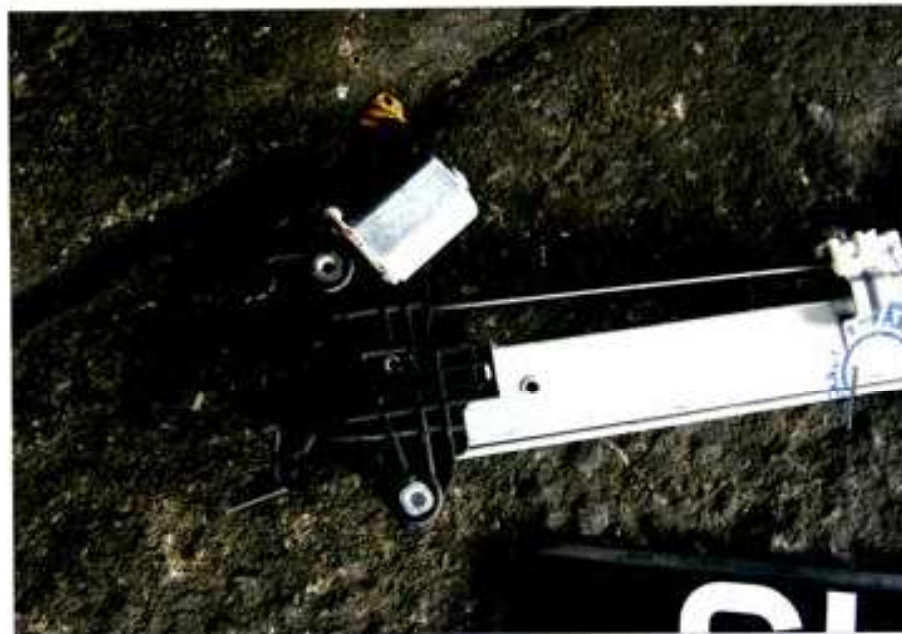































alfred_ng@juseq.com.sg

From: alfred_ng@juseq.com.sg
Sent: Tuesday, May 10, 2022 5:25 PM
To: 'MT_Claim_SG'
Cc: 'ONG LI LI'; 'GERALD POH WEE BIN'
Subject: ACCIDENT INVOLVING SLM6702H AND XE2621J ON 9 MAY 2022
Attachments: SLM6702H.pdf

Dear Sirs,

Your ref: XE2621J
Our ref: JEQ/SLM6702H/AD

We act for the owner of vehicle no. SLM6702H.

We hereby notify you of a road traffic accident on **09 May 2022** at about **0354 hrs**, along Keppel Road involving our client's vehicle and .icle registration no. XE2621J driven by you / your insured at the material time. A copy of our client's accident report is enclosed.

As a result of the accident, our client's vehicle has been damaged. Before our client proceeds to repair the damaged vehicle, please let us know within 2 working days of your receipt of this notice whether you would like to conduct a pre-repair survey of the vehicle. If we do not receive any reply from you within the stipulated timeline, our client shall proceed to repair the vehicle without further reference to you.

With Regards

Alfred Ng
Executive
Legal Division
On behalf of Mr. Caleb Tan
M/s JusEquity Law Corporation
No. 133 New Bridge Road
Chinatown Point
#10-03 Singapore 059413
Tel: 6536 9339
Fax: 6536 5368

IMPORTANT NOTICE:

This message is intended only for the attention of the addressee and may contain legally privileged and/or confidential information. Its unauthorised use, disclosure, storage or copying is not permitted. If you are not the intended recipient, please permanently delete the original, destroy all copies and inform the sender.