



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

CHINA TAIPING INSURANCE (S) PTE LTD	INV No.	AC2302306
3 ANSON ROAD #16-00	INV Date	14/04/2023
SPRINGLEAF TOWER	Reference	CC3/CTI22008636/Tya3q2
SINGAPORE 079909	Code	CTI

PROFESSIONAL SERVICE FEE

Vehicle No.	SHC 1389L
Insured Veh.	SNC 1429J
Claim No.	SNM22D206283/C02
Policy No.	DMHCSNA00012762200
Accident Date	23/08/2022
Inspection Date	23/08/2022

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (8%)	32.00
Grand Total	432.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile			
CHINA TAIPING INSURANCE (S) PTE LTD 3 ANSON ROAD #16-00 SPRINGLEAF TOWERSINGAPORE 079909		Ref: CC3/CTI22008636/Tya3q2 Date: 14/04/2023 Code: CTI	
1. Policy Particulars :- THIRD PARTY CLAIM			
Insured Veh.	SNC 1429J	Veh. Inspected	SHC 1389L
Policy No.	DMHCSNA00012762200	Coverage (\$)	0.00
Claim No.	SNM22D206283/C02	Excess (\$)	0.00
Assign From		Assign Date	23/08/2022
2. Vehicle Particulars & Condition			
Make & Model	HYUNDAI IONIQ	c.c	1580
Engine No.	HIDDEN	Year of Reg.	2018
Chassis No.	KMHC851CVKU114860	Colour	BLUE
Odometer	449129 KM	Steering	IN ORDER
Brakes	IN ORDER	Modification	NIL
General	GOOD		
3. Conditions of Tyres			
	Size	Make	Balance
R/H Front Tyre	195/65 R15	WEST LAKE	6 mm
L/H Front Tyre	195/65 R15	WEST LAKE	6 mm
R/H Rear Tyre	195/65 R15	WEST LAKE	6 mm
L/H Rear Tyre	195/65 R15	WEST LAKE	6 mm
4. Description of Damages			
THE VEHICLE SUSTAINED DAMAGES AT THE FRONT O/S PORTION. DAMAGES SEE DETAILS.			
5. General Information			
Accident Date	23/08/2022	Inspection Date	23/08/2022
Survey held at	COMFORTDELGRO ENGINEERING PTE LTD 59 LOYANG DRIVE SINGAPORE 508969		
5a. Remarks			
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.			
5b. Estimate Days of Repair			
ESTIMATED NORMAL PERIOD FOR REPAIR:		2 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 1

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SHC 1389L

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
REPLACEMENT OF PARTS				
1	FRT FENDER RH	TO REPAIR SEE LABOUR	588.80	-
1	FRT FENDER BLUE -DRIVE RH	NECESSARY	26.60	26.60
1	DAYLIGHT RH	NOT NECESSARY	642.50	-
1	DAYLIGHT GRILLE RH	NOT NECESSARY	93.45	-
1	FRT BUMPER	DEFORMED	481.10	481.10
1	FRT BUMPER UPPER MOULDING	NOT NECESSARY	368.50	-
1	FRT BUMPER SIDE BRACKET RH	NOT NECESSARY	35.00	-
10	FRT BUMPER CLIPS @\$2.20	NECESSARY	22.00	22.00
	LESS 20% DISCOUNT		-451.59	-105.94
			1,806.36	423.76
SPECIAL NETT ITEMS				
1	FRT FENDER ADV STICKER RH (SN)	CUT	100.00	100.00
			100.00	100.00
LABOUR				
	PANEL BEATING.INCLUSIVE OF THE REPAIR OF FRT FENDER RH .		800.00	350.00
	SPRAY PAINTING CHARGE.		600.00	500.00
	CHECK LIGHTINGS .	NOT NECESSARY	60.00	-
	TUFF KOTE.	NOT NECESSARY	60.00	-
			1,520.00	850.00
GRAND TOTAL			3,426.36	1,373.76
RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)				1,100.00

Report Ref No. CC3/CTI22008636/Tya3q2

MOHAMAD TAUFIKH

M.MATAI, AMSAE-A

Automotive Assessor

HO LEONG CHUAN

Automotive Assessor

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd



51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SHC 1389L

INSPECTION

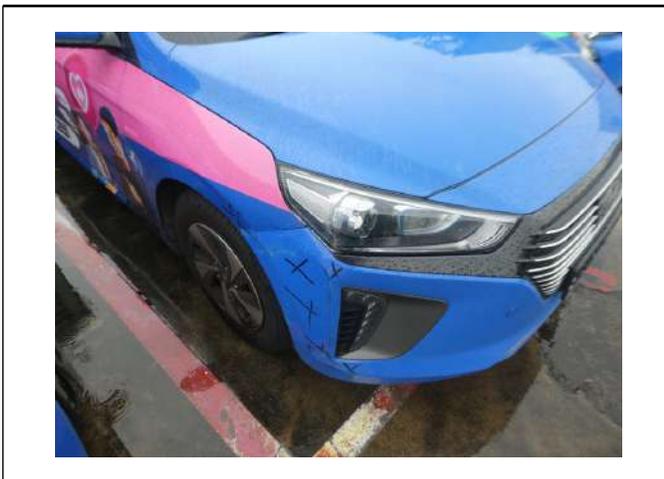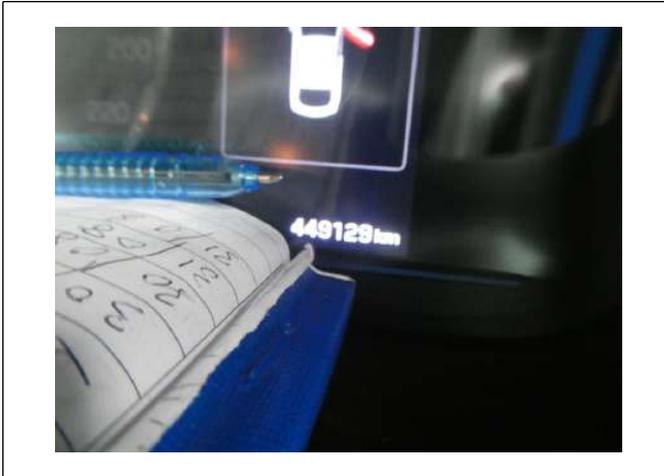






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

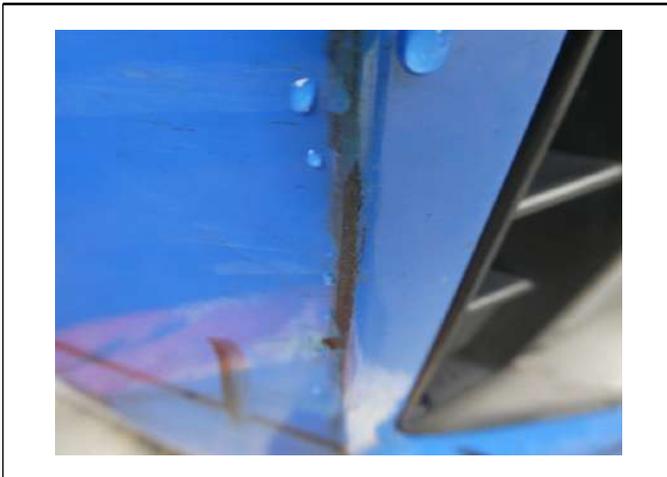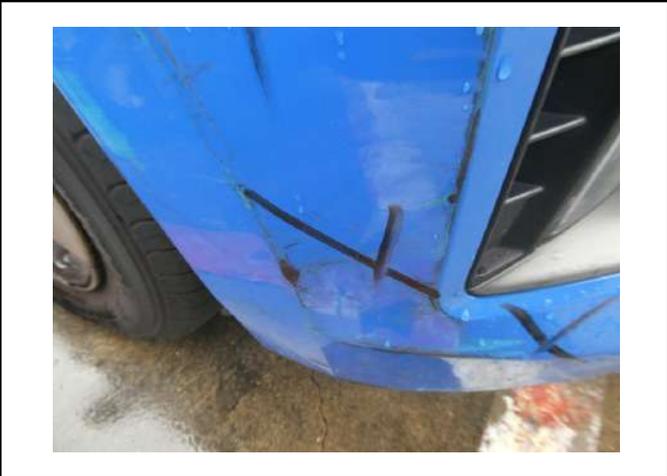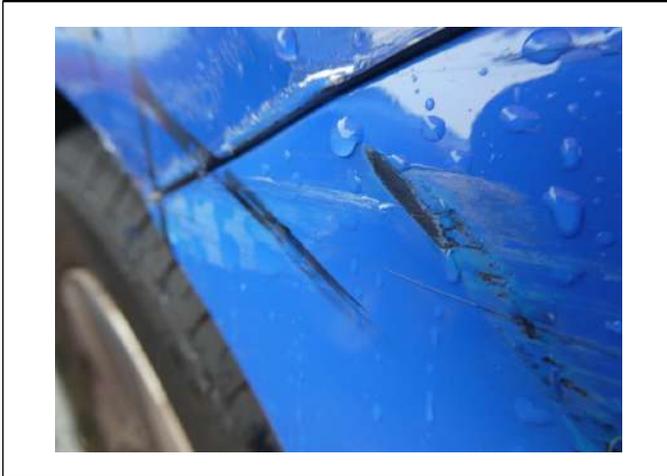






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

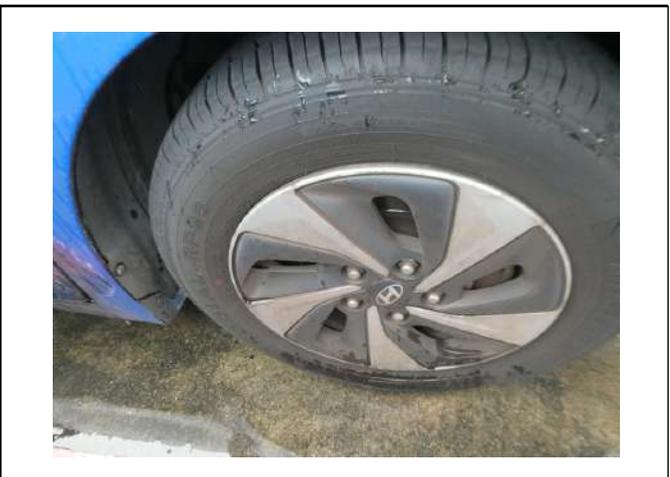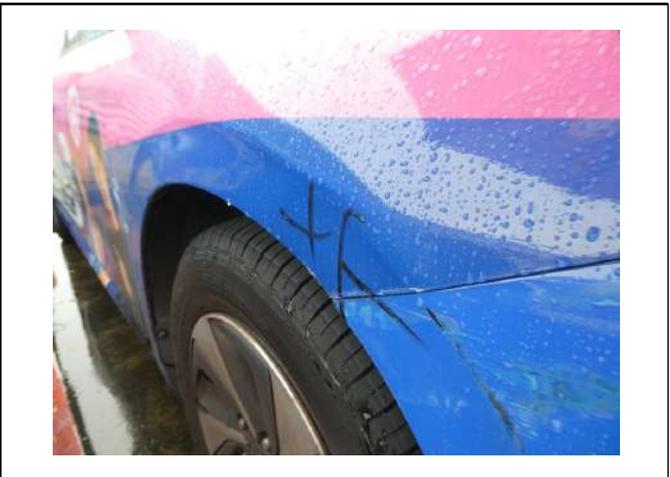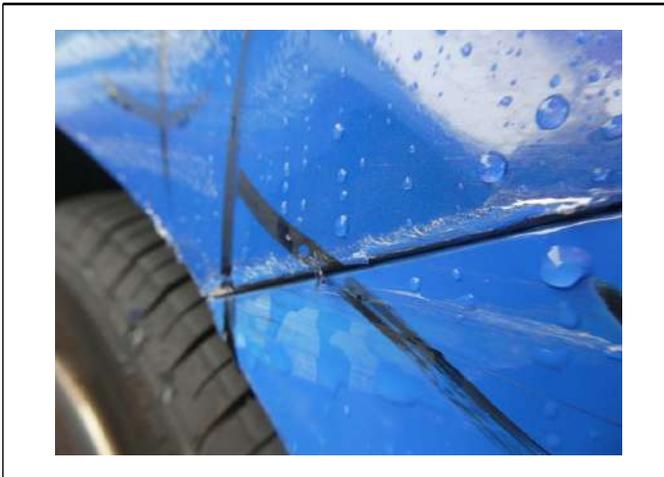



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

