



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

CHINA TAIPING INSURANCE (S) PTE LTD

INV No. AC2301158

3 ANSON ROAD #16-00
SPRINGLEAF TOWER
SINGAPORE 079909

INV Date 27/02/2023
Reference CC6/CTI22008656/Uya3q2
Code CTI

PROFESSIONAL SERVICE FEE

Vehicle No. SMC 6540Z
Insured Veh. SMP 311P
Claim No. SNM22D206478/C02
Policy No. DMHCSNA00003712200
Accident Date 03/09/2022
Inspection Date 05/09/2022

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (8%)	32.00
Grand Total	432.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
CHINA TAIPING INSURANCE (S) PTE LTD 3 ANSON ROAD #16-00 SPRINGLEAF TOWERSINGAPORE 079909			Ref: CC6/CTI22008656/Uya3q2	
			Date: 27/02/2023	
			Code: CTI	
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	SMP 311P	Veh. Inspected	SMC 6540Z	
Policy No.	DMHCSNA00003712200	Coverage (\$)	0.00	
Claim No.	SNM22D206478/C02	Excess (\$)	0.00	
Assign From		Assign Date	05/09/2022	
2. Vehicle Particulars & Condition				
Make & Model	HYUNDAI ELANTRA GLS (A)	c.c	1591	
Engine No.	HIDDEN	Year of Reg.	2018	
Chassis No.	KMHD841CMJU705215	Colour	SILVER	
Odometer	56721 KM	Steering	IN ORDER	
Brakes	IN ORDER	Modification	SPORTS RIM	
General	GOOD			
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre	195/65 R15	KAPSEN	6 mm	
L/H Front Tyre	195/65 R15	KAPSEN	6 mm	
R/H Rear Tyre	195/65 R15	KAPSEN	6 mm	
L/H Rear Tyre	195/65 R15	KAPSEN	6 mm	
4. Description of Damages				
THE VEHICLE SUSTAINED DAMAGES AT THE REAR PORTION. DAMAGES SEE DETAILS.				
5. General Information				
Accident Date	03/09/2022	Inspection Date	05/09/2022	
Survey held at	T K LEE AUTOMOTIVE PTE LTD NO. 1 KAKI BUKIT AVE 6 #02-47 AUTOBAY SINGAPORE 417883			
5a. Remarks				
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
5b. Estimate Days of Repair				
ESTIMATED NORMAL PERIOD FOR REPAIR:			5 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SMC 6540Z

Qty	Description of Parts	Condition	Initial Surveyor (\$)	Our Adjusted (\$)
<u>REPLACEMENT OF PARTS</u>				
1	REAR BOOT LID	DENTED	1,783.00	1,783.00
1	REAR BOOT LOGO	NECESSARY	42.60	42.60
1	REAR BOOT EMBLEM "ELANTRA"	NECESSARY	58.80	58.80
2	REAR BOOT LAMPS RH / LH @\$441.50	NOT NECESSARY	883.00	-
1	REAR BOOT INNER LOCK	BENT	210.60	210.60
1	REAR BOOT INNER TRIM	NOT NECESSARY	241.60	-
10	REAR BOOT INNER TRIM CLIPS @\$5.50	NOT NECESSARY	55.00	-
1	REAR BOOT W/STRIP	TWISTED	161.90	161.90
2	REAR BOOT HINGES - RH / LH @\$110.50	NOT NECESSARY	221.00	-
2	REAR BOOT STOPPER @\$10.50	NOT NECESSARY	21.00	-
1	REAR BUMPER	DENTED	571.60	571.60
1	REAR BUMPER DIFFUSER	DISTORTED	281.90	281.90
2	REAR BUMPER REFLECTOR RH / LH @\$89.90	NOT NECESSARY	179.80	-
1	REAR BUMPER REINFORCEMENT	DISTORTED	431.60	431.60
2	REAR BUMPER SIDE RETAINERS - RH / LH @\$65.50	BENT	131.00	131.00
1	REAR END PANEL	DENTED	520.60	520.60
1	REAR END PANEL GARNISH	TWISTED	161.20	161.20
1	REAR EXHAUST SILENCER	NOT NECESSARY	762.80	-
1	REAR FLOOR BOARD	NOT NECESSARY	415.90	-
2	REAR FENDER INNER TRIMS - LH / RH @\$430.60	NOT NECESSARY	861.20	-
2	REAR TAILLAMPS - RH / LH @\$551.20	CRACKED	1,102.40	1,102.40
2	REAR TAILLAMP PANELS - RH / LH @\$195.00	TO REPAIR SEE LABOUR	390.00	-
1	REAR SMART KEYLESS ANTENNA	NOT NECESSARY	191.60	-
	LESS 20% DISCOUNT		-1,936.02	-1,091.44
			7,744.08	4,365.76
<u>SPECIAL NETT ITEMS</u>				
1	SET REAR BUMPER CLIP (SN)	NECESSARY	45.00	45.00
1	SET REAR REVERSE SENSOR (SN)	SHORTED	280.00	200.00
1	REAR WEEKEND PLATE SEAL (SN)	NECESSARY	30.00	20.00

Report Ref No. CC6/CTI22008656/Uya3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Initial Surveyor (\$)	Our Adjusted (\$)
1	SET REAR NUMBER PLATE WITH HOLDER (SN)	NECESSARY	60.00	40.00
			415.00	305.00
	LABOUR			
	TO CHECK REAR ELECTRICAL WIRING.		50.00	20.00
	TO REMOVE & REFIX REAR INTERIOR TRIMS TO ASSIST REPAIR.		120.00	60.00
	TO REMOVE AND REPLACE REVERSE CAMERA & SENSORS.		80.00	50.00
	TO RESPRAY UNDERCOATING.		100.00	60.00
	TO PUTTY, SPRAY PAINT & POLISH AFFECTED PARTS.		1,080.00	900.00
	TO PANEL BEAT, CUT, WELD, REMOVE & REPLACE DAMAGED PARTS. INCLUSIVE OF THE REPAIR OF REAR TAILLAMP PANELS - RH / LH.		1,050.00	600.00
			2,480.00	1,690.00
GRAND TOTAL			10,639.08	6,360.76
RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)			0.00	5,000.00

Report Ref No. CC6/CTI22008656/Uya3q2

CHUA KANG SENG

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SMC 6540Z

INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

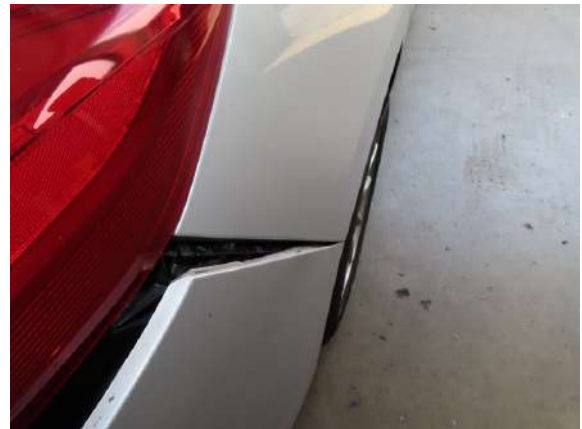



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SMC 6540Z

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SMC 6540Z

RE-INSPECTION

