

Steve

CC4/A1522008705/P93

ASSIGNMENT

From: _____ Date: _____

Estimated Cost: _____

OD ☒ WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No: _____

at Workshop m/s _____

of _____

Insured: _____

Policy No. _____

Claims No. _____

Sum Insured: _____


Excess: _____

(Client's Record)

Make of Veh: _____

(Policy Condition)

Remark: The veh had commenced its repair at the time of inspection.

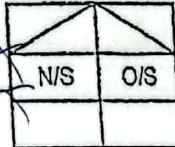

Bal. or Market Value: _____

IDAC Accident Rpt: _____ Consistent? : Yes or No

GIA / PR Seen: _____ Consistent? : Yes or No

Est. Repairs: _____ days Res.: Yes or No

Lum Sum: _____ % 3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date: _____ Person Contacted: _____

Vehicle: IN / OUT

Veh No: SKH 8588XYr Regn: 19/8/16

Type: M.Gar / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make: Porsche Macanc.c. 2997Colour: Black

A/C: Insured / Std / NI / NA

Sp. Reading 30969

T/Radio: Insured / Std / NI / NA

Eng/No: _____

C/No: WP1222952HLB 2862

Gen. Cond: Good / Fair / Poor / Burnt

Steering: In order / Jammed / Leaked / Burnt or

Brake: In order / Jammed / Leaked / Burnt or

Modi: Nil / S/Rim / STD A/Rim or

Tyre Size: F: 255/55R18R: 11

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or Pirelli

Front

Rear

R/Bal. 5 mmR/Bal. 5 mmL/Bal. 6 mmL/Bal. 5 mmD.O.A. 31/8/22D.O.I. 9/9/22Survey held at EurokarsDes. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time

Action / Instruction

MR-220X

Date/Time, File Pass to?

☐

: Prell. Report

☐

: Final Report

Date/Time, File Return to?

2)

Report Format: _____

Lump Sum / L.B.H. (%)

Days Of Repair: _____

Resurvey No. of Trip: _____

Add Fee:

☐

: Site Insp (\$

☐

: Interview (\$

☐

: Tech. Invs (\$

☐

: Weekend (\$

Survey Fee:

Transportation:

S + RS. SI

Photos

Others

Allianz Insurance Singapore Pte Ltd 79 Robinson Road #09-01 Singapore 068897 ATTN.: MOTOR CLAIMS FAX :		NAME : ADDRESS : TEL :		WIP : 35425 EXCESS : DATE: 7-Sep-22				
VEH NO :	SKH8588X	DATE IN :		CONTACT PERSON :	SHAWN 63310685			
CHASSIS NO :	WP1ZZZ95ZHLB21862	MILEAGE :		TYPE OF CLAIM :	THIRD PARTY			
MODEL :	Macan S	DATE REG.:	19-Aug-16	POLICY NO. :				
NATURE OF WORKS								
S/NO	Parts Description			QTY	1ST	SUPP	REVISED	PRICES
1	FRONT DOOR LH / <i>OD</i>	1	P95B-831-021-B -GRV					\$ 2,346.30
2	FRONT DOOR SOUND ABSORBER / <i>nc</i>	1	PPAB-837-833- -					\$ 33.30
3	DOOR CHECKER	1	P8R0-837-249-F -					\$ 106.00
4	DOOR SEAL OUTER / <i>nc</i>	1	P95B-837-911- -					\$ 266.40
5	DOOR SILL LOWER X	1	P95B-837-119-B -					\$ 155.90
6	(WH03) SEAL / <i>nc</i>	4	PAKL-437-D40- -					\$ 4.40
7	STOPPER / <i>nc</i>	4	P191-971-908- -					\$ 34.00
8	GASKET / <i>nc</i>	2	P999-911-659-40-					\$ 2.80
9	P000-043-207-67-/SEALANT (W736) / <i>nc</i>	1	P000-043-305-32-					\$ 74.90
10	BLIND RIVET NUT / <i>nc</i>	1	PN -910-167-02-					\$ 2.60
11	CLIP / <i>nc</i>	3	P8K0-837-199- -					\$ 3.30
12	P000-043-305-51-/CAVITY PRESERVATION (AK / <i>nc</i>	1	PV04-015-001-AG-					\$ 75.70
13	COMBINATION SCREW (WH03) / <i>nc</i>	2	PWHT-003-688- -					\$ 6.40
14	BLIND RIVET NUT / <i>nc</i>	2	PN -910-167-02-					\$ 5.20
15	FRONT DOOR LOWER TRIM LH / <i>cut</i>	1	P95B-898-561- -OK1					\$ 643.10
16	REAR DOOR LOWER TRIM LH / <i>cut</i>	1	P95B-898-565- -OK1					\$ 613.10
17	REPAIR KIT ADHESIVE / <i>nc</i>	1	P95B-898-633- -					\$ 118.20
18	CLIP / <i>nc</i>	8	P8K0-837-199- -					\$ 8.80
19	FRONT DOOR OUTER MOULDING LH / <i>nc</i>	1	P95B-837-475-C -GV9					\$ 151.10
20	REAR DOOR OUTER MOULDING LH	1	P95B-839-475-C -GV9					\$ 151.20
21	STONE GUARD LH / <i>nc</i>	1	P95B-854-931-A -					\$ 94.10
22	REAR DOOR LH / <i>OD</i>	1	P95B-833-021-B -GRV					\$ 2,302.50
23	DOOR CATCH	1	PPAC-839-249- -					\$ 119.50
24	HEXAGON SOCKET HEAD BOLT / <i>nc</i>	2	PWHT-003-237- -					\$ 4.20
25	DOOR SEAL OUTER LH / <i>nc</i>	1	P95B-839-911- -					\$ 259.80
26	REAR DOOR WEATHERSTRIP LH X	1	P95B-833-721-E -					\$ 294.40
27	DOOR SEAL C-PILLAR LH X	1	P95B-839-761-B -					\$ 199.30
28	REAR DOOR SEAL LOWER X	1	P95B-839-119-B -					\$ 151.40
29	STOPPER / <i>nc</i>	1	P191-971-908- -					\$ 8.50
30	GASKET / <i>nc</i>	2	P999-911-659-40-					\$ 2.80
31	P000-043-207-67-/SEALANT (W736) / <i>nc</i>	1	P000-043-305-32-					\$ 74.90
32	INSULATION / <i>nc</i>	1	P970-556-543-00-					\$ 11.40
33	CLIP / <i>nc</i>	2	P8K0-837-199- -					\$ 2.20

34	COMBINATION SCREW (WH03) <i>✓ ne</i>	2	PWHT-003-688-			\$	6.40
35	P000-043-305-51-/CAVITY PRESERVATION (AK <i>✓ ne</i>	1	PV04-015-001-AG-			\$	75.70
36		0	0			\$	-
TOTAL PARTS							\$ 8,409.80
TOTAL PARTS COST							\$ 8,409.80

SUPPLEMENTARY

NO	DESCRIPTION	QTY	PARTS NO	1st	Supp	REVISED	PRICES
1							
2							
3							
Labour Description							
1	TO REMOVE /REPLACE FRT DOOR LH, REAR DOOR LH, & ALL ACCIDENT DAMAGE PARTS					3120	\$ 4,680.00
	TO REPAIR ALL AREAS AFFECTED BY THE ACCIDENT. <i>1560</i>						
2	TO RESPRAY FRT DOOR LH, REAR DOOR LH. <i>1100 x 2 (add rear LH spray)</i>					2200	\$ 2,400.00
3	TO CARRY-OUT BODY CAVITY PRESERVATION.					150	\$ 250.00
4	TO TRANSFER THE FRT DOOR LH & REAR DOOR LH MECHANISM.					NETT	\$ 1,560.00
5	TO APPLY SPECIAL CERAMIC COATING. (PRICE TO BE ADVISE) <i>(Invoice & Sdr agent)</i>					NETT	
6	TO CHECK ELECTRICAL SYSTEM FOR PROPER FUNCTIONING.					150	\$ 250.00
7	TO REPROGRAMME AFTER THE ACCIDENT REPAIR WORKS.					NETT	\$ 600.00
8	SUNDRIES.					NETT	\$ 50.00

REMARKS:

THIS IS ONLY AN ESTIMATE FROM VISUAL INSPECTION AND SHOULD THERE BE MORE DAMAGES FOUND DURING THE PROCESS OF REPAIRING, YOU WILL BE INFORMED BEFORE THE REPAIRS ARE BEING CARRIED OUT.

TAKE NOTE THAT SHOULD YOU DECIDE NOT TO PROCEED WITH THE REPAIRS, A QUOTATION FEE OF \$400.00 WILL BE APPLY AS ACCORDINGLY FOR MAN-HOURS INVOLVED IN SOURCING FOR PARTS PRICE AS WELL AS LABOUR CHARGES.

TOTAL LABOUR	\$ -	\$ 9,790.00
TOTAL PARTS	\$ -	\$ 8,409.80
TOTAL	\$ -	\$ 18,199.80
LESS EXCESS	\$ -	\$ -
TOTAL AFTER EXCESS	\$ -	\$ 18,199.80
GST 7%	\$ -	\$ 1,273.99
GRAND TOTAL	\$ -	\$ 19,473.79

Steve (LKK)
9/9/22, 10.00

m n
6 Apr
PIP
M R S

EUROKARS AUTO PTE LTD

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Authorised Signature

Acknowledged by Repairer

Signature:

Date: