



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

CHINA TAIPING INSURANCE (S) PTE LTD	INV No.	AC2301452
3 ANSON ROAD #16-00	INV Date	10/03/2023
SPRINGLEAF TOWER	Reference	CC6/CTI22008828/Uya3q2
SINGAPORE 079909	Code	CTI

PROFESSIONAL SERVICE FEE

Vehicle No.	GBG 2510X
Insured Veh.	YP 9592T
Claim No.	SNM22D206436 /C02
Policy No.	DMCVSNA00103912204
Accident Date	06/09/2022
Inspection Date	08/09/2022

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (8%)	32.00
Grand Total	432.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile			
CHINA TAIPING INSURANCE (S) PTE LTD 3 ANSON ROAD #16-00 SPRINGLEAF TOWERSINGAPORE 079909		Ref: CC6/CTI22008828/Uya3q2 Date: 10/03/2023 Code: CTI	
1. Policy Particulars :- THIRD PARTY CLAIM			
Insured Veh.	YP 9592T	Veh. Inspected	GBG 2510X
Policy No.	DMCVSNA00103912204	Coverage (\$)	0.00
Claim No.	SNM22D206436 /C02	Excess (\$)	0.00
Assign From		Assign Date	08/09/2022
2. Vehicle Particulars & Condition			
Make & Model	NISSAN NV200 (M)	c.c	1461
Engine No.	HIDDEN	Year of Reg.	2017
Chassis No.	VSKYBAM20Z0144919	Colour	SILVER
Odometer	119545 KM	Steering	IN ORDER
Brakes	IN ORDER	Modification	NIL
General	GOOD		
3. Conditions of Tyres			
	Size	Make	Balance
R/H Front Tyre	175/70 R14	FALKEN	6 mm
L/H Front Tyre	175/70 R14	FALKEN	6 mm
R/H Rear Tyre	175/70 R14	GOODYEAR	6 mm
L/H Rear Tyre	175/70 R14	GOODYEAR	6 mm
4. Description of Damages			
THE VEHICLE SUSTAINED DAMAGES AT THE FRONT PORTION. DAMAGES SEE DETAILS.			
5. General Information			
Accident Date	06/09/2022	Inspection Date	08/09/2022
Survey held at	FASTECH AUTO PTE LTD 1 KAKI BUKIT AVENUE 6 #01-46/48/50 AUTOBAY SINGAPORE 417883		
5a. Remarks			
A) THE INSPECTION WAS CONDUCTED ON A "WITHOUT PREJUDICE" BASIS. B) IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.			
5b. Estimate Days of Repair			
ESTIMATED NORMAL PERIOD FOR REPAIR:		5 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. GBG 2510X

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
<u>REPLACEMENT OF PARTS</u>				
1	FRONT BUMPER (N)	GRAZED	945.20	632.20
1	FRONT BUMPER SIDE RETAINER N/S (N)	BENT	66.50	35.00
1	FRONT BUMPER BEAM (N)	NOT NECESSARY	315.00	-
1	FRONT BUMPER SPONGE (N)	TORN	188.00	145.00
1	HEADLAMP N/S (N)	BROKEN	1,650.00	565.20
1	HEADLAMP LOWER GARNISH N/S (N)	TORN	605.00	348.00
1	FRONT GRILLE (N)	CRACKED	588.10	381.30
1	FRONT FENDER N/S (N)	TO REPAIR SEE LABOUR	645.10	-
1	FRONT FENDER INNER SHIELD N/S (N)	NOT NECESSARY	182.50	-
1	BONNET (N)	DENTED / BUCKLED	1,266.00	1,066.20
2	BONNET HINGES @\$165.00 (N)	TWISTED	330.00	230.00
1	BONNET LOCK (N)	NOT NECESSARY	166.00	-
1	BONNET INSULATOR (N)	NOT NECESSARY	282.00	-
1	FRONT SUPPORT PANEL (N)	DENTED / BENT	845.20	645.00
1	AIR CON CONDENSER (N)	PUNCTURE	1,522.00	820.00
1	AIR CON CONDENSER SIDE GARNISH N/S (N)	DEFORMED / TORN	186.00	128.00
1	RADIATOR (N)	BENT / PUNCTURE	1,755.20	805.00
	LESS 10% DISCOUNT		-	-580.09
			11,537.80	5,220.81
<u>SPECIAL NETT ITEMS</u>				
1	SET FRONT BUMPER CLIPS (SN)	NECESSARY	30.00	30.00
1	SET FRONT FENDER INNER SHIELD CLIPS O/S (SN)	NOT NECESSARY	30.00	-
1	SET BONNET INSULATOR CLIPS (SN)	NECESSARY	50.00	50.00
1	FRONT LICENCE PLATE (SN)	NOT NECESSARY	50.00	-
			160.00	80.00
<u>LABOUR</u>				
	TO CHECK WIRING.		50.00	20.00
	TO SPRAY RUST PROOFING.		100.00	60.00
	TO REFILL AIR CON GAS.		120.00	100.00

Report Ref No. CC6/CTI22008828/Uya3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	TO DIAGNOSTIC & REPROGRAMME SYSTEM.	NOT NECESSARY	180.00	-
	TO CONDUCT WHEEL ALIGNMENT.	NOT NECESSARY	100.00	-
	LABOUR FOR PANEL BEATING & REPLACED PARTS. INCLUSIVE OF THE REPAIR OF FRONT FENDER N/S.		900.00	800.00
	TO PUTTY & SPRAY PAINTING.		1,080.00	800.00
			2,530.00	1,780.00
	GRAND TOTAL		14,227.80	7,080.81
	RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)			5,600.00

Report Ref No. CC6/CT122008828/Uya3q2

CHUA KANG SENG

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd



51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. GBG 2510X

INSPECTION

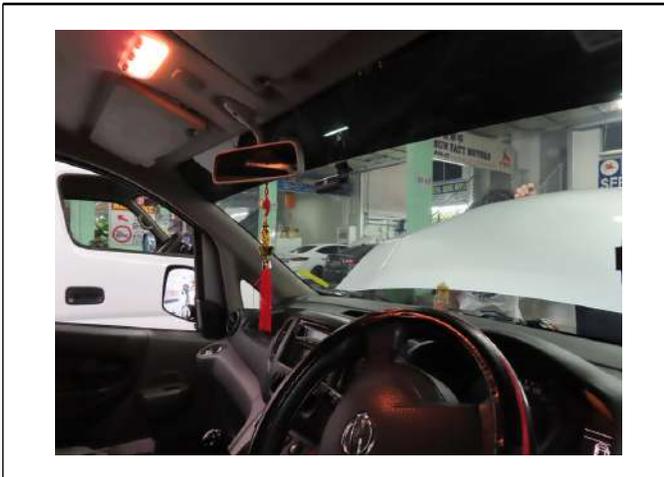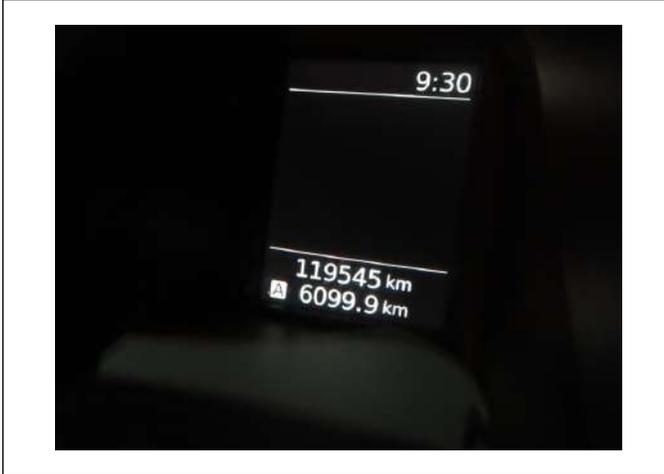





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

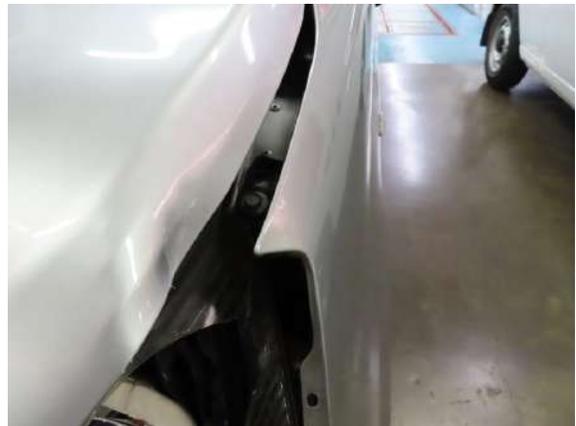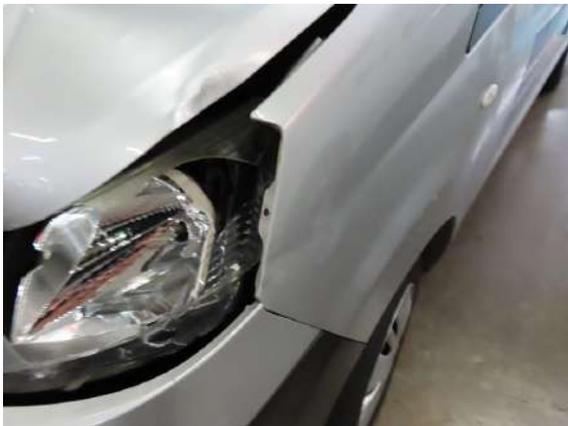



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

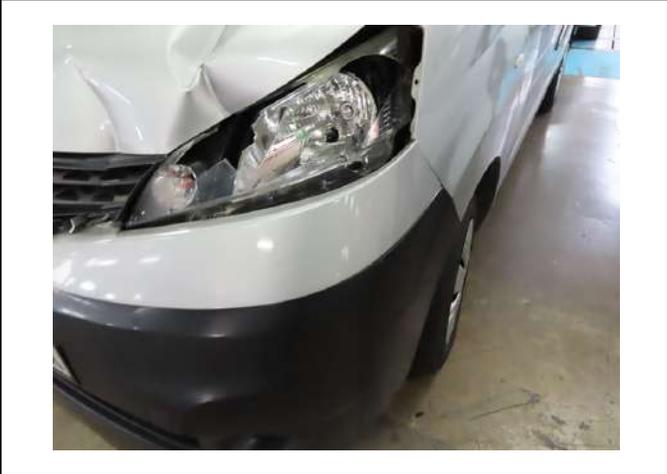



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R







LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

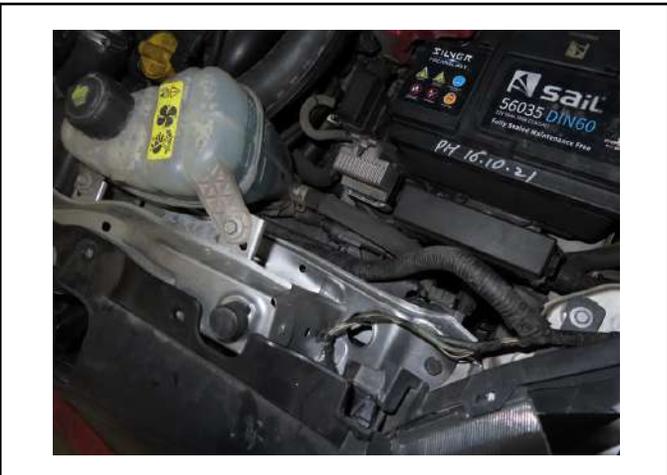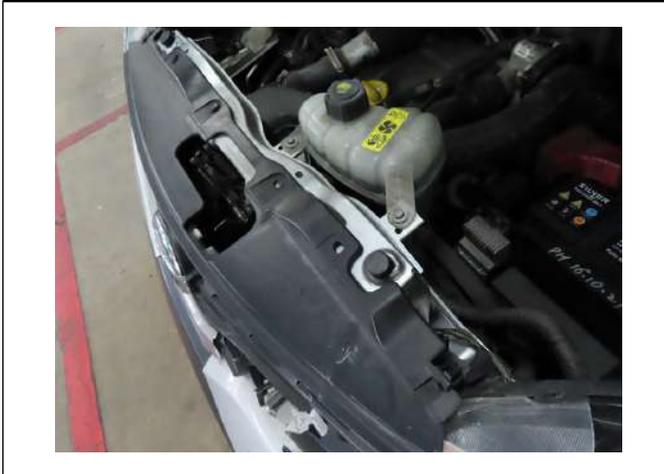




LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

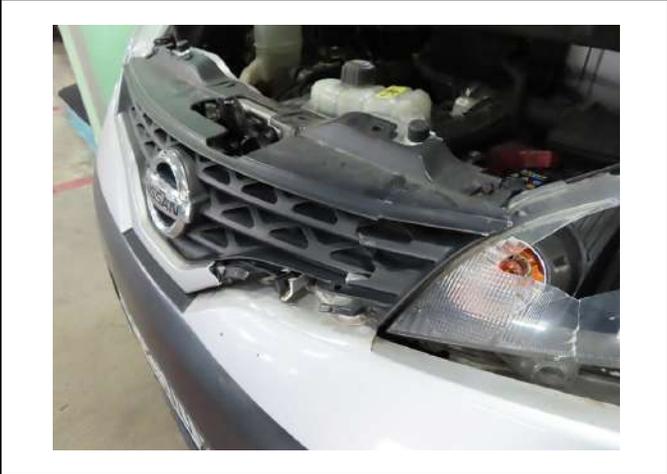



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R










LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

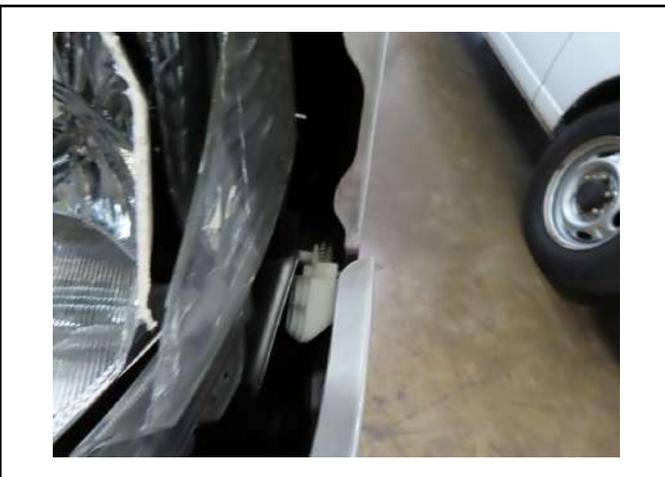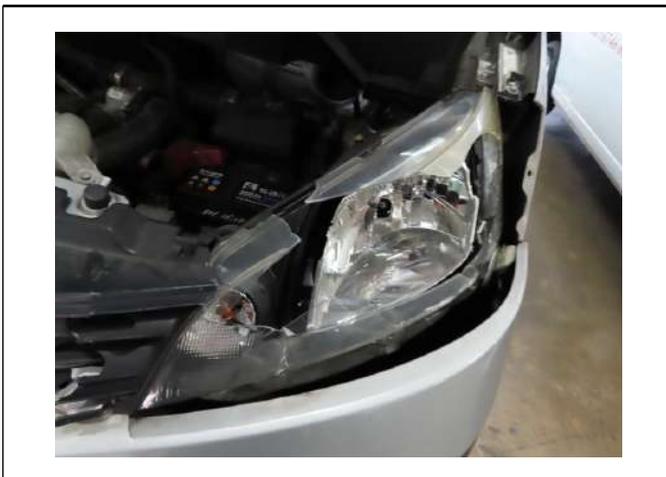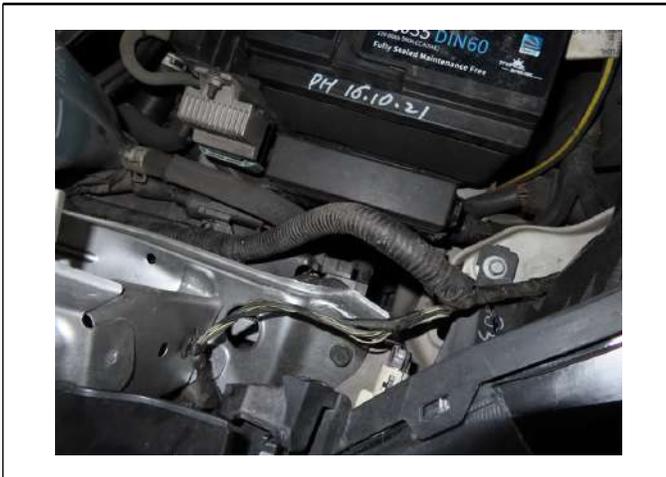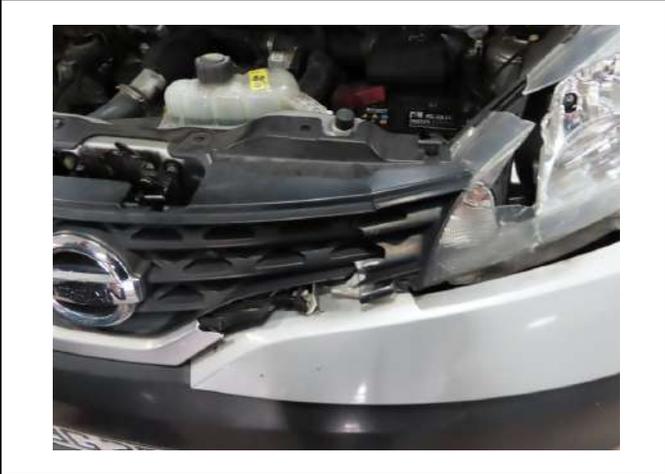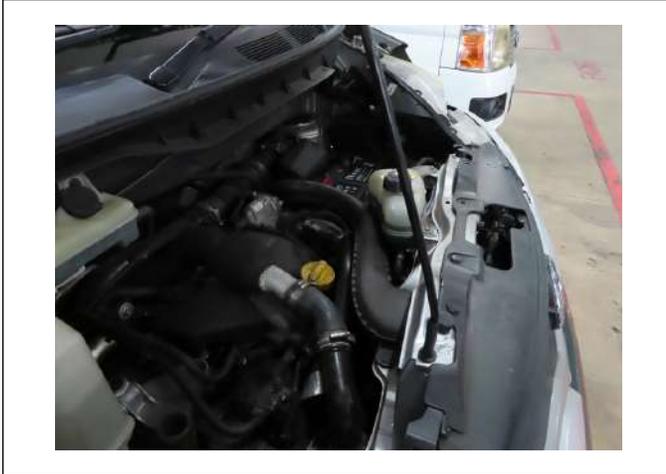





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

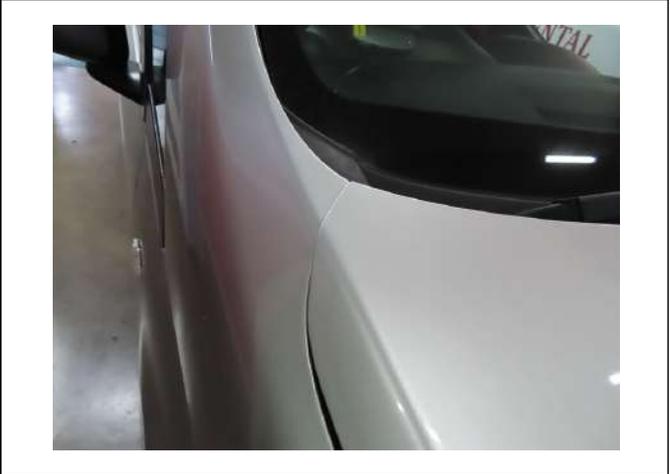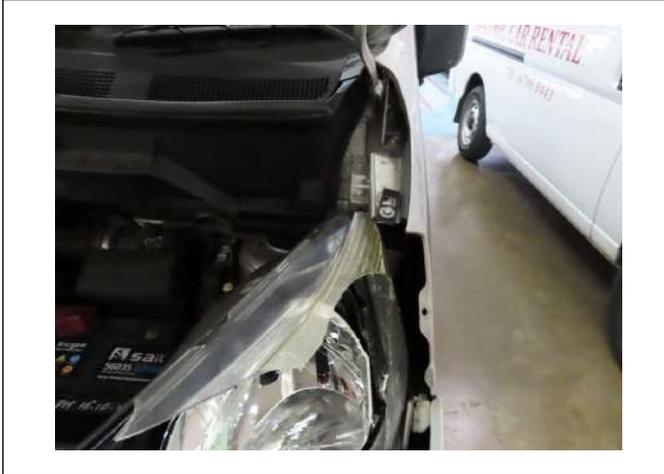



LKK Auto Consultants Pte Ltd


51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. GBG 2510X

RE-INSPECTION

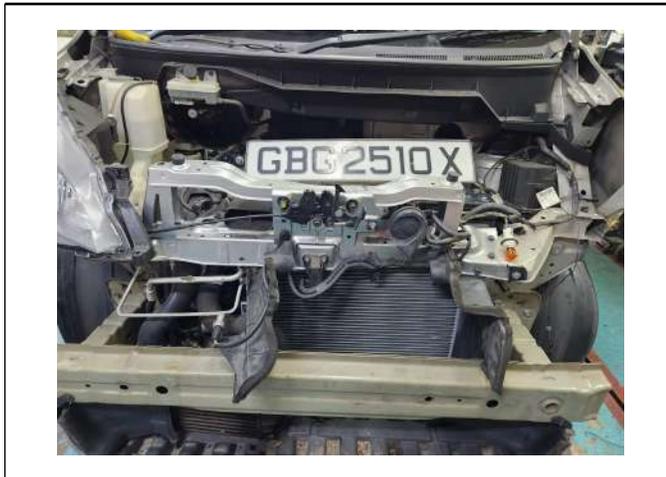



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. GBG 2510X

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

