



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

CHINA TAIPING INSURANCE (S) PTE LTD	INV No.	AC2302795
3 ANSON ROAD #16-00	INV Date	04/05/2023
SPRINGLEAF TOWER	Reference	CC6/CTI22008854/Kya3q2
SINGAPORE 079909	Code	CTI

PROFESSIONAL SERVICE FEE

Vehicle No.	SKU 9933H
Insured Veh.	SMS 2199T
Claim No.	SNM22D206394/C02
Policy No.	DMPCSNW00234702100
Accident Date	07/09/2022
Inspection Date	08/09/2022

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (8%)	32.00
Grand Total	432.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile			
CHINA TAIPING INSURANCE (S) PTE LTD 3 ANSON ROAD #16-00 SPRINGLEAF TOWERSINGAPORE 079909		Ref: CC6/CTI22008854/Kya3q2 Date: 04/05/2023 Code: CTI	
1. Policy Particulars :- THIRD PARTY CLAIM			
Insured Veh.	SMS 2199T	Veh. Inspected	SKU 9933H
Policy No.	DMPCSNW00234702100	Coverage (\$)	0.00
Claim No.	SNM22D206394/C02	Excess (\$)	0.00
Assign From		Assign Date	08/09/2022
2. Vehicle Particulars & Condition			
Make & Model	TOYOTA VIOS (A)	c.c	1497
Engine No.	HIDDEN	Year of Reg.	2009
Chassis No.	MR053HY9305097318	Colour	ORANGE
Odometer	209373 KM	Steering	IN ORDER
Brakes	IN ORDER	Modification	IN ORDER
General	GOOD		
3. Conditions of Tyres			
	Size	Make	Balance
R/H Front Tyre	195/55 R15	DUNLOP	8 mm
L/H Front Tyre	195/55 R15	DUNLOP	8 mm
R/H Rear Tyre	195/55 R15	DUNLOP	8 mm
L/H Rear Tyre	195/55 R15	DUNLOP	8 mm
4. Description of Damages			
THE VEHICLE SUSTAINED DAMAGES AT THE O/S FRONT PORTION AND UNDERCARRIAGE. DAMAGES SEE DETAILS.			
5. General Information			
Accident Date	07/09/2022	Inspection Date	08/09/2022
Survey held at	TSR AUTOMOTIVE PTE LTD 160 SIN MING DRIVE #06-01 SIN MING AUTOCITY SINGAPORE 575722		
5a. Remarks			
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.			
5b. Estimate Days of Repair			
ESTIMATED NORMAL PERIOD FOR REPAIR:		5 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SKU 9933H

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
REPLACEMENT OF PARTS				
1	FRONT RH DOOR (NPA)	TO REPAIR SEE LABOUR	-	-
1	FRONT RH FENDER	BENT	386.80	386.80
1	FRONT RH FENDER UNDERSHIELD	DISTORTED	280.00	141.00
1	FRONT RH FENDER EMBLEM	NECESSARY	120.00	48.00
1	FRONT RH FENDER INNER PANEL (NPA)	TO REPAIR SEE LABOUR	-	-
1	FRONT RH W/SCREEN SIDE PILLAR (NPA)	TO REPAIR SEE LABOUR	-	-
1	FRONT SUPPORT PANEL	TO REPAIR SEE LABOUR	980.00	-
1	BONNET (NPA)	TO REPAIR SEE LABOUR	-	-
1	HEADLAMP RH	CRACKED	620.00	525.00
1	HEADLAMP LOWER BRACKET RH	SERVICEABLE	180.00	-
1	FRONT BUMPER	MTG CRACKED	596.30	425.00
1	FRONT BUMPER LOWER COVER RH	SERVICEABLE	280.00	-
1	FRONT BUMPER RETAINER RH	DISTORTED	181.45	181.45
1	FRONT RH WHEELHUB }	BENT	388.50	275.10
1	FRONT RH WHEEL BEARING }	NECESSARY	298.60	-
1	FRONT RH SUSPENSION	BENT	522.30	393.70
1	FRONT RH SUSPENSION TOP MOUNTING	SERVICEABLE	260.00	-
1	FRONT RH LOWER ARM	BENT	378.50	378.50
1	FRONT RH KNUCKLE ARM	BENT	388.45	388.45
1	FRONT RH STABILIZER BAR	SERVICEABLE	296.00	-
1	FRONT RH STABILIZER BAR LINK	DISTORTED	168.00	168.00
1	FRONT RH TIE ROD	SERVICEABLE	223.00	-
1	FRONT RH TIE ROD END	SERVICEABLE	165.00	-
	LESS 25% DISCOUNT		-1,678.23	-827.75
			5,034.67	2,483.25
1	FRONT RH DRIVE SHAFT (LOCAL REPAIR) (SN)	DENTED	2,240.00	600.00

Report Ref No. CC6/CTI22008854/Kya3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	LESS 25% DISCOUNT		-560.00	-
			1,680.00	600.00
	<u>SPECIAL NETT ITEMS</u>			
10	FRONT BUMPER CLIPS (SN)	NECESSARY	45.00	45.00
10	FRONT RH FENDER UNDERSHIELD CLIPS (SN)	NECESSARY	45.00	45.00
1	FRONT RIM RH (SN)	DENTED	800.00	300.00
1	FRONT TYRE RH (\$200.00) (70%) (SN)	TORN	400.00	140.00
			1,290.00	530.00
	<u>LABOUR</u>			
	LABOUR CHARGE TO REPAIR REPLACE ACCIDENT AFFECTED BODY PARTS.		1,200.00	500.00
	TO CHECK FRONT WIRING SYSTEM ,FORCUS HEADLAMP ETC.		120.00	20.00
	TO DO ANTI RUST FOR ACCIDENT AFFECTED AREA .		120.00	30.00
	TO CHECK AND REPLACE FRONT UNDERCARRIAGE.		300.00	200.00
	TO DO COMPUTER WHEEL ALIGNMENT BEFORE REPAIR AND AFTER REPAIR .		160.00	60.00
	TO DO SPRAY PAINTING ON ACCIDENT AFFECTED AREA (INNER AND OUTER).		1,200.00	600.00
			3,100.00	1,410.00
	GRAND TOTAL		11,104.67	5,023.25
	RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)			4,000.00

Report Ref No. CC6/CTI22008854/Kya3q2

KONG SENG CHEONG

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SKU 9933H

INSPECTION






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

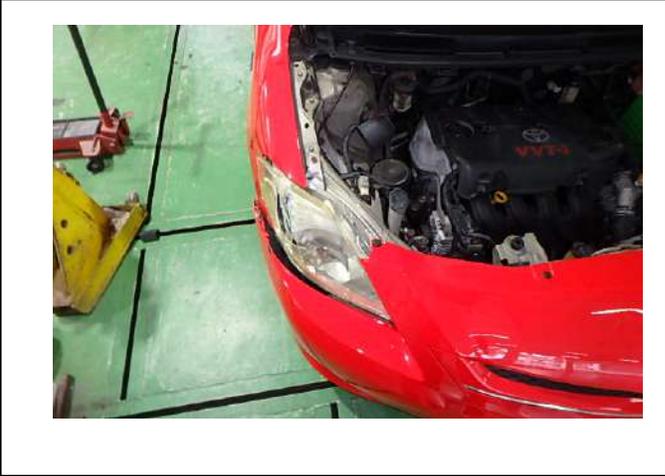



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R



TOYOTA MOTOR CORPORATION
MODEL NCP93R-BEPRK1
ENGINE 1NZ-EE 1497 mL
FRAME No. MR053HY9305097318
COLOR TRIM PLANT GVM(kg)
6JA EE10 Z35 -
MADE IN THAILAND
U-40E-02A DEC 08
V.O. BY: TOYOTA MOTOR THAILAND CO., LTD. MADE IN THAILAND



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SKU 9933H

RE-INSPECTION

