



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

CHINA TAIPING INSURANCE (S) PTE LTD	INV No.	AC2301160
3 ANSON ROAD #16-00	INV Date	27/02/2023
SPRINGLEAF TOWER	Reference	CC6/CTI22008866/Aya3q2
SINGAPORE 079909	Code	CTI

PROFESSIONAL SERVICE FEE

Vehicle No.	SMA 7193X
Insured Veh.	SJJ 2269H
Claim No.	SNM22D205334/C02
Policy No.	DMPCSNW00069852000
Accident Date	28/07/2022
Inspection Date	12/09/2022

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (8%)	32.00
Grand Total	432.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile			
CHINA TAIPING INSURANCE (S) PTE LTD 3 ANSON ROAD #16-00 SPRINGLEAF TOWERSINGAPORE 079909		Ref: CC6/CTI22008866/Aya3q2 Date: 27/02/2023 Code: CTI	
1. Policy Particulars :- THIRD PARTY CLAIM			
Insured Veh.	SJJ 2269H	Veh. Inspected	SMA 7193X
Policy No.	DMPCSNW00069852000	Coverage (\$)	0.00
Claim No.	SNM22D205334/C02	Excess (\$)	0.00
Assign From		Assign Date	12/09/2022
2. Vehicle Particulars & Condition			
Make & Model	TOYOTA C-HR	c.c	1797
Engine No.	HIDDEN	Year of Reg.	2018
Chassis No.	ZYX102112314	Colour	BLUE
Odometer	92115 KM	Steering	IN ORDER
Brakes	IN ORDER	Modification	SPORTS RIM
General	GOOD		
3. Conditions of Tyres			
	Size	Make	Balance
R/H Front Tyre	235/50 R18	MICHELIN	6 mm
L/H Front Tyre	235/50 R18	MICHELIN	6 mm
R/H Rear Tyre	235/50 R18	MICHELIN	6 mm
L/H Rear Tyre	235/50 R18	MICHELIN	6 mm
4. Description of Damages			
THE VEHICLE SUSTAINED DAMAGES AT THE REAR PORTION. DAMAGES SEE DETAILS.			
5. General Information			
Accident Date	28/07/2022	Inspection Date	12/09/2022
Survey held at	RYDER AUTO PTE LTD 2 KAKI BUKIT AVE 2 #02-19/22 KAKI BUKIT AUTOHUB SINGAPORE 417921		
5a. Remarks			
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.			
5b. Estimate Days of Repair			
ESTIMATED NORMAL PERIOD FOR REPAIR:		4 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 3

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SMA 7193X

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
REPLACEMENT OF PARTS				
1	REAR BUMPER	DEFORMED	780.10	780.10
1	REAR BUMPER DIFFUSER	DEFORMED	520.10	465.00
1	REAR BUMPER DIFFUSER TOW COVER	NOT NECESSARY	80.00	-
1	REAR BUMPER ENFORCEMENT	DENTED	580.90	382.00
2	REAR BUMPER O/S & N/S RETAINER	NOT NECESSARY	145.00	-
1	REAR END PANEL	TO REPAIR SEE LABOUR	780.90	-
1	REAR END PANEL INNER TRIM	NOT NECESSARY	378.90	-
2	REAR O/S & N/S TAIL LAMP	NOT NECESSARY	1,578.20	-
2	REAR O/S & N/S TAIL LAMP RETAINER	NOT NECESSARY	168.90	-
2	REAR O/S & N/S TAIL LAMP SIDE GARNISH	NOT NECESSARY	130.00	-
1	REAR BOOT COVER	DENTED	1,517.90	1,112.00
1	REAR BOOT COVER WEATHERSTRIP	CUT	370.90	370.90
1	REAR BOOT COVER EMBLEM	NOT NECESSARY	71.70	-
1	REAR BOOT COVER 'CHR' EMBLEM	NOT NECESSARY	71.90	-
1	REAR BOOT COVER 'HYBRID' EMBLEM	NOT NECESSARY	82.50	-
1	REAR BOOT COVER 'TOYOTA' STICKER	NOT NECESSARY	69.80	-
1	REAR BOOT COVER INNER TRIM	NOT NECESSARY	890.10	-
1	REAR BOOT COVER LOCK (UPPER)	DAMAGED	770.10	389.00
1	REAR BOOT COVER LOCK (LOWER)	NOT NECESSARY	220.90	-
1	REAR BOOT COVER LOCK SWITCH (OUTER)	NOT NECESSARY	380.90	-
1	REAR BOOT COVER LOCK SWITCH (INNER)	NOT NECESSARY	370.90	-
2	REAR BOOT COVER O/S & N/S REFLECTOR	NOT NECESSARY	1,357.80	-
2	REAR O/S & N/S FENDER WHEEL GUARD	NOT NECESSARY	240.00	-
6	REAR O/S & N/S FENDER WHEEL GUARD CLIPS (NPA)	NOT NECESSARY	-	-
2	REAR O/S & N/S FENDER INNER TRIM	NOT NECESSARY	1,578.20	-
1	REAR TOP COVER COMPARTMENT	NOT NECESSARY	460.00	-
1	REAR SPARE WHEEL SPONGE MIDDLE	NOT NECESSARY	378.10	-
2	REAR SPARE WHEEL O/S & N/S SPONGE	NOT NECESSARY	740.20	-
1	REAR N/S STONE GUARD	NOT NECESSARY	378.90	-

Report Ref No. CC6/CTI22008866/Aya3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	LESS 25% DISCOUNT		-3,773.45	-874.75
			11,320.35	2,624.25
	<u>SPECIAL NETT ITEMS</u>			
10	REAR BUMPER CLIPS (SN)	NECESSARY	40.00	40.00
2	REAR O/S & N/S BUMPER REFLECTOR (ACCESSORY) (SN)	NOT NECESSARY	600.00	-
1	REAR BUMPER LOWER BODY KIT (SN)	DEFORMED	1,500.00	700.00
2	REAR REVERSE SENSOR (SN)	DAMAGED	280.00	200.00
4	REAR END PANEL INNER TRIM CLIPS (SN)	NOT NECESSARY	20.00	-
11	REAR BOOT COVER INNER TRIM CLIPS (SN)	NOT NECESSARY	44.00	-
16	REAR O/S & N/S FENDER INNER TRIM CLIPS (SN)	NOT NECESSARY	64.00	-
1	REAR WINDSCREEN SEALANT (SN)	NECESSARY	60.00	60.00
1	REAR WINDSCREEN MOULDING (SN)	NECESSARY	240.00	165.00
1	REAR REGN NO PLATE (SN)	NOT NECESSARY	130.00	-
1	REAR REGN NO PLATE BRACKET (SN)	NOT NECESSARY	25.00	-
			3,003.00	1,165.00
	<u>LABOUR</u>			
	TO DISMANTLE DAMAGED PARTS ,STRAIGHTEN & WELDING .INCLUSIVE OF THE REPAIR OF REAR END PANEL .		1,600.00	500.00
	TO SPRAY PAINTING .		1,000.00	500.00
	TO REMOVE & REFIT REAR EXHAUST TO FACILITATE REPAIR .	NOT NECESSARY	100.00	-
	TO REMOVE & REFIT REAR WINDSCREEN ,REAR SEATS & ROOF LINING TO FACILITATE REPAIR .	NOT NECESSARY	280.00	-
	TO REMOVE & REPLACE REFIT REVERSE SENSOR CAMERA.		50.00	50.00
	TO REMOVE AND REPLACE REAR TAIL GATE .(FITTINGS)		80.00	50.00
	TO CHECK FOR FAULT CODE AND RE-SET ELECTRICAL SYSTEM.	NOT NECESSARY	180.00	-
	TO CHECK WIRING.		100.00	30.00



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:3 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	TO RE-SEAL ANTI RUST.	NOT NECESSARY	100.00	-
			3,490.00	1,130.00
GRAND TOTAL			17,813.35	4,919.25
RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)				3,900.00

Report Ref No. CC6/CTI22008866/Aya3q2

ADRIAN LING WAI PING

B.Eng,AMSOE,AMIRTE,AMSAE-A,M.MATAI

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SMA 7193X

INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

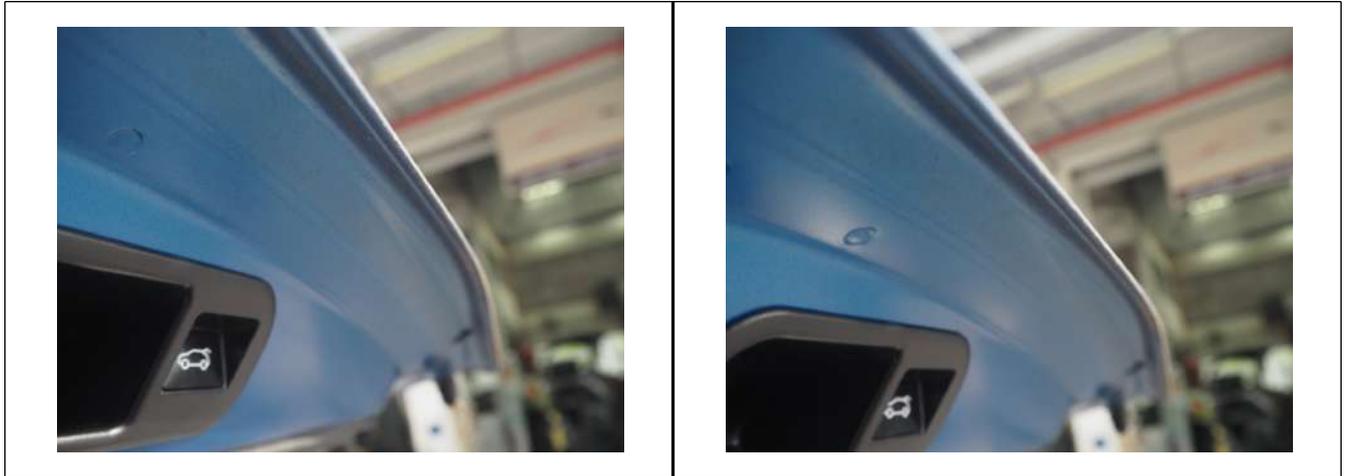



LKK Auto Consultants Pte Ltd


51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SMA 7193X

RE-INSPECTION

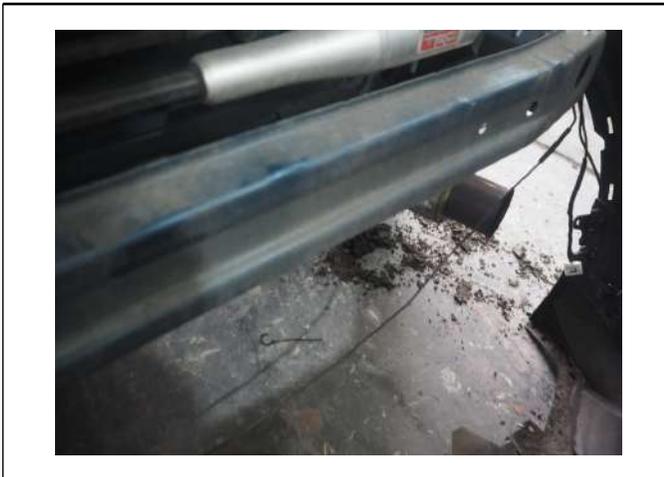



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SMA 7193X

RE-INSPECTION

