

Lai Huat (Meng Kee) Motor Pte Ltd
160 Sin Ming Drive, #04-01, #04-02 &
#07-03, Sin Ming Autocity
575722

Insurer Reference: DMPCSNW00166262100

Repairer Reference: 72784

Date calculated: 21/06/2022 3:55 PM

Full Report

Registration: SKC 3537C

Printed: 22/06/2022 10:02 AM

Summary Information

Claim

Location:	Singapore (SG)	Work Provider:	China Taiping Insurance (Singapore) Pte Ltd
Printed by:	Eddie Sim	Currency:	SGD
Claim Reference:	DMPCSNW00166262100	Date of Incident:	20/06/22
Estimated Repair Time:		Hire Car Start:	
Actual Repair Days:		Hire Car End:	

Vehicle Details

Vehicle

Manufacturer:	MERCEDES-BENZ
Model:	C-CLASS (W204)
Sub Model:	C 180 KOMPR BE
Model Sheet Number:	03 AL 27
Registration:	SKC 3537C
VIN number:	WDD2040452A535168
Odometer:	201348

Model Specs

FROM A531/F660/R177.	MODEL 2012	RAIN SENSOR	LED DAYT RUN LAMPS
MEDIA INTERFACE	MIRROR PACKAGE	AUDIO 20 CD CHANGER	GRILLE WITH STAR
STORAGE PACKAGE	LEATHER UPHOLSTERY	ALU DESIGN PARTS	TRIM AVANTGARDE
CUP HOLDER	STRG WHEEL LEATHER	H/DUTY ALTERNATOR	FUEL TANK 66L
ENGINE PROTECTION	AUTO GEARBOX 5 SPEED	PARAMETER STEERING	CRUISE CONTROL
WHEELS 7.5J X 17 ALU	SPARE WHEEL	PREPARE OFF VEHICLE	3 COAT SYSTEM
CLEAR COAT HARD	TYRES 225/45 R17..Y		

Vehicle Condition


Vehicle Status

Pre-Accident Damage:

Date of Inspection:

Damage Areas

All ☐
Underbody ☐

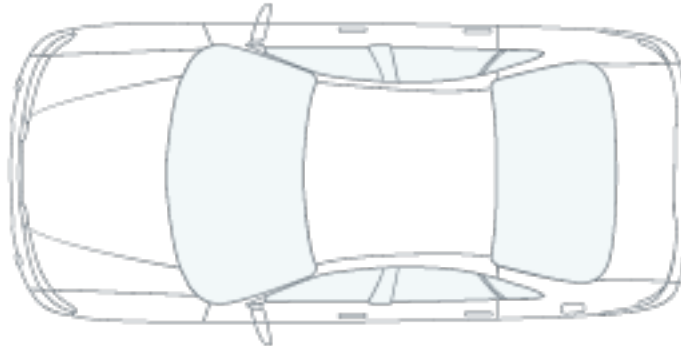

Labour

Code	Description	Time Base 10 WU/h	Price = 42.00 SGD/h	
			WU	Price SGD
83-1762 ZAX	AIR-CONDITIONING SYSTEM DRAIN FLUID, EXHAUST, REFILL, PRESSURE TEST (FOR ALL WORK ON THE SYSTEM)	9.0	9.0	37.80
88-1102 01	R + R COMPLETE FRONT BUMPER INCLUDES: R + R RADIATOR COVER, DETACH + REFIT L/- AND R/PARTITION PANEL, ADJUST FRONT FOG LAMPS	9.0	9.0	37.80
88-1105 02	DIS + ASS FRONT BUMPER (BUMPER REMOVED) AFTER CHECK: RENEW PARTS IF NECESSARY	6.0	6.0	25.20
88-1357 ZAX	ADDITION TO DIS + ASS FRONT BUMPER (REMOVED) (VEHICLE WITH LUXURY EQUIPMENT)	3.0	3.0	12.60
88-2506 01	RENEW BONNET INCLUDES: R + R BONNET, CONVERT ATTACHED PARTS, RENEW IF NECESSARY	11.0	11.0	46.20
82-4730 01)	R + R BOTH HEADLAMP UNITS (BUMPER REMOVED)	3.0	3.0	12.60
20-3865 03)	R + R RADIATOR ADD WORK	3.0	3.0	12.60
20-3866 01	R + R RADIATOR	6.0	6.0	25.20
20-4300 01	R + R AUXILIARY RADIATOR (AUTO GEARBOX)	3.0	3.0	12.60
83-6543 03)	RENEW AIR CONDITIONING CONDENSER	6.0	6.0	25.20
20-6461 04)	R + R FAN UNIT	3.0	3.0	12.60
20-6470 01	ADD FOR R + R FAN	1.0	1.0	4.20
20-7450 ZAX	R + R LEFT COOLANT HOSE	3.0	3.0	12.60
20-7450 ZAX	R + R RIGHT COOLANT HOSE	3.0	3.0	12.60
60-1301 01	R + R ATTACHED PARTS OF THE ENGINE	5.0	5.0	21.00

Code	Description	WU	Price SGD
	COMPARTMENT FOR RENEWAL OF THE REINFORCEMENT		
62-1315 01	R + R FRONT CENTRE REINFORCEMENT BETWEEN WHEELHOUSES	4.0	16.80
62-1263 01	R + R FRONT CROSSMEMBER CPL (STOSSFAENGER AUSGEBAUT)	12.0	50.40
62-1246 01)	RENEW R/REINFORCEMENT BEHIND FRONT CROSSMEMBER (CROSSMEMBER REMOVED)	3.0	12.60
54-7989 02	R + R BATTERY EARTH CABLE (WHEN DISCONNECTING ELECTRIC PLUG AND SOCKET CONNECTIONS)	2.0	8.40
61-1071 01	R + R FRONT LOWER ENGINE COMPARTMENT COVER	3.0	12.60
09-6820 02)	R + R AIR INTERCOOLER	4.0	16.80
0475	LEFT BONNET HINGE REPAIR	✓ 5.0*	21.00
0476	RIGHT BONNET HINGE REPAIR	✓ 5.0*	21.00
1001	R/F HEADLAMP PANEL REPAIR	✓ 10.0*	42.00
Labour Cost Panel / Mechanical Labour		Hrs 12.20	WU 122.0
Total of Labour			512.40

Paint

Paint Work		SYSTEM AZT		Time Basis 10 WU/h	
Code	Description - 3 COAT SYSTEM	WU	Price SGD		
	BONNET NEW PART PAINTING	33.8			
	FRONT BUMPER COVER NEW PART PAINT K1R	15.1			
	LEFT BONNET HINGE SURFACE PAINT	4.0			
	RIGHT BONNET HINGE SURFACE PAINT	4.0			

Paint Material Per Part

Code	Description	Price SGD
0471	BONNET NEW PART PAINTING	111.74
0283	FRONT BUMPER COVER NEW PART PAINT K1R	68.48
0475	LEFT BONNET HINGE SURFACE PAINT	0.25
0476	RIGHT BONNET HINGE SURFACE PAINT	0.25

Labour Cost - Paint

Factor	42.00 SGD/h	Hrs	WU	Price SGD
Time Paint			57.0	
Preparation Main Work Metal		2.50	25.0	105.00
Preparation Comp. Work Plastic		0.50	5.0	21.00
Preparation Multi-Coat		0.50	5.0	21.00
Total	10 WU/h	9.20	92.0	386.40

Material Cost - Paint

New Part Painting	Price SGD
New Part Painting - Plastic K1R	111.74
Surface-/Blend Paint	68.48
Material-constant Metal Preparation	0.50
Material-constant Multi-Coat	28.60
Material-constant Plastic	9.30
Total	9.00
	227.62

Spare Parts

				prices as at 2015-06-01
Code	Description	Part Number	Part Source	Price SGD
0283	✓ FRONT BUMPER COVER	204 880 6147649999	Original	740.00
0305	✓ FRONT BUMPER GRILLE	204 885 0624	Original	60.00
0336	✓ FRONT IMPACT DAMPER	204 885 4065	Original	70.00
0405	✓ FRONT GRILLE	204 880 0023 9744	Original	390.00
0435	✓ BONNET SEAL	204 880 0297	Original	14.00
0471	✓ BONNET	204 880 0957 64	Original	1,190.00
0507	✓ L/SPRING ELEMENT	204 880 0127	Original	14.00
0508	✓ R/SPRING ELEMENT	204 880 0127	Original	14.00
0562	✓ RIGHT HEADLAMP ASSY	204 820 9859	Original	515.00
0930	✓ CTR FRT REINF	204 620 0272	Original	70.00
0988	✓ FRONT BRACKET	204 880 0164	Original	55.00
1001	✓ FRT LWR CROSSMEMBER	207 620 1600	Original	175.00
1008	✓ R/F BUMP IMPACT DAMP	204 620 0995	Original	150.00
4465	? AIR CON CONDENSER	204 500 0654	Original	710.00
7751	✓ UPPER AIR GUIDE	204 505 0530	Original	35.00
7752	✓ LOWER AIR GUIDE	204 505 3430	Original	95.00
7753	? FAN SHROUD	204 500 0155	Original	68.00
7761	? RADIATOR	204 500 2203	Original	455.00
7768	✓ R/FASTENING CLIP	000 991 2595	Original	24.00
7773	? L/RADIATOR HOSE	204 501 0182	Original	48.00
7776	? R/RADIATOR HOSE	204 501 0282	Original	72.00
7789	? HEATER BLOWER	204 906 6802	Original	700.00
8730	? INTERCOOLER	204 500 0300	Original	690.00
8779	✓ FRONT GRILLE PANEL	204 520 0723	Original	115.00
9987	? COOLANT/ANTIFREEZE	NO NUMBER	Original	3040.00
1003	✓ AC DECAL	RENEW	Original	23.00
1004	✓ TOWING EYE COVER	204 885 0426	Original	28.00

f: OEM Parts
n: Non-OEM Parts
u: Used parts

Savings**Subtotal****Fixed Sundry Parts Price****Total**

0.00
6,560.00
✓ 100.00
6,660.00

Extras

Code	Description	Price SGD
1000	AIR CON GAS	✓ 50.00*
1002	FRONT NUMBER PLATE	✓ 35.00*
Total Extras		85.00

Final Calculation

	SGD	SGD
Parts	6,560.00	
Fixed Sundry Parts Price	100.00	
Total Parts		6,660.00
Labour Time Base 10 WU/h		
Total 122.0 WU X 42.00 SGD/h	512.40	
Total of Labour		512.40
Total Of Extras		85.00
Paint Work Time Base 10 WU/h		
Labour Cost 92.0 WU X 42.00 SGD/h	386.40	
Material Cost	227.62	
Total Paint Including Material		614.02
Repair Cost Excludes GST		7,871.42
GST (+7.0%)		551.00
Repair Cost Included GST		8,422.42

Comments

* - USER SUPPLIED DATA
NN - NO MANUFACTURERS CODE EXISTS
) - WU PARTIAL INCL IN OTHER POSITIONS

Eddie Sim
22/06/22

05 Days
Excess Nil
Authorise Repair

Note:
Lump Sum

Resurvey of both
Replacement & Damaged parts,
during after painting.

Assessment Note

No assessment notes entered.