

SM AUTOMOTIVE

Block C, 1 Kaki Bukit Avenue 6 #01-43 Singapore 417883

Blk 1 Kaki Bukit Ave 6

Email: SM_AUTOMOTIVE@HOTMAIL.COM

10/9/2022

01-43

Tel: (65) 6747 9241

Fax: (65) 6741 7276

RCB No: 53231488C

GST Reg No : 53231488C

Singapore 417883

Accident date: 09/09/2022

Estimated repair cost for vehicle no: SFZ1801R HYUNDAI ELANTRA 1.6 AT ABS D/AB
2WD 4DR

CHASSIS: KMHDH41CMGU624596 (2015)

S/n	Qty	Items	U/price	Amount
1	1	FRONT BUMPER <i>Repair</i>	\$658.00	\$658.00 <i>+</i>
2	1	RH FRONT BUMPER SIDE RETAINER <i>new</i>	\$55.00	\$55.00 <i>+</i>
3	1	RH FRONT HEADLAMP <i>cut</i>	\$1,850.10	\$1,850.10 <i>1190</i>
4	1	RH FRONT FENDER <i>Distorted</i>	\$589.00	\$589.00 <i>✓</i>
5	1	RH FRONT FENDER INNER COWLING <i>Rehd</i>	\$259.00	\$259.00 <i>✓</i>
6	1	RH FRONT FENDER MUDFLAP <i>cut</i>	\$154.00	\$154.00 <i>✓</i>
7	1	RH FRONT FENDER CORNER GARNISH <i>new</i>	\$68.00	\$68.00 <i>+</i>
8	1	RH FRONT DOOR <i>Dented</i>	\$1,259.00	\$1,259.00 <i>✓</i>
9	2	RH FRONT DOOR HINGE <i>new</i>	\$154.00	\$308.00 <i>+</i>
10	1	RH FRONT DOOR CHECKER <i>new</i>	\$78.00	\$78.00 <i>+</i>
11	1	RH FRONT DOOR WEATHER STRIPE <i>new</i>	\$134.80	\$134.80 <i>+</i>
12	1	RH FRONT DOOR INNER TRIM BOARD <i>Rehd</i>	\$386.00	\$386.00 <i>+</i>
13	1	RH FRONT DOOR BLACK STICKER <i>new</i>	\$112.00	\$112.00 <i>✓</i>
14	1	RH FRONT DOOR PILLAR OUTER PANEL <i>Repair</i>	\$1,545.00	\$1,545.00 <i>+</i>
15	1	RH FRONT WIND MIRROR <i>Damaged</i>	\$569.00	\$569.00 <i>✓</i>
16	1	RH FRONT WIND MIRROR COVER <i>Missing</i>	\$78.00	\$78.00 <i>✓</i>
17	1	RH FRONT WIND MIRROR RETRACT MOTOR <i>Damaged</i>	\$185.00	\$185.00 <i>✓</i>
18	1	RH FRONT LOWER ARM <i>But</i>	\$354.00	\$354.00 <i>✓</i>
19	1	RH FRONT SHOCK ABSORBER <i>But</i>	\$454.00	\$454.00 <i>✓</i>
20	1	STEERING RACK & PINION <i>new</i>	\$1,908.10	\$1,908.10 <i>+</i>
21	1	RH FRONT KNUCKLER ARM <i>Rehd</i>	\$589.00	\$589.00 <i>✓</i>
22	1	RH FRONT KNUCKLER ARM BEAING <i>Rehd</i>	\$214.00	\$214.00 <i>✓</i>

RH Front Door Regulator Gear *295* *✓*

Damaged

TOTAL :	\$11,807.00
LESS 20 %	\$2,361.40
SUB-TOTAL :	\$9,445.60

6687

5349.60

SFZ1801R HYUNDAI ELANTRA

s/N	Qty	ITEMS / SPECIAL NETT	U/price	Amount
1	1	FRONT BUMPER CLIPS <i>new</i>	\$80.00	\$80.00 <i>30</i>
2	1	RH FRONT FENDER INNER COWLING CLIPS <i>new</i>	\$60.00	\$60.00 <i>30</i>
3	1	RH FRONTDOOR INNER TRIM BOARD CLIPS <i>new</i>	\$60.00	\$60.00 <i>30</i>
4	1	RH FRONT SPORT RIM <i>cut</i>	\$650.00	\$650.00 <i>400</i>
5	1	RH FRONT TYRE <i>new</i>	\$320.00	\$320.00 <i>7</i>

490

TOTAL: \$1,170.00

TOTAL PARTS \$10,615.60

Labour charges

1	LABOUR FOR PANEL BEATING	\$1,600.00 <i>600</i>
2	LABOUR FOR SPRAYPAINTING	\$1,200.00 <i>600</i>
3	LABOUR FOR REMOVE & TRANSFER RH FRONT DOOR FITTING	\$200.00 <i>80</i>
4	WIRING CHECK	\$80.00 <i>30</i>
5	TO APPLY TUFF COATING/RUST PROOF ACCIDENT AREAS	\$150.00 <i>50</i>
6	LABOUR FOR REMOVE & RENEW RH FRONT UNDERCARRIAGE	\$300.00 <i>200</i>
7	TO CONDUCT WHEEL ALIGNMENT	\$150.00 <i>80</i>

Subtotal :- \$3,680.00

Total:- \$14,295.60

Adrian Lj
n/s 13/09/22

06 Days


total: 7479.60

2/s: S.9K ✓

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer
Signature:
Date:

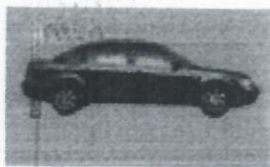

PEOPLES AUTO TRADING
BLK 3007 UBI ROAD 1 #01-400
TEL 6741 4646



COMPUTERIZED ALIGNMENT SPECIALISTS

CUSTOMER	SM	DATE	Sep 13, 2022 9:25:26 AM
FIRST NAME			
LICENSE NO.	SFZ 1801 R		
MILEAGE	184772		
MAKE	CUSTOM	MODEL	HYUNDAI ELANTRA
NOTES			

Front Wheel

SPECS

DIAGNOSIS

ADJUSTMEN

TOTAL TOE
PARTIAL TOE
SET BACK
CAMBER
CASTER
KING-PIN
INCL. ANGLE
Toe-out on turns
STEERING IN
STEERING OUT

min	prv	max	Δ	L	total	R	Δ	L	total	R	Δ
-1.00	0.00	1.00			-6.20				-6.10		
-0.50	0.00	0.50		-3.40		-2.70		-1.00		-5.00	
---	---	---			0°08"				0°08"		
-1°14"	-0°30"	0°14"		-0°44"		-1°48" 1°02"		-0°42"		-1°54" 1°10"	
3°30"	4°30"	5°30"		4°18"		3°50" 0°26"		4°18"		3°50" 0°26"	
---	---	---		12°54"		12°18" 0°36"		12°54"		12°18" 0°36"	
---	---	---		12°08"		10°28"		12°10"		10°22"	
---	---	---		---		---		---		---	
---	---	---		---		---		---		---	
---	---	---		---		---		---		---	

Rear Wheel

SPECS

DIAGNOSIS

ADJUSTMEN

TOTAL TOE
PARTIAL TOE
SET BACK
CAMBER
THRUST ANGLE

min	prv	max	Δ	L	total	R	Δ	L	total	R	Δ
---	---	---			4.60				4.60		
---	---	---		3.70		0.80		3.70		0.80	
---	---	---			0°04"				0°04"		
---	---	---		-1°28"		-1°28" 0°00"		-1°28"		-1°28" 0°00"	
---	---	---			0°14"				0°14"		