



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

CHINA TAIPING INSURANCE (S) PTE LTD

INV No. AC2302856

3 ANSON ROAD #16-00
SPRINGLEAF TOWER
SINGAPORE 079909

INV Date 08/05/2023
Reference CC6/CTI22008949/Aya3q2
Code CTI

PROFESSIONAL SERVICE FEE

Vehicle No. SMP 5849Y
Insured Veh. SLP 8874R
Claim No. SNM22D206523/C02
Policy No. DMHCSNA00009812101
Accident Date 06/09/2022
Inspection Date 08/09/2022

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (8%)	32.00
Grand Total	432.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
CHINA TAIPING INSURANCE (S) PTE LTD 3 ANSON ROAD #16-00 SPRINGLEAF TOWERSINGAPORE 079909			Ref: CC6/CTI22008949/Aya3q2 Date: 08/05/2023 Code: CTI	
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	SLP 8874R	Veh. Inspected	SMP 5849Y	
Policy No.	DMHCSNA00009812101	Coverage (\$)	0.00	
Claim No.	SNM22D206523/C02	Excess (\$)	0.00	
Assign From		Assign Date	08/09/2022	
2. Vehicle Particulars & Condition				
Make & Model	TOYOTA NOAH HYBRID	c.c	1797	
Engine No.	HIDDEN	Year of Reg.	2019	
Chassis No.	ZWR800390297	Colour	BLACK	
Odometer	56144 KM	Steering	IN ORDER	
Brakes	IN ORDER	Modification	SPORTS RIM	
General	GOOD			
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre	195/65 R15	BRIDGESTONE	6 mm	
L/H Front Tyre	195/65 R15	BRIDGESTONE	6 mm	
R/H Rear Tyre	195/65 R15	BRIDGESTONE	6 mm	
L/H Rear Tyre	195/65 R15	BRIDGESTONE	6 mm	
4. Description of Damages				
THE VEHICLE SUSTAINED DAMAGES AT THE REAR PORTION. DAMAGES SEE DETAILS.				
5. General Information				
Accident Date	06/09/2022	Inspection Date	08/09/2022	
Survey held at	ADVANCE AUTO GARAGE 23 KAKI BUKIT AVENUE 4, #04-01 VICOM KAKI BUKIT INSPECTION CENTER, SINGAPORE 415933.			
5a. Remarks				
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
5b. Estimate Days of Repair				
ESTIMATED NORMAL PERIOD FOR REPAIR:			6 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SMP 5849Y

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	REAR BUMPER	DISTORTED	1,025.20	1,025.20
2	REAR BUMPER SIDE HOLDER @\$145.80	DAMAGED	291.60	291.60
2	REAR BUMPER REFLECTOR @\$125.60	NOT NECESSARY	251.20	-
1	REAR BUMPER TOW COVER	DEFORMED	28.10	28.10
1	REAR END PANEL	DISTORTED	683.50	683.50
1	REAR END PANEL TOP GARNISH	DEFORMED	148.60	148.60
2	TAILLAMP @\$685.10	CRACKED	1,370.20	1,370.20
2	TAILLAMP LOWER APRON @\$178.80	DEFORMED	357.60	357.60
1	TAILGATE	DISTORTED	1,812.70	1,812.70
1	TAILGATE WEATHERSTRPE	CUT	375.10	375.10
1	TAILGATE LOCK	DAMAGED	420.60	420.60
1	TAILGATE OUTER CHROME	CRACKED	581.90	581.90
1	TAILGATE INNER TRIM BOARD	DEFORMED	575.90	575.90
2	TAILGATE DAMPER @\$326.80	NOT NECESSARY	653.60	-
1	TAILGATE GLASS MOULDING	NECESSARY	185.90	185.90
1	TOYOTA LOGO	NECESSARY	78.40	78.40
1	HYBRID EMBLEM	NECESSARY	58.20	58.20
2	REAR FENDER INNER TRIM BOARD @\$781.00	DEFORMED	1,562.00	1,562.00
1	FLOOR PANEL	TO REPAIR SEE LABOUR	925.60	-
1	FLOOR PANEL TOP BOARD	TORN	845.10	845.10
1	REAR JACK COVER	DEFORMED	128.70	128.70
	LESS 25% DISCOUNT		-	-2,632.33
			12,359.70	7,896.97
	<u>SPECIAL NETT ITEMS</u>			
1	REAR NUMBER PLATE (SN)	NOT NECESSARY	30.00	-
1	REAR NUMBER PLATE HOLDER (SN)	NOT NECESSARY	30.00	-
1	REAR BUMPER CLIPS (SN)	NECESSARY	30.00	30.00
1	REVERSE SENSOR (SN)	DAMAGED	280.00	200.00
1	REAR END PANEL TOP GARNISH CLIPS (SN)	NECESSARY	20.00	20.00
1	REAR END PANEL SEALANT (SN)	NECESSARY	60.00	60.00

Report Ref No. CC6/CTI22008949/Aya3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	TAILGATE INNER TRIM BOARD CLIPS (SN)	NECESSARY	30.00	30.00
1	TAILGATE GLASS SEALANT (SN)	NECESSARY	60.00	60.00
1	REAR FENDER INNER TRIM BOARD CLIPS (SN)	NECESSARY	60.00	60.00
			600.00	460.00
	LABOUR			
	PANEL BEATING.INCLUSIVE OF THE REPAIR OF FLOOR PANEL .		1,400.00	1,100.00
	SPRAY PAINTING.		1,400.00	1,000.00
	WIRING.		100.00	30.00
	TO REMOVE REVERSE SENSOR .		100.00	50.00
	TO REMOVE REAR CAMERA.		100.00	50.00
	TO REMOVE UPHOLSTERY .		150.00	80.00
	TO REMOVE TAILGATE GLASS .		180.00	120.00
	TO TRANSFER TAILGATE FITTINGS .		150.00	60.00
	TO SPRAY TUFF COAT.		150.00	60.00
			3,730.00	2,550.00
GRAND TOTAL			16,689.70	10,906.97
RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)				8,700.00

Report Ref No. CC6/CTI22008949/Aya3q2

ADRIAN LING WAI PING

B.Eng,AMSOE,AMIRTE,AMSAE-A,M.MATAI

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SMP 5849Y

INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

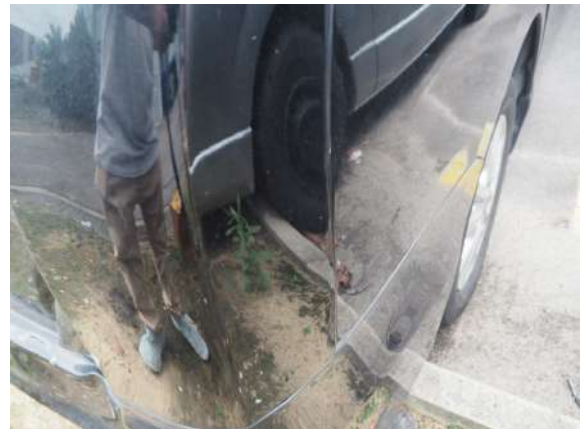



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

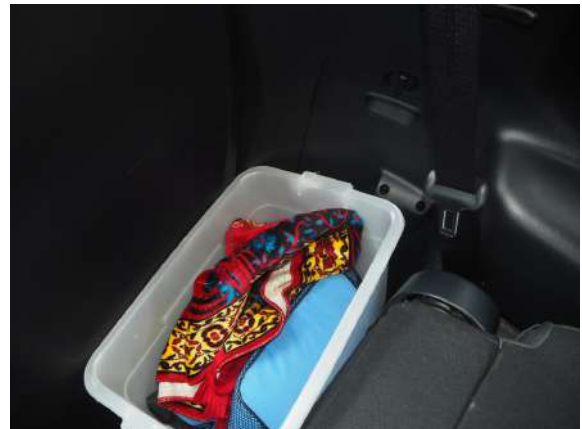



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SMP 5849Y

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R







LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

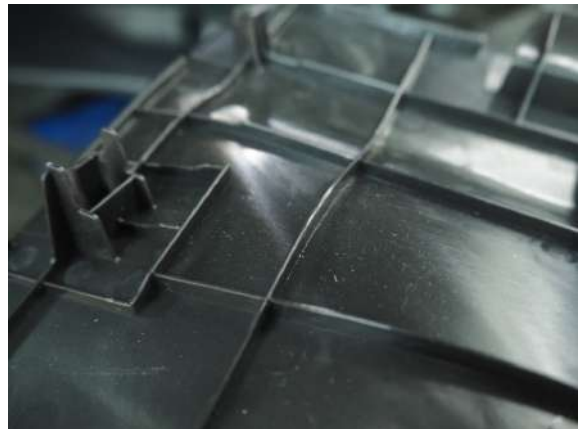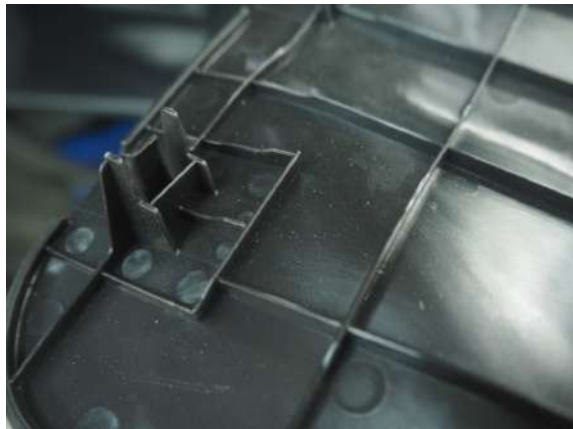



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

