

ASS. REC. BY:

REF:

CTZ/ 2200-8995/16

Kenneth

ASSIGNMENT

From:

Date:

Estimated Cost:

OD/TP/WS/TP RES/OD RES/EVA/INV/MV

To Inspect Vehicle No:

at Workshop m/s

of

Insured:

Policy No.

Claims No.

Sum Insured:


Excess:

(Client's Record)

Make of Veh:

(Policy Condition)

Remark: The veh had commenced its
repair at the time of inspection.

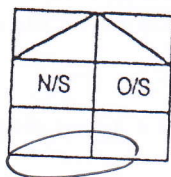

Bal. or Market Value:

IDAC Accident Rpt:

Consistent? : Yes or No

GIA / PR Seen:

Consistent? : Yes or No

Est. Repairs:

9 days

Res.: Yes or No

Lum Sum:

20 %

3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date:

Person Contacted:

Vehicle: IN / OUT

Veh No:

SKX 52237

Yr Regn:

12, 15

Type: M.Car

M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make:

Honda Jazz

c.c

1496

Colour

Yellow

A/C:

Insured / Std / NI / NA

Sp. Reading

200909

T/Radio:

Insured / Std / NI / NA

Eng/No:

C/No:

JHMGK58506 X 201179

Gen. Cond: Good / Fair / Poor / Burnt

Steering: In order / Jammed / Leaked / Burnt or

Brake: In order / Jammed / Leaked / Burnt or

Modi: Nil / S/Rim / STD / RIM or

Tyre Size:

F: B.S

185/55R16

Rear Viper

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /
TOYO / YOKO or

Front

R/Bal.

2

mm

Rear

R/Bal.

3

mm

L/Bal.

2

mm

L/Bal.

3

mm

D.O.A.

12/9/22

D.O.I.

14/9/2022

Survey held at

Des. of Damages : Frt (Rear) O/S / N/S / U/C / Rooftop or

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time

Action / Instruction

1 Got BZ

26/9/19 @ 5350k Carbur

Date/Time, File Pass to?

☐

: Prell. Report

1)

☐

: Final Report

Date/Time, File Return to?

2)

Days Of Repair:

Resurvey No. of Trip:

Survey Fee:

Transportation:

S + RS \$

Fees

Others

TOTAL

Add Fee:

☐

: Site Insp (\$

☐

: Interview (\$

☐

Tech Invs (\$

☐

Weekend (\$

Report Format :

Lump Sum / I.B.I: (\$

威利摩哆 WEI LEE MOTOR WORKS

BLOCK 9 SIN MING INDUSTRIAL ESTATE #01-32,
SINGAPORE 575644.

TEL: 6456 9830 • FAX: 6458 0128 • EMAIL: weileemotorworks@gmail.com
Business Regn No: 269436/00J

13 SEPTEMBER 2022

China Taiping Co (S) PL
105 Cecil Street
#18-00 The Octagon
Singapore 069534

*Not within
11pm 8535dp
Penny After Rain
9 days*

Attn: Motor claim dept-3rd party claim

Claiming against your insured vehicle no: SMN4495B

Accident involving vehicle no: SKX5223J/SMN4495B

DOA: 12/09/2022 at ALONG SELETAR EXPRESSWAY

Dear officer in charge

Estimate cost of repair for vehicle no: SKX5223J

To supplied:

Description		Qty	Amount	
Lid	<i>879.20</i>	<i>R</i> 1	961.30	<i>✓</i>
Lid - Jazz emblem		<i>R</i> 1	62.10	<i>✓</i>
Lid - RS emblem		<i>N/S</i> 1	48.70	<i>X</i>
Lid - H logo		1	<i>R</i> 35.90	<i>✓</i>
Lid lock		<i>R</i> 1	94.80	<i>✓</i>
Lid chrome mldg		<i>M/M</i> 1	199.60	<i>✓</i>
Lid reflector		<i>N/S</i> 2	358.00	<i>2x 179</i>
Rear bumper	<i>492.60</i>	<i>R</i> 1	492.60	<i>✓</i>
Rear bumper retainer		<i>D/S</i> 2	97.00	<i>✓</i>
Rear bumper cover		<i>R</i> 2	56.40	<i>X</i>
Rear end panel	<i>434.30</i>	1	<i>R</i> 434.30	<i>✓</i>
End panel top garnish		<i>D/S</i> 1	144.60	<i>✓</i>
Tailamp	<i>6255.60</i>	<i>OLSM</i> <i>N/S</i> 2	1665.60	<i>✓</i>
Boot weatherstrip		<i>D/S</i> 1	142.30	<i>50cm 71.155N</i>
Spare tyre panel		<i>R</i> 1	692.30	<i>✓</i>
Spare tyre compartment box		1	<i>R</i> 269.60	<i>✓</i>
Spare tyre hard board		<i>R</i> 1	278.90	<i>✓</i>
Tailgate door board		<i>R</i> 1	197.90	<i>✓</i>
Rear fender		<i>R</i> 2	1,314.80	<i>X</i>
Exhaust pipe		1	<i>R</i> 398.50	<i>✓</i>
Rear absorber		<i>R</i> 2	386.40	<i>X</i>
Parts			8,331.60	
Parts less 20%			6,665.28	

1. Reverse sensor (4pcs)
2. Private hire sticker
3. Rear nos plate w bracket
4. Remove/reinstall rear windscreen glass
5. Remove inner garnish, rear speaker hood,
rear interior cushion seat, roof lining enables job carry out
Reinstall after job done
6. To remove damaged parts n attachment
Cut n weld damaged panels
To straighten rear chassis where necessary
Repair/reshape damaged areas
Replace/realign all parts into same position
7. To spray paint

nd 220.00 ✓
na 30.00 X
en 50.00 X
 180.00 *1201*

250.00 *1001*

1,300.00 *11001*

1,200.00 *1001*

9,895.28

**LKK Auto Consultants hence notify
the Repairer of the following:**

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and
is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

威利摩哆
WEI LEE MOTOR WORKS

BLOCK 9 SIN MING INDUSTRIAL ESTATE #01-32,
SINGAPORE 575644.
TEL: 6456 9830 • FAX: 6458 0128
Business Regn No: 269436/00J

14 SEPTEMBER 2022

China Taiping Co (S) PL
105 Cecil Street
#18-00 The Octagon
Singapore 069534

Supplementary claim for vehicle no: SKX5223J

Description	Qty	Amount
Buzzer assembly, smart <i>nd</i>	1	99.30
Antenna assembly, smart <i>nd</i>	1	102.60
Rear wiper motor <i>In</i>	1	125.00
Exhaust pipe chrome <i>Shield</i> <i>nd</i>	1	126.20
Parts		453.10
Parts less 20%		90.62
		362.48
Total		