



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

LONPAC INSURANCE BHD

INV No. AC2207631

300 BEACH ROAD
#17-04/07 THE CONCOURSE
SINGAPORE 199555

INV Date 12/12/2022
Reference CC4/LPC22008999/Upa3q2
Code LPC2

PROFESSIONAL SERVICE FEE

Vehicle No. SMW 784X
Insured Veh. GBH 1386P
Claim No. 22/22/22/VC05/026283
Policy No. Z/22/VC05/009753
Accident Date 12/09/2022
Inspection Date 13/09/2022

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (7%)	28.00
Grand Total	428.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
LONPAC INSURANCE BHD 300 BEACH ROAD #17-04/07 THE CONCOURSESINGAPORE 199555			Ref: CC4/LPC22008999/Upa3q2 Date: 12/12/2022 Code: LPC2	
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	GBH 1386P	Veh. Inspected	SMW 784X	
Policy No.	Z/22/VC05/009753	Coverage (\$)	0.00	
Claim No.	22/22/22/VC05/026283	Excess (\$)	0.00	
Assign From	ENG HUEY NI	Assign Date	13/09/2022	
2. Vehicle Particulars & Condition				
Make & Model	VOLKSWAGEN TOURAN (A)	c.c	1395	
Engine No.	HIDDEN	Year of Reg.	2020	
Chassis No.	WVGZZZ1TZLW003351	Colour	BLUE	
Odometer	38893 KM	Steering	IN ORDER	
Brakes	IN ORDER	Modification	SPORTS RIM	
General	GOOD			
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre	215/55 R17	MICHELIN	6 mm	
L/H Front Tyre	215/55 R17	MICHELIN	6 mm	
R/H Rear Tyre	215/55 R17	MICHELIN	6 mm	
L/H Rear Tyre	215/55 R17	MICHELIN	6 mm	
4. Description of Damages				
THE VEHICLE SUSTAINED DAMAGES AT THE REAR PORTION. DAMAGES SEE DETAILS.				
5. General Information				
Accident Date	12/09/2022	Inspection Date	13/09/2022	
Survey held at	FASTECH AUTO PTE LTD 1 KAKI BUKIT AVENUE 6 #01-46/48/50 AUTOBAY SINGAPORE 417883			
5a. Remarks				
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
5b. Estimate Days of Repair				
ESTIMATED NORMAL PERIOD FOR REPAIR:			4 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SMW 784X

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
<u>REPLACEMENT OF PARTS</u>				
1	REAR BUMPER	DENTED / DEFORMED	2,245.20	1,466.00
1	SET REAR BUMPER BEAM	BENT	844.50	481.00
2	REAR BUMPER SIDE RETAINERS @\$95.00	NECESSARY	190.00	190.00
1	REAR BUMPER LOWER SKIRTING	GRAZED / TORN	850.00	580.00
1	SET REAR BUMPER CLIPS	NECESSARY	80.00	50.00
1	REAR BUMPER INNER TOP RETAINER	CRACKED	210.00	184.00
1	REAR END PANEL	TO REPAIR SEE LABOUR	1,215.00	-
1	REAR END PANEL TOP GARNISH	NOT NECESSARY	486.90	-
1	REAR FENDER FLOOR PANEL	NOT NECESSARY	955.10	-
1	REAR FLOOR PANEL TOP BOARD	NOT NECESSARY	627.20	-
1	REAR FLOOR PANEL TOOLS SPONGE	NOT NECESSARY	568.00	-
2	TAILLAMPS @\$980.00	NOT NECESSARY	1,960.00	-
1	REAR EXHAUST	NOT NECESSARY	2,666.00	-
	LESS 10% DISCOUNT		-	-295.10
			12,897.90	2,655.90
<u>SPECIAL NETT ITEMS</u>				
1	SET REAR BUMPER PDC SENSORS (SN)	SHORTED	900.00	200.00
1	REAR LICENCE PLATE W/HOLDER (SN)	NOT NECESSARY	50.00	-
1	SET REAR EXHAUST TIP (SN)	TO REPAIR SEE LABOUR	450.00	-
1	REAR END PANEL SEALANT (SN)	NOT NECESSARY	50.00	-
			1,450.00	200.00
<u>LABOUR</u>				
	TO CHECK WIRING.		50.00	20.00
	TO DISMANTLE & REPLACED REAR REVERSE SENSOR.		80.00	50.00
	TO DISMANTLE & REFIX CUSHION UPHOLSTERY.		120.00	60.00
	TO DISMANTLE & REFIX REAR EXHAUST.	NOT NECESSARY	80.00	-
	TO RESET & DIAGNOSIS REPROGRAMME SYSTEM.		380.00	50.00
	TO SPRAY RUST PROOFING.	NOT NECESSARY	150.00	-

Report Ref No. CC4/LPC22008999/Upa3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	TO DISMANTLE & REFIX FUEL TANK.	NOT NECESSARY	80.00	-
	LABOUR FOR PANEL BEATING & REPLACED PARTS. INCLUSIVE OF THE REPAIR OF REAR END PANEL AND 1 SET REAR EXHAUST TIP.		800.00	580.00
	TO PUTTY & SPRAY PAINTING.		1,000.00	400.00
			2,740.00	1,160.00
GRAND TOTAL			17,087.90	4,015.90
RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)				3,200.00

Report Ref No. CC4/LPC22008999/Upa3q2

CHUA KANG SENG

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SMW 784X

INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SMW 784X

RE-INSPECTION






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

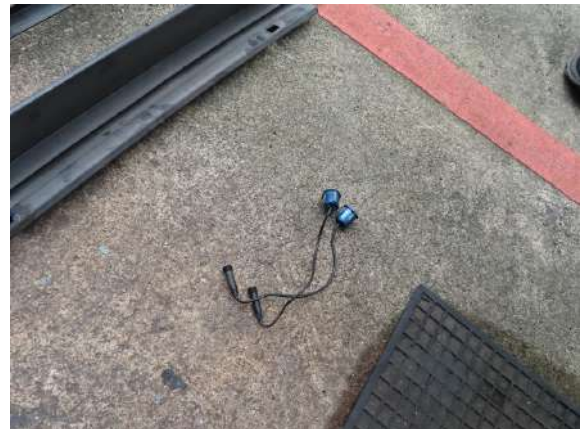



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SMW 784X

RE-INSPECTION

