

Thiam Heng Huat Pte Ltd

176 Sin Ming Drive #05-14 Sin Ming Autocare Singapore 575721

Mobile: 82636295 Email: thiamhenghuat@gmail.com

Make/Model: HONDA FIT

Engine/Chassis No.: JHMGE68509S238931


Date of accident:

Damaged area: N/S

Date: 19/09/2022

Claim Type: TP

VRN: SKA8044K

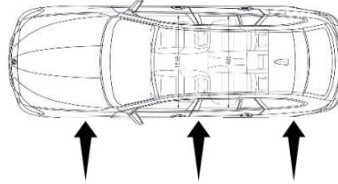

List items				
S/N	Parts description	QTY	UNIT PRICE	AMOUNT
1	Front Bumper ✓ BR	1	\$ 797.00	\$ 797.00
2	Front Bumper side retainer ✓ BR	2	\$ 56.00	\$ 112.00
3	Front fender n/s ✓ DD	1	\$ 676.00	\$ 676.00
4	Front fender inner cowling n/s ✓ TN	1	\$ 85.00	\$ 85.00
5	Front shock absorber n/s ✓ BT	1	\$ 389.00	\$ 389.00
6	Front lower arm n/s ✓ BT	1	\$ 287.00	\$ 287.00
7	Front wheel knuckle n/s ✓ BT	1	\$ 377.00	\$ 377.00
8	Front wheel knuckle bearing n/s ✓ NEC	1	\$ 290.00	\$ 290.00
9	Front endlink n/s ✗ NN	1	\$ 126.00	\$ 126.00
10	Front door n/s ✓ DD	1	\$ 904.00	\$ 904.00
11	Front door inner trim board n/s ✓ BR	1	\$ 483.00	\$ 483.00
12	Front door hinge n/s ✓ BT	2	\$ 102.00	\$ 204.00
13	Front door outer moulding n/s ✗ nn	1	\$ 125.00	\$ 125.00
14	Front door checker n/s ✓ BT	1	\$ 65.00	\$ 65.00
15	Front door outer handle n/s ✗ nn	1	\$ 92.00	\$ 92.00
16	Front door lock n/s ✓ Jammed	1	\$ 133.00	\$ 133.00
17	Front door window regulator n/s ✓ BT	1	\$ 336.00	\$ 336.00
18	Front door window motor n/s ✓ Jammed	1	\$ 186.00	\$ 186.00
19	Front door window outer channel n/s ✓ BT	1	\$ 113.00	\$ 113.00
20	Rear door n/s ✓ DD	1	\$ 815.00	\$ 815.00
21	Rear door hinge n/s ✗ nn	2	\$ 102.00	\$ 204.00
22	Rear door outer moulding n/s ✗ nn	1	\$ 125.00	\$ 125.00
23	Rear door checker n/s ✗ nn	1	\$ 65.00	\$ 65.00
24	Rear door window outer channel n/s ✗ nn	1	\$ 89.00	\$ 89.00
25	Rear fender n/s ✗ nn	1	\$ 773.00	\$ 773.00
26	Headlamp n/s ✓ CRA	1	\$ 987.00	\$ 987.00
27	Wing mirror assy n/s ✓ BR	1	\$ 457.00	\$ 457.00
Subtotal				\$ 9,295.00
List discount				20.00%
Total				\$ 7,436.00

523 ✓

✓

430 ✓

✓

✓

✓

✓

✓

✓

✓

✓

✓

✓

✓

✓

✓

✓

✓

✓

✓

✓

✓

✓

✓

✓

✓

✓

✓

✓

✓

✓

✓

✓

6578
-20%
5262.40

Repair Estimate

Special nett items				
No.	Parts description	QTY	UNIT PRICE	AMOUNT
1	Front Bumper clips ✓ NEC	10	\$ 4.50	\$ 45.00
2	Front fender sealant n/s ✗ nn	1	\$ 80.00	\$ 80.00
3	Front fender inner cowling clips n/s ✓ nec	8	\$ 4.50	\$ 36.00
4	Front door inner trim board clips n/s ✓ nec	8	\$ 4.50	\$ 36.00
5	Rear fender glass sealant n/s ✓ nec	1	\$ 80.00	\$ 80.00
6	Front alloy wheel n/s ✓ cut	1	\$ 450.00	\$ 450.00
7	Front tyre n/s ✗ nn	1	\$ 280.00	\$ 280.00
8	Sundries ✗ nn	1	\$ 50.00	\$ 50.00
Total				\$ 1,057.00

490

Labour			
No.	Description	Work unit	Amount
1	To dismantle / renew the accident damaged portion. To panel beat, reshape, straighten, orientate and align repair / replacement parts.	8	\$ 1,600.00
2	To disconnect n/s doors wire harness of electrical component to facilitate repairs, reconnect and check functions of power windows.	0.5	\$ 100.00
3	To remove and refit n/s front & rear door components to replace n/s front & rear door, check alignment.	1	\$ 200.00
4	Supply spray paint material and necessary items to respray affected area / panel.	7	\$ 1,400.00
5	To remove and refit n/s front undercarriage for replacement of parts.	1	\$ 200.00
6	To conduct computerized wheel alignment.	0.75	\$ 150.00
7	To rust proof all affected portions after repair.	0.5	\$ 100.00
8	To remove and refit n/s front tyre & rim. To perform tyre balancing.	0.25	\$ 50.00
Total labour			\$ 3,800.00

2510

Estimate Grand Total	\$ 12,293.00
----------------------	--------------

8262.40

8 Days

L/S - 6609.92
= 6600

Lumpsum repair

LIK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer
Signature:
Date: