



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

LONPAC INSURANCE BHD

INV No. AC2301389

300 BEACH ROAD
#17-04/07 THE CONCOURSE
SINGAPORE 199555

INV Date 09/03/2023
Reference CC4/LPC22009561/Epa3q2
Code LPC2

PROFESSIONAL SERVICE FEE

Vehicle No. SDD 6500R
Insured Veh. GBC 510E
Claim No. 22/22/22/VC05/026341
Policy No. Z22VC05010794
Accident Date 27/09/2022
Inspection Date 05/10/2022

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (8%)	32.00
Grand Total	432.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
LONPAC INSURANCE BHD 300 BEACH ROAD #17-04/07 THE CONCOURSE SINGAPORE 199555			Ref: CC4/LPC22009561/Epa3q2 Date: 09/03/2023 Code: LPC2	
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	GBC 510E	Veh. Inspected	SDD 6500R	
Policy No.	Z22VC05010794	Coverage (\$)	0.00	
Claim No.	22/22/22/VC05/026341	Excess (\$)	0.00	
Assign From	GERALD	Assign Date	28/09/2022	
2. Vehicle Particulars & Condition				
Make & Model	MINI COOPER S	c.c	1998	
Engine No.	HIDDEN	Year of Reg.	2020	
Chassis No.	WMWYS920203J21624	Colour	GREY	
Odometer	20918 KM	Steering	IN ORDER	
Brakes	IN ORDER	Modification	SPORTS RIM	
General	GOOD			
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre	215/50 R17	DUNLOP	4 mm	
L/H Front Tyre	215/50 R17	DUNLOP	4 mm	
R/H Rear Tyre	215/50 R17	DUNLOP	4 mm	
L/H Rear Tyre	215/50 R17	DUNLOP	4 mm	
4. Description of Damages				
THE VEHICLE SUSTAINED DAMAGES AT THE FRONT O/S PORTION. DAMAGES SEE DETAILS.				
5. General Information				
Accident Date	27/09/2022	Inspection Date	05/10/2022	
Survey held at	27A Tanjong Penjuru, Singapore 609042			
Repairer	EUROKARS HABITAT PTE LTD			
5a. Remarks				
A) THE INSPECTION WAS CONDUCTED ON A "WITHOUT PREJUDICE" BASIS. B) IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
5b. Estimate Days of Repair				
ESTIMATED NORMAL PERIOD FOR REPAIR:			5 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SDD 6500R

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	BONNET	DENTED	1,523.28	1,523.28
1	BONNET HINGE LH	NOT NECESSARY	143.13	-
1	BONNET HINGE RH	NOT NECESSARY	143.13	-
1	BONNET LOCK LH	NOT NECESSARY	89.89	-
1	BONNET LOCK RH	NOT NECESSARY	89.89	-
1	HEADLIGHT TRIM RING LH	NECESSARY	65.97	65.97
1	HEADLIGHT TRIM RING RH	NECESSARY	57.59	57.59
1	EMBLEM FRONT	NECESSARY	80.53	80.53
1	LABEL ,COOLANT	NECESSARY	32.50	32.50
1	FRONT BUMPER	CUT	1,080.23	1,080.23
1	SUPPORT FOGLAMP RH	NOT NECESSARY	181.16	-
1	FRONT BUMPER LOWER SPOILER	NOT NECESSARY	1,027.52	-
1	TRIM FOR FOGLAMP RH	NOT NECESSARY	115.25	-
1	FRONT BUMPER SPONGE	NOT NECESSARY	68.83	-
1	FRONT FENDER ARCH RH	CUT	197.73	197.73
1	ADAPTER FOR FRT FENDER RH	NOT NECESSARY	32.76	-
1	FRONT FENDER RH	NOT NECESSARY	635.96	-
1	HEADLIGHT RH	CUT	3,362.45	3,362.45
3	ALIGNMENT ELEMENT	NOT NECESSARY	35.70	-
1	MOUNT FOR HEADLIGHT RH	NOT NECESSARY	289.51	-
1	CLIP	NECESSARY	4.88	4.88
			9,257.89	6,405.16
	<u>SPECIAL NETT ITEMS</u>			
1	SUNDRIES (SN)	NECESSARY	50.00	20.00
			50.00	20.00
	<u>LABOUR</u>			
	TO REMOVE & REPLACE BONNET ,FRT BUMPER ,REINFORCEMENT ,FRT FENDER RH & ALL ACCIDENT DAMAGE AREAS .TO REPAIR ALL AREAS AFFECTED BY THE ACCIDENT .		2,940.00	1,680.00
	TO RESPRAY BONNET ,FRT BUMPER ,FRT FENDER RH .		2,600.00	1,600.00

Report Ref No. CC4/LPC22009561/Epa3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	TO CARRY OUT BODY CAVITY PRESERVATION .		250.00	150.00
	TO INSTALL THE BONNET STICKER .		270.00	270.00
	TO TRANSFER THE FRT BUMPER SENSORS.		300.00	150.00
	TO CHECK ELECTRICAL SYSTEM FOR PROPER FUNCTIONING.		250.00	150.00
	TO REPROGRAMME AFTER THE ACCIDENT REPAIR WORKS.		350.00	250.00
			6,960.00	4,250.00
GRAND TOTAL			16,267.89	10,675.16
RECOMMENDED COST OF REPAIRS				10,675.16

Report Ref No. CC4/LPC22009561/Epa3q2

CHEN TSUE YEE

Automotive Assessor

HO LEONG CHUAN

Automotive Assessor

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd


51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SDD 6500R

INSPECTION

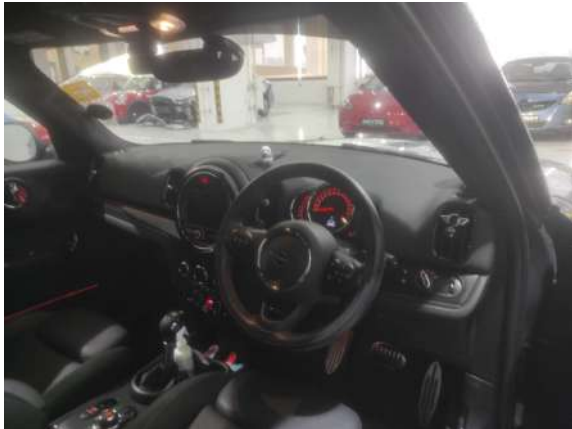



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SDD 6500R

RE-INSPECTION

