

From: \_\_\_\_\_ Date: \_\_\_\_\_

Estimated Cost: \_\_\_\_\_

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No: XD 42953

at Workshop m/s THINK ONE

of BO, JLN LAM HUK #02-31

Insured: LPC

Policy No. \_\_\_\_\_

Claims No. \_\_\_\_\_


Sum Insured: \_\_\_\_\_ Excess: \_\_\_\_\_

(Client's Record)

Make of Veh: \_\_\_\_\_

(Policy Condition)

Remark: The veh had commenced its repair at the time of inspection.

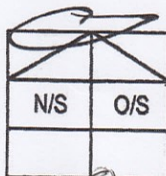

Bal. or Market Value: \_\_\_\_\_

IDAC Accident Rpt: \_\_\_\_\_ Consistent? : Yes or No

GIA / PR Seen: \_\_\_\_\_ Consistent? : Yes or No

Est. Repairs: 75 days Res.: Yes or No

Lum Sum: 25 % 3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date: \_\_\_\_\_ Person Contacted: \_\_\_\_\_

Vehicle: IN / OUT

Date / Time Action / Instruction

REPAIR LIMIT - 30K

Trailer MV \$10K

22/5/23 L/S \$34,000 in hand Michael

Veh No: XD 42953 Yr Regn: 2010 / 0001

Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make: NISSAN QKBYCLBHN c.c 13074

Colour WHITE A/C: Insured / Std / NI / NA

Sp.Reading - T/Radio: Insured / Std / NI / NA

Eng/No: \_\_\_\_\_

C/No: QKBYCLB 00334

Gen. Cond: Good / Fair / Poor / Burnt

Steering: Inorder / Jammed / Leaked / Burnt or

Brake: Inorder / Jammed / Leaked / Burnt or

Modi: NI / S/Rim / STD A/Rim or

Tyre Size: F: 11R225

R: 11

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or FENIXWAY

Front

Rear

R/Bal. 8 mm R/Bal. 8/8 mm

L/Bal. 8 mm L/Bal. 8/8 mm

D.O.A. 01/10/22 D.O.I. 10/04/22

Survey held at THINK ONE 4/10/22

Des. of Damages: Fr / Rear / O/S / N/S / U/C / Rooftop or

Rear & Inf.

The U/C / Chassis frame / Body Structure affected due to collision.

Date/Time, File Pass to?



: Preli. Report



: Final Report

Date/Time, File Return to?

1)

2)

Days Of Repair: \_\_\_\_\_

Resurvey No. of Trip: \_\_\_\_\_

Survey Fee:

Transportation:

Add Fee: ☐ : Site Insp (\$ \_\_\_\_\_)

☐ : Interview (\$ \_\_\_\_\_)

☐ : Tech. Invs (\$ \_\_\_\_\_)

S + RS, SI

Photos

Others

Report Format : \_\_\_\_\_

Lump Sum / I.B.I: (\$ \_\_\_\_\_)

ESTIMATE

NOFF item

DATE 03.10.2022

VEHICLE NO:XD4295J NISSAN UD CKB4 00334

| No       | Qty | DESCRIPTION                                  | AMOUNT S\$      |
|----------|-----|----------------------------------------------|-----------------|
| 1        | 1   | FRONT FIRE PANEL <del>body</del> 2660        | 2,855.00        |
| 2        | 1   | FRONT FIRE PANEL AIR VENT MIS                | 211.00          |
| 3        | 2   | FRONT DOOR PILLAR INNER R+L X                | 1,455.00        |
| 4        | 12  | FRONT DOOR PILLAR OUTER R+L LH-repair/RH X   | 1,425.00        |
| 5        | 1   | FRONT DOOR PILLAR INNER GARNISH LH X         | 328.00          |
| 6        | 12  | FRONT WIPER PANEL PULL HANDLE R+L LH-at/RH X | 285.00          |
| 7        | 1   | FRONT WIPER PANEL OUTER X                    | 758.00          |
| 8        | 1   | FRONT WIPER PANEL INNER repair               | 685.00          |
| 9        | 1   | FRONT WIPER TANK X                           | 385.00          |
| 10       | 1   | FRONT WIPER MOTOR X                          | 658.00          |
| 11       | 2   | FRONT WIPER LINKAGE X                        | 274.00          |
| 12       | 1   | FRONT BONNET ASSY <del>body</del> 2550       | 2,885.00        |
| 13       | 1   | FRONT BONNET RUBBER SEAL X                   | 115.00          |
| 14       | 1   | FRONT BONNET (UD) LOGO MIS                   | 350.00          |
| 15       | 1   | FRONT BONNET (QUON) EMBLEM X                 | 185.00          |
| 16       | 1   | FRONT BONNET GRILLE (UD TRUCKS) EMBLEM MIS X | 195.00          |
| 17       | 1   | FRONT BONNET GRILLE MIS                      | 688.00          |
| 18       | 2   | FRONT BONNET GRILLE BRACKET R+L X            | 87.00           |
| 19       | 1   | FRONT LOWER GRILLE MIS                       | 788.00          |
| 20       | 2   | FRONT BONNET LOCK R+L MIS                    | 198.00          |
| 21       | 2   | FRONT BONNET LOCK CATCH R+L MIS              | 80x2=160 135.00 |
| 22       | 1   | BRACE PANEL <del>body</del>                  | 110.00          |
| 23       | 1   | HEIGHT CONTROL VALVE X                       | 450.00          |
| 24       | 1   | HEIGHT CONTROL ROD X                         | 125.00          |
| 25       | 1   | FRONT BONNET DAMPER                          | 262             |
| 26       | 12  | CORNER PANEL R+L RH-X/LH-car MIS             | 988.00          |
| 27       | 2   | CORNER PANEL RUBBER LH X                     | 25.00           |
| 28       | 2   | CORNER PANEL BRACKET R+L X                   | 45.00           |
| 29       | 12  | CORNER PANEL LOWER GARNISH LH RH-X/LH-car    | 125.00          |
| 30       | 1   | FRONT BUMPER REINFORCEMENT <del>body</del>   | 875.00          |
| 31       | 1   | FRONT BUMPER CENTER <del>body</del>          | 1,670.00        |
| 32       | 1   | FRONT BUMPER CENTER FOOT STEP car            | 220             |
| 33       | 1   | CORNER BUMPER LH <del>body</del>             | 900             |
| 34       | 1   | CORNER BUMPER END GARNISH LH MIS             | 105             |
| 35       | 1   | CORNER BUMPER END BRACKET LH X               | 185.00          |
| 36       | 2   | FRONT BUMPER TOW HOOK COVER LH X             | 220.00          |
| 37       | 2   | FRONT BUMPER CENTER COVER MIS                | 220.00          |
| 38       | 1   | FRONT BUMPER FOG LAMP LH                     | 205.00          |
| 39       | 1   | FRONT BUMPER SINGAL LAMP LH                  | 185.00          |
| 40       | 1   | FRONT HEADLAMP LH car                        | 2,218.40        |
| 41       | 1   | FRONT HEADLAMP BRACKET LH                    | 542.00          |
|          |     |                                              | \$ 31,029.40    |
| less 10% |     |                                              | \$ 3,102.94     |
|          |     |                                              | \$ 27,926.46    |

|                           |                                                             | AMOUNT S\$ |                         |
|---------------------------|-------------------------------------------------------------|------------|-------------------------|
| 2                         | 4 FRONT HEADLAMP RUBBER MOUNTING LH <del>X</del>            | 28.00      | 112.00 <del>X</del>     |
| 3                         | 1 FRONT CHASSIS CROSS MEMBER <del>repair</del> <del>X</del> |            | 3,200.00 <del>X</del>   |
| 4                         | 2 CABIN FLOOR BRACKET <del>X</del>                          | 485.00     | 970.00 <del>X</del>     |
| 5                         | 2 CABIN LOWER BRACKET <del>X</del>                          | 488.00     | 976.00 <del>X</del>     |
| 6                         | 2 CABIN BELLOW R+L <del>RH-X</del> / <del>LH-7wi</del>      | 680.00     | 1,360.00 <del>120</del> |
| 7                         | 2 CABIN SHOCK ABSORBER R+L <del>Lt</del>                    | 402.00     | 804.00                  |
| 8                         | 1 CABIN TORSION BAR <del>Lt</del>                           |            | 1,899.00                |
| 9                         | 2 CABIN TORSION BAR BRACKER R+L                             | 452.00     | 904.00                  |
| 10                        | 1 TURBO COOLER <del>Lt</del>                                |            | 9,450.00                |
| 11                        | 1 RADIATOR ASSY                                             |            | 5,230.00 <del>X</del>   |
| 12                        | 1 FAN BLADE <del>assy</del>                                 |            | 653.00                  |
| 13                        | 1 AIR CON CONDENSER ASSY <del>Lt</del>                      |            | 1,270.00                |
| 14                        | 1 AIR CON CONDENSER LIQUID TUBE <del>X</del>                |            | 185.00 <del>X</del>     |
| 15                        | 1 AIR CON CONDENSER DISCHARGE HOSE <del>X</del>             |            | 285.00 <del>X</del>     |
| 16                        | 1 AIR CON CONDENSER MOTOR <del>X</del>                      |            | 320.00 <del>X</del>     |
| 17                        | 2 FRONT DOOR R+L <del>repair</del>                          | 3,855.00   | 7,710.00 <del>X</del>   |
| 18                        | 2 FRONT DOOR HINGE TOP R+L <del>X</del>                     | 265.00     | 530.00 <del>X</del>     |
| 19                        | 2 FRONT DOOR HINGE LOWER R+L <del>X</del>                   | 265.00     | 530.00 <del>X</del>     |
| 20                        | 2 FRONT DOOR LOCK R+L <del>X</del>                          | 425.00     | 850.00 <del>X</del>     |
| 21                        | 1 DASHBOARD HOUSING <del>X</del>                            |            | 652.00 <del>X</del>     |
| 22                        | 1 GLOVE COMPARTMENT DOOR <del>X</del>                       |            | 388.00 <del>X</del>     |
| 23                        | 1 FUSE BOX ASSY <del>X</del>                                |            | 988.00 <del>X</del>     |
| 24                        | 1 AIR CON COOLING BOX ASSY <del>X</del>                     |            | 3,221.00                |
| 25                        | 1 AIR CON FAN BLOWER ASSY <del>X</del>                      |            | 2,115.00                |
| 26                        | 1 AIR CON SUCTION HOSE <del>X</del>                         |            | 245.00 <del>X</del>     |
| 27                        | 1 AIR CON DISCHARGE HOSE <del>X</del>                       |            | 210.00 <del>X</del>     |
| 28                        | 2 CABIN REAR BELLLOW R+L <del>X</del>                       | 680.00     | 1,360.00 <del>X</del>   |
| 29                        | 2 CABIN REAR SHOCK ABSORBER R+L <del>X</del>                | 402.00     | 804.00 <del>X</del>     |
| 30                        | 1 CABIN REAR BRIDGE <del>X</del>                            |            | 685.00 <del>X</del>     |
| 31                        | 2 CABIN REAR BRIDGE LOCK <del>X</del>                       | 458.00     | 916.00 <del>X</del>     |
| 32                        | 2 CABIN REAR BRIDGE LOCK CATCH <del>X</del>                 | 85.00      | 170.00 <del>X</del>     |
| 1 pc Air cleaner box assy |                                                             |            | \$ 48,992.00            |
|                           |                                                             |            | \$ 4,899.20             |
|                           |                                                             |            | \$ 44,092.80            |

| Qty SPECIAL NETT ITEMS     |                                                    | AMOUNT S\$  |                        |
|----------------------------|----------------------------------------------------|-------------|------------------------|
| 17                         | FRONT BONNET GRILLE CLIPS <del>new</del>           | 6.00        | <del>102.00</del> 60   |
| 8                          | FRONT LOWER GRILL CLIP <del>new</del>              | 6.00        | <del>48.00</del> 40    |
| 4                          | CORNER PANEL CLIP <del>new</del>                   | 8.00        | <del>32.00</del> 20    |
| 2                          | JOINT SEAL <del>new</del>                          | 120.00      | <del>240.00</del> 80   |
| 3                          | COMPANY STICKER BONNET/DOOR                        | 250.00      | <del>750.00</del> 500  |
| 1                          | 40 FOOTER TRAILER ASSY (TR9563B) <del>Repair</del> |             | 42,000.00 <del>X</del> |
| (PARKED AT 10 PANDAN ROAD) |                                                    |             |                        |
|                            |                                                    | Refer other |                        |
|                            |                                                    | Estimate \$ | 43,172.00              |

#### LABOUR & MISCELLANEOUS:

To remove damaged body parts with all necessary components/attachments apply hot-works where necessary repair, reshape body dented panels in accordance with factory specifications replace new parts refit and align into position refit all necessary components/attachments

AMOUNT S\$

6,000.00

2800

|    |                                                                                                   |    |                             |
|----|---------------------------------------------------------------------------------------------------|----|-----------------------------|
| 2  | To spray paint replaced/repaired body parts inclusive of preparatory works and painting materials |    | <del>2,600.00</del><br>1800 |
| 3  | To transfer front door components with all necessary attachments 2pcs                             | 17 | 300.00 X                    |
| 4  | To remove,refit interior garnishes,upholstery,roof lining with all necessary attachments          | 11 | 250.00 X                    |
| 5  | To remove,refit dashboard panel with all necessary components/attachment                          | 11 | 250.00 X                    |
| 6  | To remove,replace turbo cooler,radiator with all necessary attachments                            |    | <del>350.00</del> 250       |
| 7  | To remove,replace air con parts vacuum system and recharge gas                                    |    | <del>250.00</del> 100       |
| 8  | To remove and install front windscreen glass and water test                                       |    | 200.00 ✓                    |
| 9  | To conduct headlamp alignment                                                                     |    | 30.00 ✓                     |
| 10 | Towing charge <i>receipt?</i>                                                                     |    | 300.00 100                  |
|    |                                                                                                   |    | <hr/> \$ 10,530.00 1717     |

Spare Parts \$ 27,926.46  
Spare Parts \$ 44,092.80  
Specail Nett \$ 43,172.00  
Labour Charge \$ 10,530.00

**LKK Auto Consultants** hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer  
Signature:  
Date:

*Paul*  
Hp 9006068  
15 days  
4/5 @ 34,000/  
10/04/10/22  
@1500

Reg after repair  
P-34327  
P-30814  
S.N-700  
L-5280  
368143  
222  
28499

TOTAL \$ 45404  
252  
34053

Think One Autocare Pte Ltd  
No.60 Jalan Lam Huat #02-32 Carros Centre  
Singapore 737869  
Tel:68443300 Fax:68424988

**ESTIMATED**

DATE 12.10.2022 *S. Nety*

**VEHICLE NO:XD4295J TRAILER TR9563B (40 FT PLATFORM)**

| No | Qty | DESCRIPTION                                  | AMOUNT S\$         |
|----|-----|----------------------------------------------|--------------------|
| 1  | 1   | 21" MAIN FRAME                               | Dis 4,500.00       |
| 2  | 1   | 8" x 51/4" REAR FRAME FOR SUPPORT TWIST LOCK | Dis 1,200.00       |
| 3  | 1   | CROSS MEMBER                                 | Dis 1,000.00       |
| 4  | 1   | REAR BUMPER                                  | Dis 1,800.00       |
| 5  | 1   | TAIL LIGHT BRACKET                           | 11 350.00 X        |
| 6  | 2   | NUMBER PLATE LAMP                            | 75.00 11 150.00 X  |
| 7  | 1   | REVERSE BUZZER                               | 11 45.00 X         |
| 8  | 2   | RED REFLECTOR                                | 35.00 11 70.00 X   |
| 9  | 1   | STICKER (50KM/H)                             | 11 25.00 X         |
| 10 | 1   | RED STICKER (3 METER)                        | 11 150.00 X        |
| 11 | 1   | VEHICLE NUMBER PLATE                         | Sub 45.00 15       |
| 12 | 1   | TRAILER NUMBER PLATE                         | Sub 45.00 15       |
|    |     |                                              | <u>\$ 9,380.00</u> |

| No | Qty | DESCRIPTION    | AMOUNT S\$         |
|----|-----|----------------|--------------------|
| 1  | 1   | REAR AXLE ASSY | 11 4,500.00 X      |
| 2  | 12  | REAR AXLE OIL  | 11 240.00 X        |
|    |     |                | <u>\$ 4,740.00</u> |

**LABOUR & MISCELLANEOUS:**

**AMOUNT S\$**

|   |             |                                                                                                                                                                                                                                                                                |                    |      |
|---|-------------|--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|--------------------|------|
| 1 | <i>Rear</i> | To remove damaged body parts with all necessary components/attachments apply hot-works where necessary repair, reshape body dented panels in accordance with factory specifications replace new parts refit and align into position refit all necessary components/attachments | 4,500.00           | 2500 |
| 2 |             | To spray paint replaced/repaired body parts inclusive of preparatory works and painting materials, premier green and finishing paint including blasting steel                                                                                                                  | Repl 2,600.00      | X    |
| 3 |             | To remove axle housing assy with all necessary components/attachments                                                                                                                                                                                                          | 11 450.00          | X    |
| 4 |             | To Re-wiring rear chassis light system                                                                                                                                                                                                                                         | 11 150.00          | X    |
|   |             |                                                                                                                                                                                                                                                                                | <u>\$ 7,700.00</u> |      |

\$ 9,380.00  
\$ 4,740.00  
\$ 7,700.00  
\$ 21,820.00