



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

CHINA TAIPING INSURANCE (S) PTE LTD

INV No. AC2301103

3 ANSON ROAD #16-00
SPRINGLEAF TOWER
SINGAPORE 079909

INV Date 23/02/2023
Reference CC6/CTI22009830/Apa3q2
Code CTI

PROFESSIONAL SERVICE FEE

Vehicle No. SLT 2867E
Insured Veh. GBC 9141C
Claim No. SNM22D207069/C02
Policy No. DMCVSNW00016422205
Accident Date 30/09/2022
Inspection Date 03/10/2022

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (8%)	32.00
Grand Total	432.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
CHINA TAIPING INSURANCE (S) PTE LTD 3 ANSON ROAD #16-00 SPRINGLEAF TOWERSINGAPORE 079909			Ref: CC6/CTI22009830/Apa3q2 Date: 23/02/2023 Code: CTI	
1. Policy Particulars :- THIRD PARTY CLAIM				
	Insured Veh.	GBC 9141C	Veh. Inspected	SLT 2867E
	Policy No.	DMCVSNW00016422205	Coverage (\$)	0.00
	Claim No.	SNM22D207069/C02	Excess (\$)	0.00
	Assign From		Assign Date	03/10/2022
2. Vehicle Particulars & Condition				
	Make & Model	TOYOTA HARRIER	c.c	2017
	Engine No.	HIDDEN	Year of Reg.	1998
	Chassis No.	JTEKB3GH50J000484	Colour	SILVER
	Odometer	29435 KM	Steering	IN ORDER
	Brakes	IN ORDER	Modification	SPORTS RIM
	General	GOOD		
3. Conditions of Tyres				
		Size	Make	Balance
	R/H Front Tyre	235/55 R18	YOKOHAMA	6 mm
	L/H Front Tyre	235/55 R18	YOKOHAMA	6 mm
	R/H Rear Tyre	235/55 R18	YOKOHAMA	6 mm
	L/H Rear Tyre	235/55 R18	YOKOHAMA	6 mm
4. Description of Damages				
	THE VEHICLE SUSTAINED DAMAGES AT THE N/S BODY. DAMAGES SEE DETAILS.			
5. General Information				
	Accident Date	30/09/2022	Inspection Date	03/10/2022
	Survey held at	SM AUTOMOTIVE BLK C, 1 KAKI BUKIT AVENUE 6 #01-43 SINGAPORE 417883		
5a. Remarks				
	A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.			
5b. Estimate Days of Repair				
	ESTIMATED NORMAL PERIOD FOR REPAIR:		6 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 3

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SLT 2867E

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	LH FRONT FENDER	TO REPAIR SEE LABOUR	1,025.30	-
1	LH FRONT DOOR	DENTED	1,881.30	1,881.30
1	LH FRONT DOOR OUTER CHROME MOULDING	CUT	168.70	168.70
1	LH FRONT DOOR INNER TRIM BOARD	NOT NECESSARY	512.90	-
2	LH FRONT DOOR HINGE @\$58.90	NOT NECESSARY	117.80	-
1	LH FRONT DOOR CHECKER	NOT NECESSARY	62.30	-
1	LH FRONT DOOR LOCK	DAMAGED	338.40	338.40
1	LH FRONT DOOR WEATHERSTRIPE	NOT NECESSARY	198.10	-
1	LH FRONT DOOR POWER WINDOW MOTOR	NOT NECESSARY	689.70	-
1	LH FRONT DOOR POWER WINDOW GEAR	DAMAGED	588.70	315.00
1	LH FRONT DOOR OUTER HANDLE WITH SENSOR	CUT	361.40	361.40
1	LH FRONT DOOR WIND MIRROR	CUT	1,230.10	1,230.10
1	LH FRONT DOOR WIND MIRROR COVER	TO REPAIR SEE LABOUR	112.80	-
1	LH ROCKER PANEL GARNISH	DEFORMED	1,021.10	645.00
1	LH REAR DOOR	DENTED	1,882.10	1,882.10
1	LH REAR DOOR OUTER CHROME MOULDING	CUT	168.80	168.80
1	LH REAR DOOR INNER TRIM BOARD	CRACKED	512.90	512.90
2	LH REAR DOOR HINGE @\$58.90	NOT NECESSARY	117.80	-
1	LH REAR DOOR CHECKER	NOT NECESSARY	62.30	-
1	LH REAR DOOR LOCK	NOT NECESSARY	338.40	-
1	LH REAR DOOR WEATHERSTRIPE	NOT NECESSARY	198.10	-
1	LH REAR DOOR POWER WINDOW MOTOR	NOT NECESSARY	689.70	-
1	LH REAR DOOR POWER WINDOW GEAR	DAMAGED	588.70	325.00
1	LH REAR DOOR OUTER HANDLER WITH SENSOR	CUT	361.40	361.40
1	LH REAR FENDER	TO REPAIR SEE LABOUR	2,243.10	-
1	REAR WINDSCREEN GLASS MOULDING	NOT NECESSARY	178.10	-
1	LH REAR SHOCK ABSORBER	NOT NECESSARY	731.20	-
1	LH REAR ADJUSTER ARM	NOT NECESSARY	711.20	-
1	LH REAR KNUCKLE ARM	DAMAGED	631.10	631.10

Report Ref No. CC6/CTI22009830/Apa3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	LH REAR KNUCKLE ARM BEARING	DAMAGED	580.10	580.10
1	LH REAR UPPER ARM	NOT NECESSARY	789.10	-
1	LH REAR LOWER ARM	BENT	570.90	570.90
	LESS 25% DISCOUNT		-4,915.90	-2,493.05
			14,747.70	7,479.15
	<u>SPECIAL NETT ITEMS</u>			
1	LH FRONT SPORT RIM (SN)	CUT	1,400.00	1,100.00
1	LH REAR SPORT RIM (SN)	CUT	1,400.00	1,100.00
1	LH FRONT DOOR INNER TRIM BOARD CLIPS (SN)	NECESSARY	80.00	30.00
1	LH REAR DOOR INNER TRIM BOARD CLIPS (SN)	NECESSARY	80.00	30.00
1	LH ROCKER PANEL GARNISH CLIPS (SN)	NECESSARY	80.00	30.00
			3,040.00	2,290.00
	<u>LABOUR</u>			
	LABOUR FOR PANEL BEATING.INCLUSIVE OF THE REPAIR OF LH FRONT FENDER ,LH FRONT DOOR WIND MIRROR COVER AND LH REAR FENDER .		2,000.00	800.00
	LABOUR FOR SPRAYPAINTING.		1,800.00	800.00
	WIRING CHECK.		80.00	30.00
	LABOUR FOR REMOVE & REMOVE & REFIX WINDSCREEN GLASS .	NOT NECESSARY	150.00	-
	LABOUR FOR REMOVE & TRANSFER BOTH LH DOOR FITTING.		300.00	160.00
	LABOUR FOR REMOVE & REFIX LH INNER TRIM BOARD /UPHOLSTERY .	NOT NECESSARY	300.00	-
	LABOUR FOR REMOVE & RENEW LH REAR UNDER CARRIAGE.		400.00	220.00
	TO CONDUCT WHEEL ALIGNMENT.		150.00	80.00
			5,180.00	2,090.00
	GRAND TOTAL		22,967.70	11,859.15



RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)			9,500.00
---	--	--	----------

Report Ref No. CC6/CTI22009830/Apa3q2

ADRIAN LING WAI PING

B.Eng,AMSOE,AMIRTE,AMSAE-A,M.MATAI

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd


51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SLT 2867E

INSPECTION

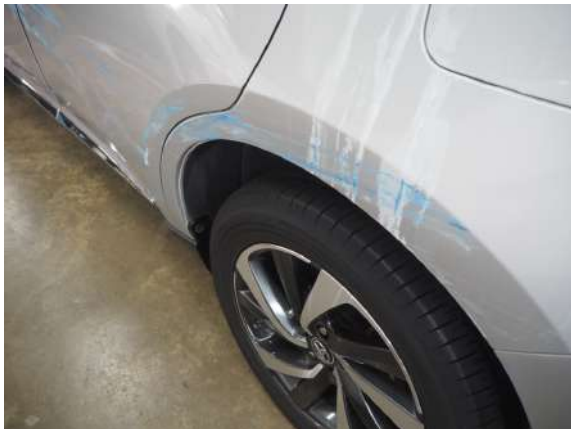



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

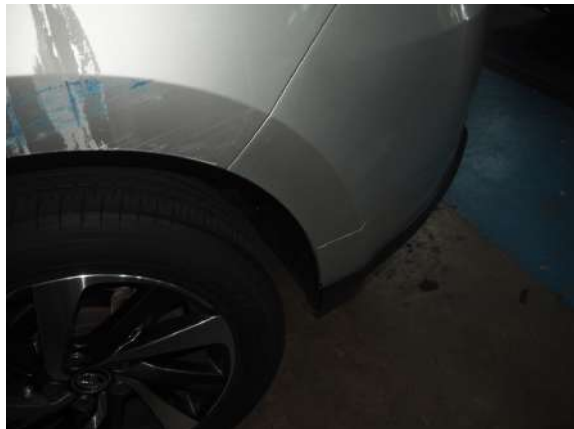



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SLT 2867E

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SLT 2867E

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

