

## ASSIGNMENT

From: \_\_\_\_\_ Date: \_\_\_\_\_

Estimated Cost: \_\_\_\_\_

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No: SWA 5215T

at Workshop m/s MY CAR CONSULTANTS

of 60, JLN LAMHART #10 5-21

Insured: CTI

Policy No. \_\_\_\_\_

Claims No. \_\_\_\_\_


Sum Insured: \_\_\_\_\_ Excess: \_\_\_\_\_

(Client's Record)

Make of Veh: \_\_\_\_\_

(Policy Condition)

Remark: The veh had commenced its repair at the time of inspection.

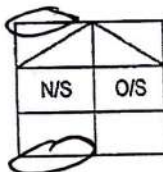

Bal. or Market Value: 162k

IDAC Accident Rpt: \_\_\_\_\_ Consistent? : Yes or No

GIA / PR Seen: \_\_\_\_\_ Consistent? : Yes or No

Est. Repairs: \_\_\_\_\_ days Res.: Yes or No

Lum Sum: \_\_\_\_\_ % 3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Vehicle: IN / OUT

Date: \_\_\_\_\_ Person Contacted: \_\_\_\_\_

Veh No: SNA521ST Yr Regn: 2021 / Jun  
Type: (M) Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /  
Truck / Trailer or \_\_\_\_\_  
Make: TOYOTA PRIUS SOR H.B.A C.C. 1798  
Colour: GREY A/C: Insured / Std / NI / NA  
Sp. Reading: 134874 T/Radio: Insured / Std / NI / NA  
Eng/No: \_\_\_\_\_  
C/No: 3TDKB3FU903091914  
Gen. Cond: Good / Rain / Poor / Burnt  
Steering: In order / Jammed / Leaked / Burnt or \_\_\_\_\_  
Brake: In order / Jammed / Leaked / Burnt or \_\_\_\_\_  
Modi: Nil / S/Rim / STD A/Rim or \_\_\_\_\_  
Tyre Size: F: 195/65R15  
R: \_\_\_\_\_

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /  
TOYO / YOKO or **ARIVO**

Front

R/Bal. 6 mm

L/Bal. 6 mm

D.O.A. 03/10/22

Survey held at My CAC CONSULTANT

Rear

R/Bal. 6 mm

L/Bal. 6 mm

D.O.I. 05/10/22

Des. of Damages : Frt / Rear / O/S / N/S / U/C / Rooftop or  
FRT N/S & REAR N/S

The U/C / Chassis frame / Body Structure affected due to collision.

[illegible]

Date/Time, File Pass to?

☐: Preli. Report

1)

**□: Final Report**

Date/Time, File Return to?

2)

Rep. Form(s) :

Lump Sum / L.E.J. Co.

Days Of Repair:

Resurvey No. of Trip:

Add Fee:  : Site Insp (\$

Site Insp (\$

☐ : Interview (\$

Tech. Invs (\$

☐ Weekend (S)

Survey Fee:

Transportation:

$$S + RS, \quad SI$$

## Photos

Others

TOTAL





# MY CAR CONSULTANT PTE LTD

Reg no.: 201605878Z

Address: 60 JALAN LAM HUAT, CARROS CENTRE #05-68 S737986

HP: 98888885

## Estimation

Date:

5/10/2022

Vehicle:

SNA5215T

Make / Model:

TOYOTA PRIUS

Chassis:

CHINA TAIPING

No.	Description	Unit	Unit Price	Amount
1	BONNET <i>bt</i> /	1	\$ 989.00	\$ 989.00
2	BONNET HINGES <i>bt</i> /	1	\$ 56.00	\$ 112.00
3	BONNET LOCK ?	1	\$ 312.00	\$ 312.00
4	BONNET INSULATOR <i>bt</i> -	1	\$ 324.00	\$ 324.00
5	BONNET RUBBER <i>ne</i> /	1	\$ 25.00	\$ 25.00
6	FRONT BUMPER <i>Turn</i> /	1	\$ 798.00	\$ 798.00
7	FRONT BUMPER LOWER <i>cm</i> /	1	\$ 651.00	\$ 651.00
8	FRONT BUMPER LOGO <i>cm</i> /	1	\$ 68.00	\$ 68.00
9	FRONT BUMPER SIDE RETAINER <i>ne</i> / <i>LH</i>	1 <i>Z</i>	\$ 58.00	\$ 116.00
10	FRONT BUMPER BRACKET ?	2	\$ 52.00	\$ 104.00
11	FRONT BUMPER SPONGE <i>cm</i> /	1	\$ 215.00	\$ 215.00
12	FRONT BUMPER REINFORCEMENT ?	1	\$ 412.00	\$ 412.00
13	FRONT BUMPER FOGLAMP ?	2	\$ 312.00	\$ 624.00
14	FRONT BUMPER FOGLAMP COVER <i>LH</i> - <i>scm</i> /	1 <i>Z</i>	\$ 112.00	\$ 224.00
15	FRONT BUMPER TOWING COVER <i>LH</i> - <i>rus</i> /	1 <i>Z</i>	\$ 42.00	\$ 84.00
16	FRONT BUMPER LOWER GRILLE CENTRE <i>X</i>	1	\$ 259.00	\$ 259.00
17	FRONT BUMPER UNDER COVER <i>X</i>	1	\$ 312.00	\$ 312.00
18	FRONT BUMPER TOP RUBBER <i>cm</i> /	1	\$ 68.00	\$ 68.00
19	FRONT GRILLE <i>cm</i> /	1	\$ 498.00	\$ 498.00
20	FRONT SUPPORT PANEL <i>bt</i> /	1	\$ 898.00	\$ 898.00
21	FRONT SUPPORT PANEL TOP GARNISH <i>End</i> /	1	\$ 184.00	\$ 184.00
22	HEADLAMP <i>LH</i> <i>cm</i> / <i>RH</i> - ?	2	\$ 2,591.00	\$ 5,182.00
23	HEADLAMP LOWER BRACKET <i>LH</i> - ?	2 <i>Z</i>	\$ 42.00	\$ 84.00
24	FRONT WIPER GARNISH (CENTRE) <i>X</i>	1	\$ 311.00	\$ 311.00
25	FRONT WIPER GARNISH (SIDE) <i>X</i>	2	\$ 62.00	\$ 124.00
26	HYBRID BATTERY <i>X</i>	1	\$ 9,857.00	\$ 9,857.00
27	HYBRID BATTERY BRACKET <i>X</i>	1	\$ 357.00	\$ 357.00
28	AIR CLEANER HOUSING <i>cm</i> /	1	\$ 698.00	\$ 698.00
29	AIR CLEANER AIR DUCT <i>X</i>	1	\$ 187.00	\$ 187.00
30	ENGINE TOP COVER <i>X</i>	1	\$ 287.00	\$ 287.00
31	FRONT ENGINE MOUNTING <i>X</i>	2	\$ 612.00	\$ 1,224.00
32	FRONT EXHAUST MANIFOLD <i>X</i>	1	\$ 1,025.00	\$ 1,025.00
33	FRONT CHASSIS EXTENSION <i>X</i>	2	\$ 287.00	\$ 574.00
34	FRONT DASHBOARD <i>X</i>	1	\$ 2,985.00	\$ 2,985.00
35	FRONT DASHBOARD AIRBAG <i>X</i>	1	\$ 698.00	\$ 698.00
36	FRONT INTERIOR VIEW MIRROR <i>X</i>	1	\$ 298.00	\$ 298.00
37	ROOF LINING <i>X</i>	1	\$ 2,874.00	\$ 2,874.00
38	ROOF SIDE AIR BAG <i>X</i>	2	\$ 1,025.00	\$ 2,050.00
39	STEERING AIRBAG <i>X</i>	1	\$ 698.00	\$ 698.00
40	FRONT SEAT BELT <i>X</i>	2	\$ 989.00	\$ 1,978.00



41	FRONT SEAT AIRBAG <i>X</i>	2	\$ 698.00	\$ 1,396.00
42	FRONT SEAT COVER <i>X</i>	2	\$ 798.00	\$ 1,596.00
43	FRONT DOOR CENTRE PILLAR INNER GARNISH LOWER <i>X</i>	2	\$ 198.00	\$ 296.00
44	FUSE BOX <i>X</i>	1	\$ 878.00	\$ 878.00
45	FRONT WIRE HARNESS <i>X</i>	1	\$ 1,125.00	\$ 1,125.00
46	BATTERY TRAY <i>?</i>	1	\$ 159.00	\$ 159.00
47	BATTERY BRACKET <i>?</i>	1	\$ 42.00	\$ 42.00
48	ALTERNATOR <i>X</i>	1	\$ 1,324.00	\$ 1,324.00
49	STARTER MOTOR <i>X</i>	1	\$ 1,211.00	\$ 1,211.00
50	ENGINE TOP COVER <i>X</i>	1	\$ 258.00	\$ 258.00
51	ENGINE MOUNTING SET <i>X</i>	1	\$ 2,120.00	\$ 2,120.00
52	AIRCON COMPRESSOR <i>X</i>	1	\$ 1,327.00	\$ 1,327.00
53	AIRCON CONDENSER <i>?</i>	1	\$ 1,157.00	\$ 1,157.00
54	AIRCON CONDENSER SUCTION PIPE <i>X</i>	1	\$ 355.00	\$ 355.00
55	AIRCON CONDENSER DISCHARGE PIPE <i>X</i>	1	\$ 341.00	\$ 341.00
56	AIRCON CONDENSER AIR ARCH GARNISH <i>X</i>	2	\$ 112.00	\$ 224.00
57	RADIATOR <i>?</i>	1	\$ 1,287.00	\$ 1,287.00
58	RADIATOR COWLING <i>?</i>	1	\$ 421.00	\$ 421.00
59	RADIATOR FAN MOTOR <i>?</i>	1	\$ 598.00	\$ 598.00
60	RADIATOR FAN BLADE <i>?</i>	1	\$ 221.00	\$ 221.00
61	RADIATOR COOLANT RESERVOIR <i>X</i>	1	\$ 212.00	\$ 212.00
62	HYBRID COOLER <i>X</i>	1	\$ 1,251.00	\$ 1,251.00
63	FRONT WINDSCREEN GLASS <i>X</i>	1	\$ 1,359.00	\$ 1,359.00
64	FRONT WINDSCREEN GLASS MOULDING <i>X</i>	1	\$ 212.00	\$ 212.00
65	FRONT WIPER GARNISH CENTRE <i>X</i>	1	\$ 298.00	\$ 298.00
66	FRONT WIPER GARNISH SIDE <i>X</i>	2	\$ 52.00	\$ 104.00
67	WIPER WASHER TANK <i>X</i>	1	\$ 358.00	\$ 358.00
68	FRONT FENDER <i>LH-B1</i>	<i>1/2</i>	\$ 521.00	\$ 1,022.00
69	FRONT FENDER WHEEL HOUSING <i>X</i>	2	\$ 1,025.00	\$ 2,050.00
70	FRONT FENDER EMBLEM 'HYBRID' <i>ne</i>	2	\$ 52.00	\$ 104.00
71	FRONT FENDER COWLING <i>LH-?</i>	<i>2</i>	\$ 198.00	\$ 396.00
72	FRONT FENDER QUARTER GLASS MOULDING <i>X</i>	2	\$ 159.00	\$ 318.00
73	FRONT DOOR <i>BH-LH repair</i>	1	\$ 1,259.00	\$ 1,259.00
74	TAILGATE <i>B1</i>	1	\$ 1,359.00	\$ 1,359.00
75	TAILGATE LAMP LH <i>cm</i>	1	\$ 459.00	\$ 918.00
76	TAILGATE WEATHERSTRIP <i>ne</i>	1	\$ 212.00	\$ 212.00
77	TAILGATE OUTER GARNISH <i>cm</i>	1	\$ 521.00	\$ 521.00
78	TAILGATE LOGO <i>ne</i>	1	\$ 95.50	\$ 95.50
79	TAILGATE EMBLEM PRIUS t <i>ne</i>	1	\$ 89.40	\$ 89.40
80	TAILGATE EMBLEM HYBRID <i>ne</i>	1	\$ 82.30	\$ 82.30
81	TAILGATE ABSORBER <i>LH-B1</i>	<i>1/2</i>	\$ 251.00	\$ 302.00
82	TAILGATE LOWER GLASS <i>bo</i>	1	\$ 798.00	\$ 798.00
83	TAILGATE LOWER GLASS MOULDING <i>ne</i>	1	\$ 159.00	\$ 159.00
84	TAILGATE TOP SPOILER <i>cm</i>	1	\$ 1,125.00	\$ 1,125.00
85	TAILGATE DETECTOR <i>X</i>	1	\$ 321.00	\$ 321.00
86	TAILGATE LOCK <i>cut</i>	1	\$ 312.00	\$ 312.00
87	TAILGATE WINDSCREEN MOULDING <i>ne</i>	1	\$ 198.00	\$ 198.00
88	TAILGATE INNER TRIM BOARD <i>?</i>	1	\$ 459.00	\$ 459.00
89	TAILGATE INNER HANDLE <i>X</i>	1	\$ 38.00	\$ 38.00
90	REAR BUMPER <i>fun</i>	1	\$ 658.00	\$ 658.00



91	REAR BUMPER SIDE RETAINER LH- <i>re</i> /	1 <i>Z</i>	\$ 112.00	\$ 224.00
92	REAR BUMPER REINFORCEMENT ?	1	\$ 350.50	\$ 350.50
93	REAR BUMPER TOP LAMP LH <i>cm</i> /	1	\$ 412.00	\$ 412.00
94	REAR BUMPER BRACKET ? LH ?	1 <i>Z</i>	\$ 114.00	\$ 228.00
95	REAR BUMPER LIP <i>de</i> /	1	\$ 728.90	\$ 728.90
96	REAR BUMPER REFLECTOR LH- <i>cm</i> /	1 <i>Z</i>	\$ 68.00	\$ 136.00
97	REAR BUMPER UNDER COVER LH <i>not cm</i> /	1	\$ 321.00	\$ 321.00
98	REAR BUMPER UNDER COVER RH X	1	\$ 251.00	\$ 251.00
99	REAR FENDER LH- <i>huc</i> /	1 <i>Z</i>	\$ 898.00	\$ 1,796.00
100	REAR FENDER WHEEL HOUSING LH <i>huc</i> / <i>photo</i>	1	\$ 1,025.00	\$ 1,025.00
101	REAR FENDER COWLING <i>de</i> / LH	1 <i>Z</i>	\$ 198.20	\$ 396.40
102	REAR FENDER INNER TRIM LH-?	1 <i>Z</i>	\$ 612.00	\$ 1,218.00
103	TAILAMP LH- <i>cm</i> /	1 <i>Z</i>	\$ 581.00	\$ 1,162.00
104	TAILAMP LOWER BRACKET <i>cm</i> / LH	1 <i>Z</i>	\$ 82.00	\$ 164.00
105	REAR END PANEL <i>lt</i> /	1	\$ 612.00	\$ 612.00
106	REAR END PANEL TOP GARNISH ?	1	\$ 212.00	\$ 212.00
107	REAR FLOOR PANEL <i>repu</i> /	1	\$ 1,151.00	\$ 1,151.00
108	REAR FLOOR PANEL TOP BOARD ?	1	\$ 398.00	\$ 398.00
109	REAR FLOOR PANEL SIDE LH ?	1	\$ 352.00	\$ 352.00
110	REAR FLOOR PANEL TOP SIDE SPONGE ?	2	\$ 312.00	\$ 624.00
111	REAR FLOOR PANEL TOP CENTRE SPONGE ?	1	\$ 522.00	\$ 522.00
112	REAR DOOR LOCK LH ?	1	\$ 321.00	\$ 321.00
113	REAR DOOR WEATHERSTRIP LH X	1	\$ 212.00	\$ 212.00
114	REAR EXHAUST HEAT SHIELD X	1	\$ 312.00	\$ 312.00
	① Tailgate top garnish <i>cm</i> /			\$ 64,047.00
	② Tailgate lower glass inner trim ?		Less 20%	\$ 12,809.40
	③ Rear fender <i>Av van de</i> /		Total	\$ 51,237.60
	④ Fender top garnish <i>mis</i> /			
	S/Nett items:			
1	BONNET INSULATOR CLIPS SET <i>re</i> /	1	\$ 50.00	\$ <del>30</del> 50.00 <i>30</i>
2	FRONT NUMBER PLATE <i>lt</i> /	1	\$ 50.00	\$ <del>35</del> 50.00 <i>35</i>
3	FRONT BUMPER CLIPS SET <i>re</i> /	1	\$ 50.00	\$ <del>30</del> 50.00 <i>30</i>
4	FRONT FENDER COWLING CLIP SET <i>re</i> /	1	\$ 50.00	\$ <del>30</del> 50.00
5	FRONT SUPPORT TOP GARNISH CLIP SET <i>re</i> /	1	\$ 30.00	\$ <del>20</del> 30.00
6	BATTERY ?	1	\$ 300.00	\$ <del>150</del> 300.00
7	FRONT WINDSCREEN SEALANT X	1	\$ 80.00	\$ X 80.00
8	FRONT WINDSCREEN INNER SEAL X	1	\$ 80.00	\$ X 80.00
9	GEARBOX OIL X	1	\$ 150.00	\$ X 150.00
10	FRONT DASHBOARD CLIP X	1	\$ 80.00	\$ X 80.00
11	ROOF LINING CLIP X	1	\$ 100.00	\$ X 100.00
12	BARKE FLUID X	1	\$ 80.00	\$ X 80.00
13	FRONT SPORTS RIM LH X	1	\$ 800.00	\$ X 800.00
14	FRONT TYRE LH X	1	\$ 180.00	\$ X 180.00
15	INTERIOR CAMERA X	1	\$ 400.00	\$ X 400.00
16	BARKE FLUID X	1	\$ 80.00	\$ X 80.00
17	COOLANT <i>re</i> /	1	\$ 30.00	\$ 30.00 ✓
18	REAR BUMPER CLIPS <i>re</i> /	1	\$ 80.00	\$ <del>30</del> 80.00
19	REAR TAILGATE INNER TRIM BOARD CLIPS <i>re</i> /	1	\$ 80.00	\$ <del>40</del> 80.00
20	REAR WINDSCREEN SEALANT <i>re</i> /	1	\$ 80.00	\$ <del>30</del> 80.00
21	REAR WINDSCREEN INNER SEAL <i>re</i> /	1	\$ 80.00	\$ <del>30</del> 80.00
22	REAR FENDER INNER TRIM CLIPS SET <i>re</i> /	1	\$ 50.00	\$ <del>30</del> 50.00



23	REAR NUMBER PLATE <del>X</del>	1	\$ 50.00	\$ <del>X</del> 50.00
24	REAR NUMBER PLATE GARNISH <del>X</del>	1	\$ 50.00	\$ <del>X</del> 50.00
25	REAR REVERSE SENSOR <del>nu</del>	1	\$ 250.00	\$ <del>200</del> 250.00
26	REAR REVERSE CAMERA <del>X</del>	1	\$ 350.00	\$ <del>X</del> 350.00
27	REAR END PANEL TOP GARNISH CLIPS <del>nu</del>	1	\$ 80.00	\$ <del>70</del> 80.00
28	REAR END PANEL SEALANT <del>nu</del>	1	\$ 60.00	\$ <del>40</del> 60.00
				\$ 2,510.00
	Labour to:FRONT			
1	TO CHECK REAR ELECTRICAL WIRING <del>u</del>	1	\$ 150.00	\$ <del>60</del> 150.00
2	REMOVE AND REFIR AICON AND RADIATOR <del>nu</del>	1	\$ 150.00	\$ <del>100</del> 150.00
3	REALIGN HEADLAMP <del>X</del>	1	\$ 50.00	\$ <del>X</del> 50.00
4	RESET HYBRID BATTERY CODE <del>X</del>	1	\$ 300.00	\$ <del>X</del> 300.00
5	REMOVE AND REFIR ENGINE ASSEMBLY <del>X</del>	1	\$ 500.00	\$ <del>X</del> 500.00
6	REALIGN FRONT CHASSIS <del>X</del>	1	\$ 1,200.00	\$ <del>X</del> 1,200.00
7	TO REMOVE AND RENEW FRONT WINDSCREEN GLASS <del>X</del>	1	\$ 150.00	\$ <del>X</del> 150.00
8	TO REMOVE AND REFIT ENGINE ASSEMBLY <del>X</del>	1	\$ 800.00	\$ <del>X</del> 800.00
9	REMOVE AND RENEW GEARBOX ASSEMBLY <del>X</del>	1	\$ 500.00	\$ <del>X</del> 500.00
10	REMOVE AND RENEW FRONT DASHBOARD <del>X</del>	1	\$ 400.00	\$ <del>X</del> 400.00
11	REMOVE AND RENEW FRONT SEAT BELT <del>X</del>	2	\$ 150.00	\$ <del>X</del> 300.00
12	REMOVE AND RENEW STEERING AIRBAG <del>X</del>	1	\$ 150.00	\$ <del>X</del> 150.00
13	REMOVE AND RENEW ROOF LINING <del>X</del>	1	\$ 400.00	\$ <del>X</del> 400.00
14	TO REMOVE AND RENEW REVERSE SENSOR <del>nu</del>	1	\$ 150.00	\$ <del>60</del> 150.00
15	TO REMOVE AND REFIT REAR GLASS <del>nu</del>	1	\$ 150.00	\$ <del>80</del> 150.00
16	REMOVE AND RENEW REAR GARNISH / UPHOLSTERY <del>nu</del>	1	\$ 200.00	\$ <del>60</del> 200.00
17	REMOVE AND RENEW TAILGATE MECHANISM <del>nu</del>	1	\$ 80.00	\$ <del>40</del> 80.00
18	REMOVE AND RENEW REAR EXHAUST SILENCER <del>X</del>	1	\$ 150.00	\$ <del>X</del> 150.00
19	REMOVE AND RENEW FRONT UNDERCARRIAGE <del>X</del>	1	\$ 600.00	\$ <del>X</del> 600.00
20	CONDUCT WHEEL ALIGNMENT <del>X</del>	1	\$ 150.00	\$ <del>X</del> 150.00
21	TO RESPRAY UNDERCOATING <del>nu</del> <del>X</del>	1	\$ 150.00	\$ <del>80</del> 150.00
22	APPLY ANTI RUST ON AFFECTED AREAS <del>nu</del>	1	\$ 200.00	\$ <del>X</del> 200.00
23	SPRAY PAINTING ON AFFECTED AREAS	1	\$ 3,200.00	\$ 3,200.00
24	PANEL BEATING ON AFFECTED AREAS	1	\$ 3,200.00	\$ 3,200.00
				\$ 13,280.00
			Parts Replacement Amount	\$ 53,747.60
			Total Amount for Labour	\$ 13,280.00
			Total Amount	\$ 67,027.60

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer  
Signature:  
Date:

Rasul  
Hy 90014068  
14 days  
4/5  
05/10/22 @

# SINGAPORE ACCIDENT STATEMENT

## IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Actual Driver
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

## ACCIDENT STATEMENT

Date of Submission	04/10/2022 09:42 (SGT)
Reported by	Driver
Date of Accident	03/10/2022 09:55 (SGT)
Exact Location of Accident	PIE, Singapore
Additional Location Information	(TUAS) NEAR TOH GUAN EXIT
Country/State of Loss	Singapore

## DETAILS OF OWN VEHICLE

Vehicle Registration Number	SNA5215T
INSURED/POLICYHOLDER	
Is company?	Yes
Name Of Registered Owner	LUMENS AUTO PTE LTD
Company Reg No	2XXXXX961K
Email Address	kokhow.tay@lumens.sg
Mobile Phone No	(Phone) +65-91818678
Alternative Phone No	(Office) +65-87781765

## VEHICLE PARTICULARS

Manufacturer	Toyota
Model	Prius
Variant	-
Exact purpose for which vehicle was being used at time of accident	Private hire
Are you claiming under your own insurance policy for repair to your vehicle?	No - Claiming third party
Vehicle Category	Private hire
Transmission	Auto
CC	1798

## INSURANCE COMPANY

Name of Insurance Company	India International Insurance Pte Ltd
Policy Number / Cover Note Number	D20MFL0005826_01

## DRIVER

Name of Driver	TAY BOON PINN
NRIC No	SXXXX343E
Date Of Birth	27/08/1962
Occupation	Outdoor



Date Of Driving Pass	07/08/1984
Driving experience	38 YEARS AND 2 MONTHS
Gender	Male
Mobile Number	(Phone) +65-91818678
Alt. Phone Number	-
Email Address	kokhow.tay@lumens.sg
Address	103C EDGEFIELD PLAINS #13-75
Address complement	-
Postcode	823103
Is the driver the policyholder?	No
If No, Relationship of the Driver with the Insured	Hirer
Does Driver Own Other Vehicles?	No
Vehicle Registration Number of Other Vehicle Owned by Driver	-
Insurance Company of Other Vehicle Owned by Driver	-

#### GENERAL INFORMATION OF THE ACCIDENT

Type of Accident	Chain Collision
Weather Conditions	Clear
Road Surface	Dry

#### OTHER INFORMATION

Was any foreign vehicle involved in the accident?	No
Number of vehicles involved in the accident	4
Was anybody injured in the Accident?	No
Was any injured conveyed to hospital by ambulance?	-
Was any other vehicle or property damaged?	Yes
Number of Passengers (Including Driver)	2
Has the driver been approached by unknown person(s) soliciting/offering accident claims assistance?	No
Translator's name	-
Translator's ID	-
Translator's phone number	-
Translator's email	-
Original language used in the statement	-

#### PASSENGER 1

Name	FRANCESCO MADDALENA
Gender	Male

#### DETAILS OF POLICE ACTION

Was the accident reported to the police?	No
Was notice of intended Prosecution given?	No
If yes, against whom?	-

#### CIRCUMSTANCES OF ACCIDENT

ON 03/10/2022 AT AROUND 0955HRS, I WAS DRIVING VEHICLE A (SNA5215T) ALONG PIE TOWARDS TUAS NEAR TOH GUAN EXIT. WHILE STATIONARY IN A TRAFFIC JAM, VEHICLE B (CB7503Z) SUDDENLY REAR ENDED VEHICLE A, CAUSING VEHICLE A TO ROLL FORWARD AND REAR END VEHICLE C (SMG9792Y). THE IMPACT CAUSED VEHICLE C TO ALSO ROLL FORWARD AND REAR END VEHICLE D (SHB6253S). I SUFFERED BACK INJURY BUT HAVE YET TO SEE A DOCTOR. THERE WERE NO OTHER VEHICLES INVOLVED IN THE CHAIN COLLISION.

#### ATTACHMENT(S)

Are accident photos available for attachment?	Yes
Was there any video captured by Car Camera?	No

#### DETAILS OF OTHER VEHICLE PROPERTY 1

Vehicle Registration Number	CB7503Z
-----------------------------	---------

Vehicle Manufacturer	Nissan
Vehicle Model	-
Vehicle Variant	-
Vehicle Colour	-
Vehicle Category	Bus
Name of Driver	BI GUANGJUN
Passport No/FIN	GXXXX276M
Contact Number	-
Address	-
Address complement	-
Postcode	-
Insurance Company Name	-
Nature Of Damage	-
Details of property damaged in accident	-
No. Of Passenger (Including Driver)	1

#### DETAILS OF OTHER VEHICLE PROPERTY 2

Vehicle Registration Number	SMG9792Y
Vehicle Manufacturer	Subaru
Vehicle Model	-
Vehicle Variant	-
Vehicle Colour	-
Vehicle Category	Private car
Name of Driver	PEK CHIK LAY
NRIC No	SXXXX805G
Contact Number	-
Address	-
Address complement	12C HOUGANG STREET 11 #13-65
Postcode	534072
Insurance Company Name	-
Nature Of Damage	-
Details of property damaged in accident	-
No. Of Passenger (Including Driver)	-

#### DETAILS OF OTHER VEHICLE PROPERTY 3

Vehicle Registration Number	SHB6253S
Vehicle Manufacturer	Hyundai
Vehicle Model	-
Vehicle Variant	-
Vehicle Colour	-
Vehicle Category	Taxi
Name of Driver	KOH CHONG HUAT
NRIC No	SXXXX562G
Contact Number	-
Address	-
Address complement	865 TAMPINES STREET 83 #06-215
Postcode	520865
Insurance Company Name	-
Nature Of Damage	-
Details of property damaged in accident	-
No. Of Passenger (Including Driver)	-



# SKETCH PLAN

## IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. The report will be forwarded by the Insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
7. By the lodgement of this report to the Insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.
8. **Consent under the Personal Data Protection Act (PDPA)**  
I understand, acknowledge, agree and consent that :  
(a) My insurer, my workshop and the General Insurance Association of Singapore ("GIA") may/are permitted to collect, use, disclose and/or process my personal data/personal information set out in this [form] and any other personal information provided by me or possessed by my insurer (collectively the "Personal Information") and disclose and transfer such Personal Information to all insurer(s) who have insured vehicle(s) involved in this accident (all insurer(s) who have insured vehicle(s) involved in this accident shall be collectively referred to as the "Insurers"), the Insurers' lawyers/law firms, the Monetary Authority of Singapore and any relevant government agency/authority (such as the police), for the purpose(s) of :  
(i) processing, handling and/or dealing with my claims including the settlement of the claims and any necessary investigations relating to the claims;  
(ii) investigating the accident and/or my claims;  
(iii) carrying out and/or dealing with my instructions or responding to any enquiries by me;  
(iv) administering my claims (including the mailing of correspondence, statements, invoices, reports or notices to me, which could involve disclosure of certain personal data about me to bring about delivery of the same as well as on the external cover of envelopes/mail packages); and/or  
(v) complying with applicable law in administering, processing, handling and/or dealing with my claims.  
(collectively the "Purposes")  
(b) all insurer(s) who have insured vehicle(s) involved in this accident and the Insurers' lawyers/law firms, may/are permitted to collect, use, disclose and/or process my Personal Information for one or more of the above Purposes; and  
(c) my Personal Information may/can be disclosed by any of the Insurers and/or GIA to their third party service providers or agents (including their lawyers/law firms), which may be sited outside of Singapore, for one or more of the above Purposes.



*[Handwritten Signature]*

**FLASH ACCIDENT  
REPORTING OFFICER**  
FRO SUFIYAN



Policyholder's Signature / Date & Time

Driver's Signature (If driver is not the policyholder) / Date & Time  
**03/10/2022 1620HRS**

Witnessed by Reporting Centre Personnel

Sketch Plan

A - SNA5215T  
B - CB7503Z  
C - SMG9792Y  
D - SHB6253S

PIE TOWARDS TUAS NEAR TOH GUAN EXIT



> Back to OneMotoring

## Enquire PARF/COE Rebate for Registered Vehicle

Owner ID Type:	Company
Owner ID:	961K
Vehicle No.:	SNA5215T
Vehicle to be Exported:	No
Intended Deregistration Date:	06 Oct 2022
Vehicle Make:	TOYOTA
Vehicle Model:	PRIUS 5DR HATCHBACK (AUTO)
Primary Colour:	Silver
Manufacturing Year:	2020
Engine No.:	2ZR2G92130
Chassis No.:	JTDKB3FU903091914
Maximum Power Output:	90.0 kW (120 bhp)
Open Market Value:	\$26,807.00
Original Registration Date:	28 Jun 2021
First Registration Date:	28 Jun 2021
Transfer Count:	0
Actual ARF Paid:	\$14,530.00
PARF Eligibility:	Yes
PARF Eligibility Expiry Date:	27 Jun 2031
PARF Rebate Amount:	\$10,897.00
COE Expiry Date:	27 Jun 2031
COE Category:	B - Car above 1600cc or 97kW (130bhp)
COE Period(Years):	10
QP Paid:	\$52,309.00
COE Rebate Amount:	\$45,639.00
Total Rebate Amount:	\$56,536.00

The information contained herein is correct as at 06 Oct 2022

OK



# Toyota Prius Plus Hybrid 1.8A

Overview

Financial

Accessories

Similar

Research

Photos

Map



**CAR CHOICE**  
SINGAPORE

**The Best Buying Experience**



Price	<b>\$179,988</b>		
Depreciation ⓘ	\$17,610 /yr <a href="#">View models with similar depre</a>	Reg Date	15-Jul-2022 (9yrs 9mths 8days COE left)
Mileage	N.A.	Manufactured ⓘ	2021
Road Tax ⓘ	N.A.	Transmission	Auto
Dereg Value ⓘ	\$99,723 as of today ( <a href="#">change</a> )	Fuel Type	Petrol-Electric
COE ⓘ	\$90,002	OMV ⓘ	\$27,588
Engine Cap	1,798 cc	ARF ⓘ	\$15,624
Curb Weight ⓘ	1,500 kg	Power	100.0 kW (134 bhp)