

REF:

AG/ 228009946/kp

ASS. REC. BY:

Kenneth

ASSIGNMENT

From: _____ Date: _____

Estimated Cost: _____

OD / TP / WS / TP RES / OD RES / EVA / INV / MY

To Inspect Vehicle No: _____

at Workshop m/s _____

of _____

Insured: _____

Policy No. _____


Claims No. _____

Sum Insured: _____ Excess: _____

(Client's Record)

Make of Veh: _____

(Policy Condition)

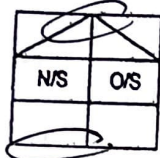Remark: The veh had commenced its
repair at the time of inspection.Bal. or Market Value: 872K

IDAC Accident Rpt: _____ Consistent? : Yes or No

GIA / PR Seen: _____ Consistent? : Yes or No

Est. Repairs: 21 days Res.: Yes or NoLum Sum: 20 % 3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date: _____ Person Contacted: _____

Vehicle: IN / OUT

Veh No: SLX1217S Yr Regn: 03, 18Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /Truck / Trailer or AMake: Mercedes 3 c.c. 1496Colour: M.P. white A/C: Insured / Std / NI / NASp. Reading: 61252 T/Radio: Insured / Std / NI / NA

Eng/No: _____

C/No: TM6BN22A8J0-183141Gen. Cond: Good / Fair / Poor / BurntSteering: In order / Jammed / Leaked / Burnt orBrake: In order / Jammed / Leaked / Burnt orModl: Nil / S/Rlm / STD / A/Rlm orTyre Size: F: 205/60R16

R: _____

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or

Front _____ Rear _____

R/Bal. 8 mm R/Bal. 8 mmL/Bal. 8 mm L/Bal. 8 mmD.O.A. 8/10/22 D.O.I. 17/10/2022

Survey held at _____

Des. of Damages: Frt / Rear / O/S / N/S / UIC / Rooftop orRear N/S & 1st

The UIC / Chassis frame / Body Structure affected due to collision.

Date / Time Action / Instruction

Date/Time, File Pass to?

☐

: Prel. Report

1)

☐

: Final Report

Date/Time, File Return to?

2)

Days Of Repair: _____

Resurvey No. of Trip: _____

Add Fee:

☐

: Site Insp (\$

☐

: Interview (\$

☐

Tech Invs (\$

☐

Weekend (\$

Survey Fee:

Transportation

\$ - RS. \$

Fees

Others

TOTAL

Report Format :

Lump Sum / I.B.I: (\$

Cheng Hoe Motor Pte Ltd

Blk 1019, Yishun Industrial Park A #01-374/382, Singapore 768761
TEL: 67556142 (YIS) FAX: 67557719 (YIS) Email: chmotor@singnet.com.sg
GST:201001158E RCB NO:201001158E

SLX1217S
TP/AIG

M/S : AIG ASIA PACIFIC INSURANCE PTE LTD
78 SHENTON WAY
#07-16 AIG BUILDING
SINGAPORE 079120

TEL: 64193000
ATTN: Motor Claim Department

FAX: 64153727

Not Authorized

WS Ref: TP/AIG
Claim Type: Third Party
Accident Date: 06/10/2022
TP Veh Reg No: GBL9899C

*1/Reg &
Recovery After Repair
21 days*

Estimate No: ES2291063/YISHUN
Date: 17 Oct 2022
Policy No: 5130022771
Veh Reg No: SLX1217S
Make/Model: MAZDA MAZDA 3
SEDAN 1.5 AT LED EU6
Chassis No: JM6BN22A8J0183141
Engine No: P520472853
Reg. Date: 16/03/2018

Estimate Repair Cost to Vehicle No :SLX1217S

Description	U/Price	Quantity	List Price S\$	Amount S\$
List Price				
1 FRONT BUMPER	856.80	1 PC	<i>Br</i> 856.80	✓
2 FRONT BUMPER LH DAY RUNNING LAMP	147.00	1 PC	<i>Sm</i> 147.00	X
3 FRONT BUMPER DAY RUNNING LAMP CHROME	71.30	1 PC	<i>Sm</i> 71.30	X
4 FRONT BUMPER REINFORCEMENT	502.80	1 PC	502.80	?
5 FRONT BUMPER REINFORCEMENT COVER	97.40	1 PC	97.40	?
6 FRONT BUMPER REINFORCEMENT SPONGE	116.20	1 PC	116.20	?
7 FRONT GRILLE BASE	135.50	1 PC	<i>cm</i> 135.50	✓
8 FRONT GRILLE CENTRE EMBLEM	61.50	1 PC	<i>pu</i> 61.50	✓
9 FRT GRILLE FIN - RH TOP	39.10	1 PC	<i>mi</i> 39.10	✓
10 FRONT GRILLE FIN - LH TOP	39.10	1 PC	<i>cm</i> 39.10	✓
11 FRONT GRILLE FIN - RH MID 2	39.10	1 PC	<i>mi</i> 39.10	✓
12 FRONT GRILLE FIN - LH MID 2	39.10	1 PC	<i>cm</i> 39.10	✓
13 FRONT GRILLE FIN - RH MID 3	39.10	1 PC	39.10	?
14 FRONT GRILLE FIN - LH MID 3	39.10	1 PC	39.10	?
15 FRONT GRILLE LOWER FIN	71.00	1 PC	71.00	?
16 FRONT GRILLE MID FIN	71.00	1 PC	71.00	?
17 FRONT GRILLE BOTTOM FIN	59.70	1 PC	59.70	?
18 FRONT GRILLE LH SURROUND	20.50	1 PC	20.50	?
19 FRONT GRILLE LH SURROUND CHROME	191.70	1 PC	<i>cm</i> 191.70	✓
20 FRONT GRILLE RH SURROUND	20.50	1 PC	20.50	?
21 FRONT GRILLE RH SURROUND CHROME	191.70	1 PC	191.70	?
22 FRONT NUMBER PLATE GARNISH	74.60	1 PC	<i>pu</i> 74.60	✓
23 FRONT GRILLE LH BRACKET	27.30	1 PC	27.30	?
24 FRONT GRILLE LH BRACKET PIN	5.50	1 PC	5.50	?
25 FRONT GRILLE LH BRACKET PIN HOLDER	12.00	1 PC	12.00	?
26 FRONT GRILLE RH BRACKET	27.30	1 PC	27.30	?
27 FRONT GRILLE RH BRACKET PIN	5.50	1 PC	5.50	?
28 FRONT GRILLE RH BRACKET PIN HOLDER	12.00	1 PC	12.00	?
29 FRONT GRILLE TOP PLATE	141.40	1 PC	<i>cm</i> 141.40	✓
30 FRONT GRILLE TOP PLATE CLIPS	4.50	10 PCS	<i>mi</i> 45.00	✓
31 FRONT GRILLE TOP PLATE RIVETS	5.50	6 PCS	<i>mi</i> 33.00	✓
32 FRONT GRILLE TOP PLATE COVER	355.50	1 PC	<i>cm</i> 355.50	✓
33 FRONT GRILLE TOP PLATE COVER CLIPS	4.50	6 PCS	<i>mi</i> 27.00	✓
34 FRONT BUMPER LOWER STIFFENER	144.60	1 PC	144.60	?
35 HEADLAMP LH	3,778.60	1 PC	<i>Br</i> 3,778.60	✓
36 HEADLAMP LOWER BEAM LH	12.90	1 PC	12.90	?
37 HEADLAMP RH	3,778.60	1 PC	3,778.60	?

Cheng Hoe Motor Pte Ltd

Blk 1019, Yishun Industrial Park A #01-374/382, Singapore 768761
TEL: 67556142 (YIS) FAX: 67557719 (YIS) Email: chmotor@singnet.com.sg
GST:201001158E RCB NO:201001158E

M/S : AIG ASIA PACIFIC INSURANCE PTE LTD
78 SHENTON WAY
#07-16 AIG BUILDING
SINGAPORE 079120
TEL: 64193000 FAX: 64153727
ATTN: Motor Claim Department

WS Ref: TP/AIG
Claim Type: Third Party
Accident Date: 06/10/2022
TP Veh Reg No: GBL9899C

Estimate No: ES2291063/YISHUN
Date: 17 Oct 2022
Policy No: 5130022771
Veh Reg No: SLX1217S
Make/Model: MAZDA MAZDA 3
SEDAN 1.5 AT LED EU6
Chassis No: JM6BN22A8J0183141
Engine No: P520472853
Reg. Date: 16/03/2018

Estimate Repair Cost to Vehicle No :SLX1217S

Description	U/Price	Quantity	List Price	Amount
			S\$	S\$
38 HEADLAMP LOWER BEAM RH	12.90	1 PC	12.90	X
39 FRT SUPPORT PANEL	491.20	1 PC	491.20	✓
40 FRONT LH FENDER INNER PANEL	576.80	1 PC	576.80	X
41 FRONT LH FENDER	350.60	1 PC	350.60	✓
42 BONNET	1,126.70	1 PC	1,126.70	✓
43 BONNET RUBBER SEAL - FRONT	66.80	1 PC	66.80	✓
44 BONNET RUBBER SEAL - MID	92.00	1 PC	92.00	✓
45 BONNET HINGES	43.10	2 PCS	86.20	✓
46 BONNET LOCK	207.10	1 PC	207.10	✓
47 AIR-CON CONDENSER	1,116.20	1 PC	1,116.20	?
48 RADIATOR	1,118.30	1 PC	1,118.30	?
49 RADIATOR TOP HOSE	62.50	1 PC	62.50	X
50 RADIATOR TOP MOUNTINGS	38.00	2 PCS	76.00	?
51 RADIATOR FAN ASSY	1,424.70	1 PC	1,424.70	?
52 AIR INTAKE DUCT	97.40	1 PC	97.40	✓
53 AIR FILTER TOP CASING	79.20	1 PC	79.20	✓
54 AIR FILTER LOWER CASING	83.70	1 PC	83.70	?
55 AIR RESONATOR	274.40	1 PC	274.40	?
56 AIR RESONATOR DUCT	89.10	1 PC	89.10	?
57 THROTTLE VALVE AIR DUCT	102.20	1 PC	102.20	?
58 WIPER GARNISH LH COVER	227.40	1 PC	227.40	✓
59 REAR BUMPER	996.70	1 PC	996.70	✓
60 REAR BUMPER LH RETAINER	53.00	1 PC	53.00	✓
61 REAR BUMPER LH REFLECTOR	53.00	1 PC	53.00	✓
62 REAR BUMPER LH TOW-EYE COVER	19.50	1 PC	19.50	✓
63 REAR BUMPER REINFORCEMENT	564.20	1 PC	564.20	?
64 REAR BUMPER PDC SENSORS	203.00	2 PCS	406.00	✓
65 REAR BUMPER PDC SENSOR HOLDERS	16.00	4 PCS	64.00	?
66 REAR BUMPER PDC WIRE HARNESS	152.80	1 PC	152.80	?
67 BOOTLID	1,005.30	1 PC	1,005.30	✓
68 BOOTLID LH HINGE	152.00	1 PC	152.00	✓
69 BOOTLID RH HINGE	152.00	1 PC	152.00	?
70 BOOTLID UPPER LOCK	106.70	1 PC	106.70	X
71 BOOTLID WEATHER STRIP	113.10	1 PC	113.10	50 pin
72 BOOTLID INSULATOR	26.30	1 PC	26.30	✓
73 BOOTLID INSULATOR CLIPS	4.00	8 PCS	32.00	✓
74 BOOTLID LH REFLECTOR	489.80	1 PC	489.80	✓
75 BOOTLID RH REFLECTOR	489.80	1 PC	489.80	X

Cheng Hoe Motor Pte Ltd

Blk 1019, Yishun Industrial Park A #01-374/382, Singapore 768761
 TEL: 67556142 (YIS) FAX: 67557719 (YIS) Email: chmotor@singnet.com.sg
 GST:201001158E RCB NO:201001158E

M/S : AIG ASIA PACIFIC INSURANCE PTE LTD
 78 SHENTON WAY
 #07-16 AIG BUILDING
 SINGAPORE 079120
TEL: 64193000 **FAX:** 64153727
ATTN: Motor Claim Department

Estimate No: ES2291063/YISHUN
Date: 17 Oct 2022
Policy No: 5130022771
Veh Reg No: SLX1217S
Make/Model: MAZDA MAZDA 3
 SEDAN 1.5 AT LED EU6
Chassis No: JM6BN22A8J0183141
Engine No: P520472853
Reg. Date: 16/03/2018

WS Ref: TP/AIG
Claim Type: Third Party
Accident Date: 06/10/2022
TP Veh Reg No: GBL9899C

Estimate Repair Cost to Vehicle No :SLX1217S

Description	U/Price	Quantity	List Price	Amount
			<u>S\$</u>	<u>S\$</u>
76 BOOTLID CENTER EMEBLEM	78.20	1 PC	<i>mc</i> 78.20	✓
77 BOOTLID (MAZDA3) EMBLEM	56.10	1 PC	<i>mc</i> 56.10	✓
78 BOOTLID (SKYACTIV) EMBLEM	65.80	1 PC	<i>mc</i> 65.80	✓
79 REAR LH FENDER	1,233.00	1 PC	<i>By Return</i> 1,233.00	✓
80 REAR LH FENDER INNER TRIM	190.70	1 PC	<i>mc</i> 190.70	✓
81 REAR LH FENDER INNER TRIM CLIPS	4.50	8 PCS	<i>mc</i> 36.00	✓
82 REAR LH FENDER UNDER LINER	162.00	1 PC	162.00	?
83 REAR LH FENDER UNDER LINER CLIPS	4.00	6 PCS	24.00	?
84 TAILLAMP LH	960.80	1 PC	<i>Bo</i> 960.80	✓
85 TAILLAMP PANEL LH	189.00	1 PC	<i>R</i> 189.00	✓
86 TAILLAMP RH	960.80	1 PC	<i>R</i> 960.80	X
87 REAR END PANEL	551.00	1 PC	<i>R</i> 551.00	✓
88 REAR END PANEL INNER TRIM	89.40	1 PC	89.40	?
89 REAR END PANEL INNER TRIM CLIPS	5.00	4 PCS	<i>mc</i> 20.00	✓
90 REAR FLOORBOARD PANEL	551.00	1 PC	<i>mc</i> 551.00	X
91 REAR FLOORBOARD PANEL SPONGE TRAY	398.00	1 PC	398.00	?
92 REAR WINDSCREEN GLASS	<i>cm</i> 1,015.50	1 PC	1,015.50	✓
93 REAR WINDSCREEN GLASS MOULDING	77.00	1 PC	<i>mc</i> 77.00	✓
			30,625.90	
		Less 20%	6,125.18	24,500.72
Special Net				
94 FRONT NUMBER PLATE	35.00	1 PC	35.00	
95 REAR WINDSCREEN GLASS GUM	40.00	1 PC	<i>mc</i> 40.00	✓
96 RADIATOR COOLANT	40.00	1 PC	40.00	
			115.00	115.00
Labour				
97 TOWING	50.00	1 LA	50.00	✓
98 REMOVE AND REFIX REAR WINDSCREEN GLASS	120.00	1 LA	120.00	✓
99 REMOVE AND REFIX AIRCON,CHECK,VACUUM & REFILL GAS	100.00	1 LA	100.00	✓
100 REMOVE & REFIX REAR SEAT,CARPET, TOP ROOF LINING,GARNISH,ETC	120.00	1 LA	120.00	✓
101 REMOVE & REFIX FRT BUMPER ASSY,HEADLAMPS,GRILLE,BONNET,RADIATOR,SUPPORT PANEL,FRT FENDERS,TO CUT,WELD & RENEW FRT LH FENDER INNER PANEL,TO STRAIGHTEN,KNOCK & REPAIR FRT BOTH MAIN CHASSIS & REALIGN FRT THE SAME	1,600.00	1 LA	1,600.00	<i>Good</i>

Cheng Hoe Motor Pte Ltd

Blk 1019, Yishun Industrial Park A #01-374/382, Singapore 768761
TEL: 67556142 (YIS) FAX: 67557719 (YIS) Email: chmotor@singnet.com.sg
GST:201001158E RCB NO:201001158E

M/S : AIG ASIA PACIFIC INSURANCE PTE LTD
78 SHENTON WAY
#07-16 AIG BUILDING
SINGAPORE 079120
TEL: 64193000 **FAX:** 64153727
ATTN: Motor Claim Department

WS Ref: TP/AIG
Claim Type: Third Party
Accident Date: 06/10/2022
TP Veh Reg No: GBL9899C

Estimate No: ES2291063/YISHUN
Date: 17 Oct 2022
Policy No: 5130022771
Veh Reg No: SLX1217S
Make/Model: MAZDA MAZDA 3
SEDAN 1.5 AT LED EU6
Chassis No: JM6BN22A8J0183141
Engine No: P520472853
Reg. Date: 16/03/2018

Estimate Repair Cost to Vehicle No :SLX1217S

Description	U/Price	Quantity	List Price	Amount
			<u>S\$</u>	<u>S\$</u>
102 PUTTY & RESPRAY ON FRT BUMPER,FRT BOTH FENDERS,BONNET,FRT BOTH FENDER INNER PANELS & CHASSISS,NOSE PANEL	1,200.00	1 LA	1,200.00	1100
103 REMOVE & REFIX REAR BUMPER ASSY,TAILLAMPS,BOOT,REAR LOCK ASSY,TO STRAIGHTEN,KNOCK & REPAIR REAR RH FENDER,CUT,WELD & RENEW REAR LH FENDER,REAR PANEL,LH TAILLAMP PANEL,REAR COMPARTMENT,TO BE CONTINUED	2,400.00	1 LA	2,400.00	1600
104 KNOCK & REPAIR REAR RH FENDER,REAR LH FENDER INNER PANEL,REAR LH MAIN CHASSISS AND REALIGN REAR PORTION		1 LA		
105 REMOVE & REFIX FUEL TANK	60.00	1 LA	60.00	✓
106 TO SUPPLY AND INSTALL REAR WINDSCREEN SOLAR FILM	280.00	1 LA	280.00	200
107 REMOVE & REFIX REVERSE CAMERA AND REVERSE SENSOR AND CHECK SYSTEM	50.00	1 LA	50.00	✓
108 PUTTY & RESPRAY ON REAR BUMPER,REAR PANEL,REAR COMPARTMENT,BOOT,HINGES,REAR BOTH FENDERS,REAR LH DOOR,REAR LH CHASSIS,REAR BUMPER REINFORCEMENT	1,700.00	1 LA	1,700.00	1400
109 TO CHECK REAR LH UNDER CARRIAGE & CONDUCT COMPUTERIZED WHEEL ALIGNMENT	80.00	1 LA	80.00	✓
110 REMOVE & INSTALL AUXILIARY BATTERY PACK & WIRE HARNESS	120.00	1 LA	120.00	?
111 TO REPROGRAMME AND RESET ECU	180.00	1 LA	180.00	?
112 TO MOUNT ON CAR-O-LINER,JACK & STRAIGHTEN CHASSIS	250.00	1 LA	250.00	✓
113 RUSTPROOFING	120.00	1 LA	120.00	✓
			8,430.00	8,430.00

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

Total S\$ 33,045.72

Add GST @ 7% 2,313.20

Total Amount Payable S\$ 35,358.92

For Cheng Hoe Motor Pte Ltd

AUTHORISED SIGNATURE

Inquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars

Owner ID Type: Singapore NRIC
Owner ID: 032C

Vehicle Details

Vehicle No.: SLX1217S
Vehicle to be Exported: No
Intended Deregistration Date: 06 Oct 2022
Vehicle Make: MAZDA
Vehicle Model: MAZDA3 SEDAN 1.5 AT LED EU6
Primary Colour: White
Manufacturing Year: 2017
Engine No.: P520472853
Chassis No.: JM6BN22A8J0183141
Maximum Power Output: 88.0 kW (118 bhp)
Open Market Value: \$18,638.00
Original Registration Date: 16 Mar 2018
First Registration Date: 16 Mar 2018
Transfer Count: 1
Actual ARF Paid: \$18,638.00

Intended PARF Rebate Details

PARF Eligibility: Yes
PARF Eligibility Expiry Date: 15 Mar 2028
PARF Rebate Amount: \$13,978.00

Intended COE Rebate Details

COE Expiry Date: 15 Mar 2028
COE Category: A - Car up to 1600cc & 97kW (130bhp)
COE Period(Years): 10
QP Paid: \$38,830.00
COE Rebate Amount: \$21,126.00
Total Rebate Amount: \$35,104.00

The information contained herein is correct as at 06 Oct 2022

OK

SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Actual Driver
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT

Date of Submission	07/10/2022 18:25 (SGT)
Reported by	Both
Date of Accident	06/10/2022 16:28 (SGT)
Exact Location of Accident	Singapore
Additional Location Information	SLE(EXIT 9) TO WOODLANDS AVE 12
Country/State of Loss	Singapore

DETAILS OF OWN VEHICLE

Vehicle Registration Number	SLX1217S
INSURED/POLICYHOLDER	
Is company?	No
Name Of Registered Owner	KUA SIEW HWA
NRIC No	SXXXX032C
Email Address	kuachloe@gmail.com
Mobile Phone No	(Phone) +65-97708279
Alternative Phone No	-

VEHICLE PARTICULARS

Manufacturer	Mazda
Model	MAZDA3 SEDAN 1.5 AT LED EU6
Variant	-
Exact purpose for which vehicle was being used at time of accident	Private use
Are you claiming under your own insurance policy for repair to your vehicle?	No - Claiming third party
Vehicle Category	Private car
Transmission	Auto
CC	1496

INSURANCE COMPANY

Name of Insurance Company	Income Insurance Limited
Policy Number / Cover Note Number	5130022771

DRIVER

Name of Driver	KUA SIEW HWA
NRIC No	SXXXX032C
Date Of Birth	24/04/1989
Occupation	Indoor

Describe Circumstance of the Accident


NOTE PLEASE TAKE NOTE THAT YOUR INSURER HAVE 14 DAYS TIME FRAME for you to submit OWN DAMAGE Claim under your Own Comprehensive policy. Pls check your policy for more information.

() Claim Own Policy

(✓) Claim Third party

() Reporting Only

Sketch Plan

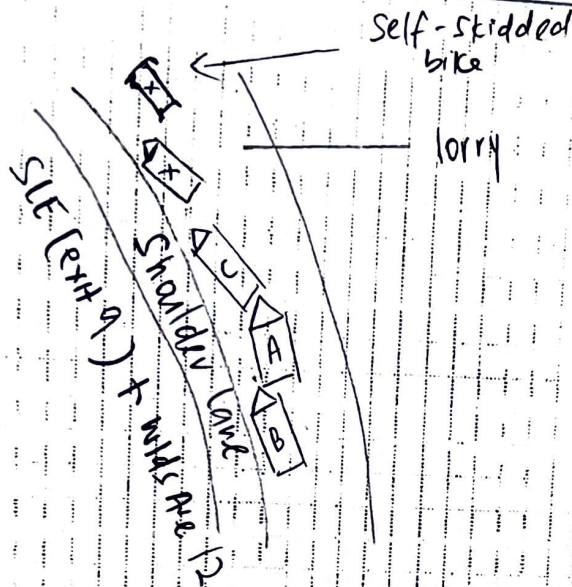

A = SLX12175

B = GBL 9899C
Ong Boon Hong
68801287P
hp: 9897 2912

C = GBJ 5008U
hp: 87213839

Doa: 6/10/22

Time: 1628hrs

Ins: Income

I saw m/lorry (C) in front of me braked and stopped. I follow to brake and stop in time. The next moment, I felt a strong impact from the rear and my car was pushed to the front and hit onto the rear of m/lorry (C). I came out of my car to check and realized I am involved in a chain accident of total 3 vehicles including mine. I later understand that a m/bike had self-skidded thus causing vehicles ahead to stop.

No injuries on anyone. I have 1 passenger onboard (my husband). It was after rain at that time.

John

Declaration

I/We declare the foregoing particulars are true in every respect.

Policyholder's Signature / Date & Time

Driver's Signature (if driver is not the policyholder) / Date & Time

Witnessed by Reporting Centre Personnel
(Name as in NRIC/ID card) Efecta

7/10/22

CYS
2