



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

LONPAC INSURANCE BHD

INV No. AC2300361

300 BEACH ROAD
#17-04/07 THE CONCOURSE
SINGAPORE 199555

INV Date 17/01/2023
Reference CC4/LPC22009953/Upa3q2
Code LPC2

PROFESSIONAL SERVICE FEE

Vehicle No. SNB 5877C
Insured Veh. SMJ 8891K
Claim No. 22/22/22/VP05/026401
Policy No. Z22VP05031507
Accident Date 08/10/2022
Inspection Date 10/10/2022

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (8%)	32.00
Grand Total	432.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
LONPAC INSURANCE BHD 300 BEACH ROAD #17-04/07 THE CONCOURSESINGAPORE 199555			Ref: CC4/LPC22009953/Upa3q2 Date: 17/01/2023 Code: LPC2	
1. Policy Particulars :- THIRD PARTY CLAIM				
	Insured Veh.	SMJ 8891K	Veh. Inspected	SNB 5877C
	Policy No.	Z22VP05031507	Coverage (\$)	0.00
	Claim No.	22/22/22/VP05/026401	Excess (\$)	0.00
	Assign From	GERALD	Assign Date	10/10/2022
2. Vehicle Particulars & Condition				
	Make & Model	MERCEDES BENZ GLC250 AMG LINE (A)	c.c	1991
	Engine No.	HIDDEN	Year of Reg.	2017
	Chassis No.	WDC2539462F209836	Colour	BLUE
	Odometer	69614 KM	Steering	IN ORDER
	Brakes	IN ORDER	Modification	SPORTS RIM
	General	GOOD		
3. Conditions of Tyres				
		Size	Make	Balance
	R/H Front Tyre	255/45 R20	MICHELIN	7 mm
	L/H Front Tyre	255/45 R20	MICHELIN	7 mm
	R/H Rear Tyre	255/45 R20	MICHELIN	7 mm
	L/H Rear Tyre	255/45 R20	MICHELIN	7 mm
4. Description of Damages				
	THE VEHICLE SUSTAINED DAMAGES AT THE REAR PORTION. DAMAGES SEE DETAILS.			
5. General Information				
	Accident Date	08/10/2022	Inspection Date	10/10/2022
	Survey held at	ZOOM AUTOWERKS PTE LTD 130 BEDOK RESERVOIR ROAD, #08-1339,EUNOS SPRING SINGAPORE 470130		
5a. Remarks				
	A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.			
5b. Estimate Days of Repair				
	ESTIMATED NORMAL PERIOD FOR REPAIR:		4 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SNB 5877C

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	REAR WINDSCREEN MOULDING	NECESSARY	175.00	162.00
1	REAR TAILGATE	BADLY DENTED	3,080.00	3,022.00
2	REAR TAILGATE DAMPERS	NOT NECESSARY	270.00	-
2	REAR TAILGATE LAMPS	NOT NECESSARY	690.00	-
1	REAR TAILGATE LOCK	SHORTED	885.00	610.00
1	REAR TAILGATE LOGO	NECESSARY	85.00	75.00
1	REAR TAILGATE RUBBER	NOT NECESSARY	175.00	-
2	REAR TAILLAMPS	NOT NECESSARY	1,050.00	-
1	REAR END PANEL	TO REPAIR SEE LABOUR	656.00	-
1	REAR END PANEL INNER GARNISH	TWISTED	135.00	135.00
1	REAR BUMPER	DEFORMED / TORN	1,485.00	1,485.00
1	REAR BUMPER INNER RETAINER	CRACKED	295.00	182.00
1	REAR BUMPER LOWER GARNISH CENTRE	GRAZED	485.00	485.00
2	REAR BUMPER REFLECTORS	NOT NECESSARY	210.00	-
1	REAR BUMPER REINFORCEMENT	BENT	485.00	485.00
2	REAR BUMPER INNER SIDE RETAINERS	CRACKED	150.00	150.00
1	REAR BUMPER TOW HOOK COVER	GRAZED	58.00	58.00
1	REAR BUMPER TOP CHROME PLATE	NOT NECESSARY	345.00	-
4	REAR BUMPER REVERSE SENSORS	SHORTED (2 PCS ONLY)	1,252.00	396.00
1	REAR BUMPER LOWER	GRAZED	710.00	680.00
2	REAR FENDER WHEEL ARCH GARNISHES	NOT NECESSARY	570.00	-
2	REAR FENDER INNER TRIMS	NOT NECESSARY	490.00	-
	LESS 10% DISCOUNT		-1,373.60	-792.50
			12,362.40	7,132.50
	<u>SPECIAL NETT ITEMS</u>			
1	REAR WINDSCREEN SEALANT (SN)	NECESSARY	80.00	40.00
1	SET REAR BUMPER CLIP (SN)	NECESSARY	80.00	60.00
			160.00	100.00



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	LABOUR			
	TO REMOVE, REPLACE DAMAGED LAMPS AND CHECK UP REAR WIRING.		80.00	20.00
	TO REMOVE AND REFIT INNER GARNISHES .		180.00	80.00
	TO REMOVE AND REFIT REAR REVERSE SENSOR .		180.00	50.00
	TO TRANSFER REAR TAILGATE MECHANISM AND WIRING ASSEMBLY .		120.00	60.00
	TO REMOVE AND REFIT REAR WINDSCREEN GLASS .		180.00	120.00
	TO APPLY UNDERCOATING.		200.00	40.00
	PANEL BEATING.INCLUSIVE OF THE REPAIR OF REAR END PANEL .		1,600.00	580.00
	TO RE-SPRAY PAINTING ON THE AFFECTED AREAS .		1,500.00	600.00
			4,040.00	1,550.00
	GRAND TOTAL		16,562.40	8,782.50
	RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)			7,000.00

Report Ref No. CC4/LPC22009953/Upa3q2

CHUA KANG SENG

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SNB 5877C

INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SNB 5877C

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

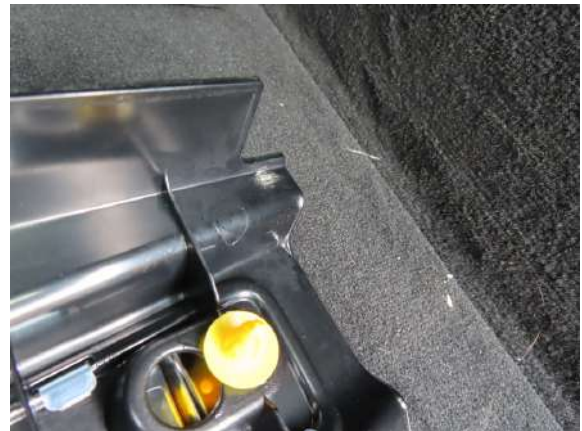



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SNB 5877C

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

