



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

LONPAC INSURANCE BHD

300 BEACH ROAD
#17-04/07 THE CONCOURSE
SINGAPORE 199555

INV No. AC2301673

INV Date 19/03/2023

Reference CC4/LPC22010389/Upa3q2

Code LPC2

PROFESSIONAL SERVICE FEE

Vehicle No. SLW 914A
Insured Veh. SLX 9492K
Claim No. 22/22/22/VP05/026437
Policy No. Z22VP05030886
Accident Date 17/10/2022
Inspection Date 19/10/2022

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (8%)	32.00
Grand Total	432.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
LONPAC INSURANCE BHD 300 BEACH ROAD #17-04/07 THE CONCOURSESINGAPORE 199555			Ref: CC4/LPC22010389/Upa3q2 Date: 19/03/2023 Code: LPC2	
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	SLX 9492K	Veh. Inspected	SLW 914A	
Policy No.	Z22VP05030886	Coverage (\$)	0.00	
Claim No.	22/22/22/VP05/026437	Excess (\$)	0.00	
Assign From	GERALD	Assign Date	19/10/2022	
2. Vehicle Particulars & Condition				
Make & Model	MITSUBISHI ATTRAGE (A)		c.c	1193
Engine No.	HIDDEN		Year of Reg.	2018
Chassis No.	MMBSTA13AJH001406		Colour	RED
Odometer	60817 KM		Steering	IN ORDER
Brakes	IN ORDER		Modification	SPORTS RIM
General	GOOD			
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre	185/55 R15	BRIDGESTONE	7 mm	
L/H Front Tyre	185/55 R15	BRIDGESTONE	7 mm	
R/H Rear Tyre	185/55 R15	BRIDGESTONE	7 mm	
L/H Rear Tyre	185/55 R15	BRIDGESTONE	7 mm	
4. Description of Damages				
THE VEHICLE SUSTAINED DAMAGES AT THE O/S REAR PORTION.THE UNDERCARRIAGE AFFECTED DUE TO COLLISION. DAMAGES SEE DETAILS.				
5. General Information				
Accident Date	17/10/2022		Inspection Date	19/10/2022
Survey held at	ZERO GRAVITY 2 KAKI BUKIT AVE 2 #01-25 KAKI BUKIT AUTOHUB SINGAPORE 417921			
5a. Remarks				
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
5b. Estimate Days of Repair				
ESTIMATED NORMAL PERIOD FOR REPAIR:			7 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SLW 914A

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
<u>REPLACEMENT OF PARTS</u>				
1	DOOR (R/H/R)	BADLY DENTED	1,119.00	839.00
1	DOOR STICKER (FRAME) (R/H/R)	NECESSARY	50.00	50.00
1	WINDOW REGULATOR (R/H/R)	BENT	165.00	133.00
1	WINDOW REGULATOR MOTOR (R/H/R)	JAMMED	432.00	394.00
1	DOOR ANTI SPLASH PLASTIC SEAL	NECESSARY	55.00	55.00
1	DOOR INNER LOCK (R/H/R)	SHORTED	255.00	255.00
1	DOOR CHANNEL (R/H/R)	TWISTED	165.00	165.00
1	BRACKET DOOR CHANNEL (R/H/R)	BENT	50.00	50.00
1	DOOR STOPPER RUBBER (R/H/R)	NOT NECESSARY	30.00	-
1	DOOR INNER TRIM BOARD (R/H/R)	NOT NECESSARY	940.00	-
10	DOOR INNER TRIM BOARD CLIP (R/H/R) @\$12.00	NOT NECESSARY	120.00	-
1	DOOR WEATHERSTRIP (R/H/R)	TORN	330.00	182.00
1	DOOR FRAME BEADING (R/H/R)	NOT NECESSARY	215.00	-
1	DOOR CATCH (R/H/R)	NOT NECESSARY	45.00	-
1	SWITCH (DOOR)	NOT NECESSARY	90.00	-
1	ROCKER PANEL (R/H)	BADLY DENTED	880.00	880.00
1	FENDER (R/H/R)	BADLY DENTED	805.00	805.00
1	SHOCK ABOSBRER (R/H/R)	TWISTED	200.00	200.00
1	WHEEL BEARING (R/H/R)	DAMAGED	130.00	130.00
1	AXLE BEAM	NOT NECESSARY	1,063.00	-
	LESS 10% DISCOUNT		-713.90	-413.80
			6,425.10	3,724.20
<u>SPECIAL NETT ITEMS</u>				
1	TYRE (R/H/R) (50%) (SN)	CUT	180.00	90.00
1	SPORT RIM (R/H/R) (SN)	BENT	300.00	300.00
1	SEALANT (WINDSCREEN)(SN)	NECESSARY	35.00	35.00
			515.00	425.00
<u>LABOUR</u>				
	TO COMPUTERISE ADJUST WHEEL ALIGNMENT.		100.00	100.00



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	TO CHECK UNDERCARRIAGE AND REPLACE DAMAGED PARTS.		250.00	150.00
	TO PROVIDE UNDER TURFCOAT .		150.00	60.00
	PANEL BEATING & REPLACING OF THE ABOVE .		1,000.00	900.00
	TO PUTTY AND RE-SPRAY AFFECTED PORTION .		900.00	800.00
	TO REMOVE ,TRANSFER & INSTALL RELATED COMPONENT DOOR .		250.00	60.00
	TO REMOVE AND REFIT COMPONENTS/FACILITATE THE REPAIR .		180.00	80.00
	TO CHECK WIRING SYSTEM & ENSURE FUNCTION OF COMPONENT.		80.00	20.00
	TO REMOVE AND REFIT REAR WINDSCREEN GLASS .		150.00	120.00
			3,060.00	2,290.00
GRAND TOTAL			10,000.10	6,439.20
RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)				5,100.00

Report Ref No. CC4/LPC22010389/Upa3q2

CHUA KANG SENG

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd


51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SLW 914A

INSPECTION

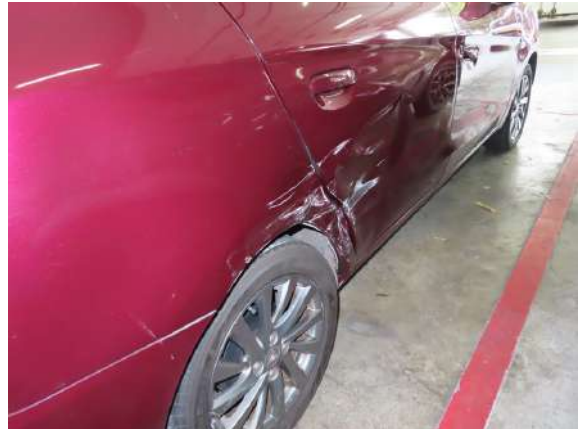





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

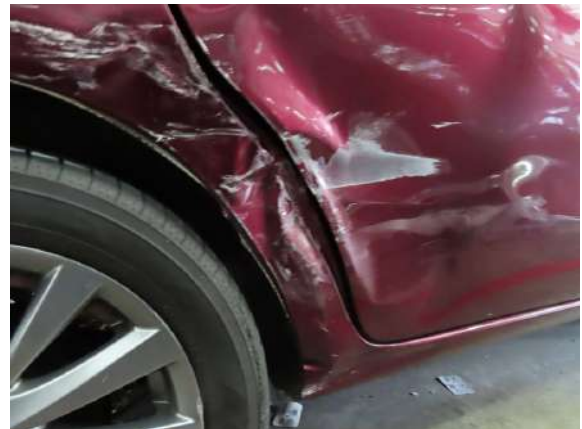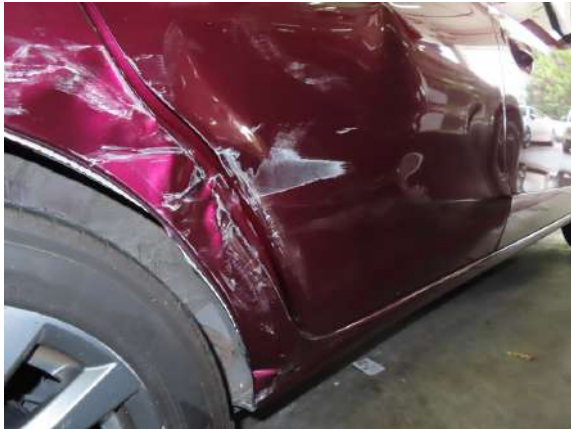



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R







LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

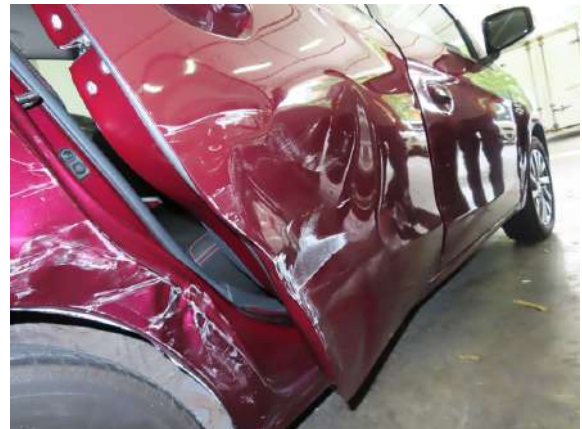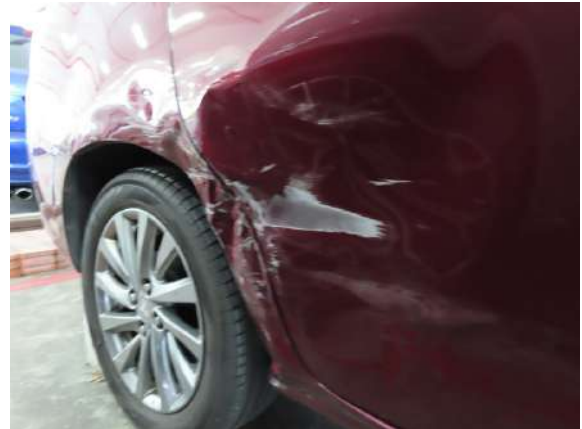






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

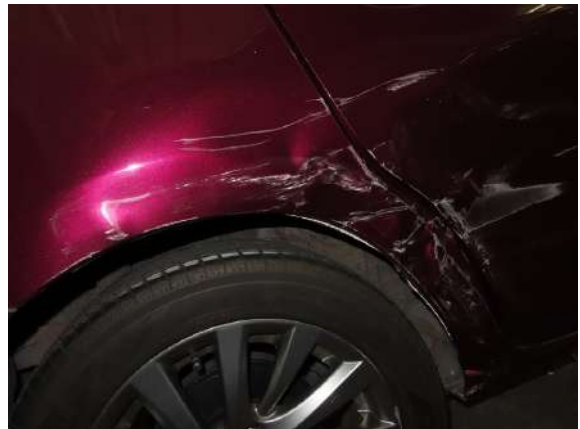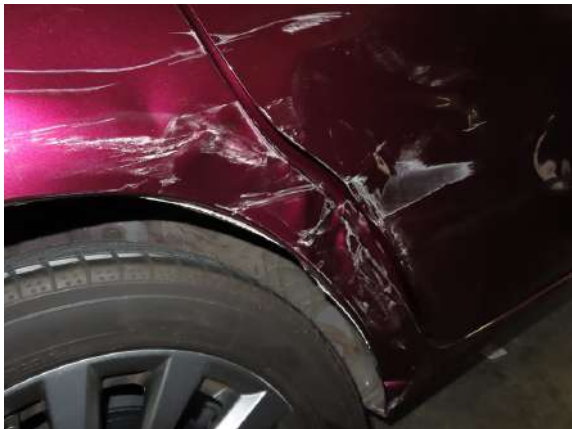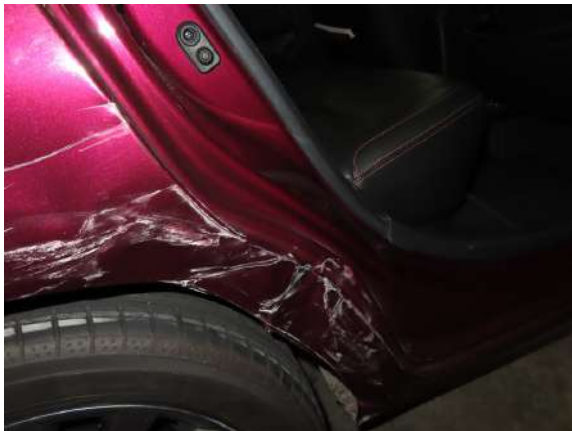



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SLW 914A

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd


51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SLW 914A

RE-INSPECTION

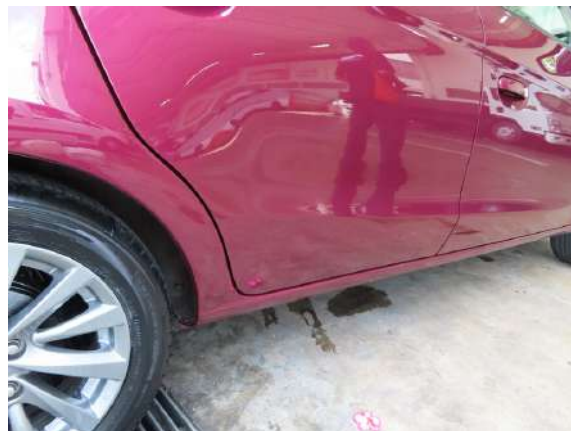



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

