



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

EQ INSURANCE COMPANY LTD

INV No. AC2303803

5 MAXWELL ROAD
#17-00 TOWER BLOCK
MND COMPLEX
SINGAPORE 069110

INV Date 15/06/2023
Reference CS/EQI22010422/Kny3e2
Code EQI

PROFESSIONAL SERVICE FEE

Vehicle No. SME 8882M

Insured Veh.

Claim No. DM22HO01739

Policy No. DMPPHQ22-005606

Accident Date 07/10/2022

Inspection Date 21/10/2022

Description	Total
Survey Inspection	300.00
Resurvey Inspection	
Digital Photographs	
Transportation	
Subtotal	300.00
GST (8%)	24.00
Grand Total	324.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to 'LKK Auto Consultants Pte Ltd'

LKK Auto Consultants Pte Ltd

KHM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
EQ INSURANCE COMPANY LTD 5 MAXWELL ROAD #17-00 TOWER BLOCK MND COMPLEXSINGAPORE 069110			Ref: CS/EQI22010422/Kny3e2 Date: 15/06/2023 Code: EQI	
1. Policy Particulars :- OWN DAMAGE				
	Insured Veh.	Veh. Inspected	SME 8882M	
	Policy No. DMPPHQ22-005606	Coverage (\$)	0.00	
	Claim No. DM22HO01739	Excess (\$)	15,000.00	
	Assign From JOSEPHINE WONG	Assign Date	20/10/2022	
2. Vehicle Particulars & Condition				
	Make & Model FERRARI F8 (A)	c.c	3902	
	Engine No. HIDDEN	Year of Reg.	2022	
	Chassis No. ZFF92LMC000262643	Colour	MILKY	
	Odometer 4051 KM	Steering	IN ORDER	
	Brakes IN ORDER	Modification	STANDARD ALLOY RIM	
	General GOOD			
3. Conditions of Tyres				
		Size	Make	Balance
	R/H Front Tyre	245/35Z R20	MICHELIN	9 mm
	L/H Front Tyre	245/35Z R20	MICHELIN	9 mm
	R/H Rear Tyre	305/30Z R20	MICHELIN	9 mm
	L/H Rear Tyre	305/30Z R20	MICHELIN	9 mm
4. Description of Damages				
	THE VEHICLE SUSTAINED DAMAGES AT THE N/S REAR BODY AND UNDERCARRIAGE. DAMAGES SEE DETAILS.			
5. General Information				
	Accident Date 07/10/2022	Inspection Date	21/10/2022	
	Survey held at OPTIMA WERKZ PTE LTD 10 ANG MO KIO INDUSTRIAL PARK 2A #01-05 AMK AUTOPOINT SINGAPORE 568047			
5a. Remarks				
	A)THE MARKET VALUE IS S\$1,400,000.00(EST. AVERAGE) B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE AUTHORISED REPAIRS.			
5b. Estimate Days of Repair				
	ESTIMATED NORMAL PERIOD FOR REPAIR:		28 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 4

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SME 8882M

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	FRONT DOOR LH	BENT	30,000.00	16,718.42
1	FRONT DOOR OUTER HANDLE LH	BROKEN	1,900.00	1,900.00
1	FRONT DOOR OUTER HANDLE SEAL LH	NECESSARY	180.00	180.00
1	FRONT DOOR LOCK LH	CRACKED	750.00	750.00
1	FRONT DOOR LOWER WEATHERSTRIP LH	NECESSARY	1,900.00	1,900.00
1	FRONT DOOR UPPER MOULDING LH	NECESSARY	1,650.00	1,650.00
1	FRONT DOOR REGULATOR LH	DISTORTED / JAMMED	2,400.00	2,400.00
1	FRONT DOOR INNER BRACKET LH	CRACKED	1,000.00	1,000.00
1	REAR FENDER LH	BENT	65,000.00	60,500.00
1	REAR FENDER QUARTER GLASS LH	MLDG NECESSARY	2,400.00	2,400.00
1	REAR FENDER INNER SHIELD (FRONT)	DEFORMED / DISTORTED	3,800.00	3,800.00
1	REAR FENDER INNER SHIELD (REAR)	DISTORTED / CRACKED	1,600.00	1,600.00
1	SIDE SKIRT CARBON FIBER LH	CRACKED	36,500.00	33,800.00
1	SIDE SKIRT KICK PLATE LH	NECESSARY	1,200.00	1,200.00
1	SIDE SKIRT RETAINER LH	NECESSARY	140.00	140.00
1	REAR AIR INTAKE LH	CRACKED	2,100.00	2,100.00
1	REAR AIR INTAKE GASKET SHIELD LH	BENT	400.00	400.00
1	REAR AIR INTAKE UPPER & LOWER FOAM	NECESSARY	250.00	250.00
1	REAR AIR INTAKE SIDE FOAM	NECESSARY	330.00	330.00
1	ENGINE COMPARTMENT COVER CARBON FIBER LH	CRACKED	12,000.00	11,200.00
1	ENGINE COMPARTMENT LID GRILLE LH	DENTED / DISTORTED	1,800.00	1,800.00
1	ENGINE UNDER COVER	CRACKED	2,600.00	2,600.00
1	ENGINE UNDER COVER BRACKET	TO REPAIR SEE LABOUR	850.00	-
1	REAR RIM LH	DENTED	17,000.00	15,800.00
1	REAR UPPER ARM LH	BENT	2,600.00	2,600.00
1	REAR LOWER ARM LH	BENT	4,200.00	4,200.00
1	REAR KNUCKLE ARM LH	BENT	8,500.00	8,500.00
1	REAR STABILIZER BAR LINK LH	BENT	900.00	900.00

Report Ref No. CS/EQI22010422/Kny3e2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 4

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	REAR TIE ROD LH	BENT	1,400.00	1,400.00
1	REAR BUMPER	CRACKED	39,900.00	25,129.43
1	REAR BUMPER LOWER DIFFUSER CARBON FIBER	CRACKED	38,400.00	35,900.00
1	REAR SPOILER	CRACKED	29,000.00	26,800.00
1	REAR SPOILER THIRD BRAKE LIGHT	SERVICEABLE	900.00	-
1	REAR SPOILER BRACKET	BUCKLED	1,680.00	1,680.00
1	REAR BUMPER REINFORCEMENT	BUCKLED	5,700.00	5,700.00
1	REAR BUMPER UPPER BRACKET LH	DISTORTED	160.00	160.00
1	REAR BUMPER WIRING HARNESS	CUT / DENTED	4,200.00	4,200.00
1	REAR BUMPER PARKING SENSOR WIRING	TORN	900.00	900.00
1	REAR BUMPER REFLECTOR LH	SERVICEABLE	250.00	-
1	REAR BUMPER REFLECTOR BASE BRACKET LH	CRACKED	200.00	200.00
1	REAR BUMPER PARKING SENSOR	DENTED	350.00	350.00
1	REAR BUMPER PARKING SENSOR O-RING	NECESSARY	50.00	50.00
1	REAR BUMPER 'FERRARI' EMBLEM	NECESSARY	750.00	750.00
1	REAR EXHAUST TIP LH	SERVICEABLE	220.00	-
1	REAR EXHAUST MUFFLER LH	TO REPAIR SEE LABOUR	4,500.00	-
1	REAR EXHAUST BRACKET LH	TO REPAIR SEE LABOUR	185.00	-
2	REAR EXHAUST MOUNTING @\$165.00	SERVICEABLE	330.00	-
1	REAR TAIL LAMP LH (OUTER)	CUT	3,000.00	3,000.00
1	REAR TAIL LAMP LH (INNER)	MTG CRACKED	3,280.00	3,280.00
1	REAR TAIL LAMP BASE BRACKET H	CRACKED	380.00	380.00
1	REAR FENDER RH (NPA)	TO REPAIR SEE LABOUR	-	-
1	FRONT DOOR LOCK CABLE LH (ADDITIONAL)	DENTED / JAMMED	345.00	345.00
1	COMPL VAPOUR FILTER (ADDITIONAL)	CRACKED	3,800.00	3,800.00
1	VABOUR FILTER BRACKET (ADDITIONAL)	BENT	800.00	800.00
1	CANISTER SHIELD (ADDITIONAL)	BENT	360.00	360.00
1	REAR SPOILER DUCT LOWER WALL (ADDITIONAL)	MTG CRACKED	4,500.00	4,500.00
1	REAR SPOILER DUCT LOWER WALL "FERRARI" EMBLEM (ADDITIONAL)	NECESSARY	380.00	380.00
1	ENGINE INTAKE DUCT LH (ADDITIONAL)	CRACKED	1,250.00	1,250.00
1	INTERCOOLER LH (ADDITIONAL)	BENT / PUNCTURE	7,600.00	7,600.00

Report Ref No. CS/EQI22010422/Kny3e2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:3 of 4

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	INTERCOOLER BRACKET LH (ADDITIONAL)	DISTORTED	225.00	225.00
	LESS 10% DISCOUNT		-35,894.50	-30,975.78
			323,050.50	278,782.07
	<u>SPECIAL NETT ITEMS</u>			
1	FRONT DOOR INNER TRIM BOARD CLIPS LH (SN)	NECESSARY	150.00	150.00
1	SIDE SKIRT SCREW & CLIPS (SN)	NECESSARY	150.00	150.00
1	REAR FENDER QUARTER GLASS SEALANT (SN)	NECESSARY	120.00	50.00
1	REAR FENDER INNER SHIELD CLIPS LH (SN)	NECESSARY	120.00	120.00
1	ENGINE COMPARTMENT GRILLE CLIPS (SN)	NECESSARY	100.00	100.00
1	ENGINE UNDER COVER CLIPS (SN)	NECESSARY	120.00	120.00
1	REAR BUMPER SCREW (SN)	NECESSARY	150.00	150.00
1	REAR BUMPER LOWER DIFFUSER SCREW (SN)	NECESSARY	150.00	150.00
1	FERRARI CHASSIS STICKER LH (SN) (ADDITIONAL)	NECESSARY	100.00	100.00
			1,160.00	1,090.00
	<u>LABOUR</u>			
	LABOUR CHARGES TO REMOVE, REPLACE, REFIX & READJUST ACCIDENT AREAS & ETC. INCLUSIVE OF THE REPAIR OF ENGINE UNDER COVER BRACKET, REAR EXHAUST MUFFLER LH, REAR EXHAUST BRACKET LH AND REAR FENDER RH.		3,000.00	2,400.00
	LABOUR CHARGES FOR PAINTING & TO SUPPLY PAINT & FURNISHING MATERIALS AT FRONT DOOR LH, ROCKER PANEL LH, REAR FENDER LH, REAR FENDER RH, REAR BUMPER & ETC.		2,500.00	2,000.00
	LABOUR CHARGES TO DISCONNECT, REMOVE & REFIX FRONT DOOR INNER WIRING HARNESS & ETC. TO EFFECT REPLACE OF FRONT DOOR LH.		300.00	150.00
	LABOUR CHARGES TO REMOVE & REINSTALLED FRONT DOOR INNER MECHANISM & ETC. TO EFFECT REPLACE OF FRONT DOOR LH.		300.00	150.00
	LABOUR CHARGES TO REMOVE & REFIX INNER TRIM & UPHOLSTERY SET & ETC TO EFFECT REPLACE OF REAR FENDER LH.		500.00	350.00
	LABOUR CHARGES TO REMOVE & REPLACE REAR QUARTER GLASS LH & ETC.		200.00	80.00
	LABOUR CHARGES TO REMOVE & REPLACE REAR PARKING SENSOR & ETC.		200.00	100.00

Report Ref No. CS/EQI22010422/Kny3e2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:4 of 4

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	LABOUR CHARGES TO REMOVE & REPLACE REAR BUMPER WIRING HARNESS & ETC. TO EFFECT REPLACE OF REAR BUMPER, BUMPER LOWER DIFFUSER.		250.00	200.00
	LABOUR CHARGES TO REMOVE & REPLACE REAR EXHAUST MUFFLER, REAR EXHAUST MOUNTING, REAR EXHAUST BRACKET & ETC.	NOT NECESSARY	350.00	-
	TO MOUNT VEHICLE ONTO CAR-O-LINER TO CALIBRATE SUB CHASSIS FRAME & BODY BACK TO MANUFACTURING SPECIFICATIONS.	NOT NECESSARY	800.00	-
	LABOUR CHARGES TO REMOVE & REPLACE REAR UPPER ARM LH, REAR LOWER ARM LH, REAR KNUCKLE ARM LH, REAR TIE ROD, REAR STABILIZER BAR LINK & ETC.		500.00	300.00
	TO WHEEL ALIGNMENT & BALANCING.		150.00	120.00
	TO TUFF KOTE / ANTI-RUST & ETC.	NOT INSURED	300.00	-
	TO DIAGNOSIS FAULT CODE & RESET MEMORY.		400.00	280.00
	TO CHECK WIRING & ELECTRICAL SYSTEM & ETC.		250.00	100.00
			10,000.00	6,230.00
GRAND TOTAL			334,210.50	286,102.07
RECOMMENDED COST OF REPAIRS				286,102.07
LESS EXCESS				-15,000.00
NETT LIABILITY				271,102.07

Report Ref No. CS/EQI22010422/Kny3e2

KONG SENG CHEONG

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.

OPTIMA WERKZ SINGAPORE

OPTIMA WERKZ PTE LTD
Co. Reg. No. 201212455W
www.ow.sg

f /OptimaWerkz

o /OptimaWerkz

Date : 02/12/2022
Vehicle No: SME8882M
Model: FERRARI F8 TRIBUTO S-A
Chassis: ZFF92LMC000262643-2021
Reg. Year: 2022
Policy No: DMPPHQ22-005606
Date of Accident: 07/10/2022

TO MOTOR CLAIM DEPT
EQ INSURANCE
5 Maxwell Road, #17-00 Tower Block
MND Complex
Singapore 069110

SUPPLEMENTARY

NO.	DESCRIPTION	QTY	UNIT S\$	AMOUNT S\$
1	FRONT DOOR LOCK CABLE LH	1		<i>with</i> \$345.00
2	COMPL VAPOUR FILTER	1		<i>CM</i> \$3,800.00
3	VAPOUR FILTER BRACKET	1		<i>R</i> \$800.00
4	CANISTER SHIELD	1		<i>R</i> \$360.00
5	REAR SPOILER DUCT LOWER WALL	1	<i>with CM</i>	\$4,500.00
6	REAR SPOILER DUCT LOWER WALL "FERRARI" EMBLEM	1		<i>CM</i> \$380.00
7	ENGINE INTAKE DUCT LH	1		<i>CM</i> \$1,250.00
8	INTERCOOLER LH	1		<i>with</i> \$7,600.00
9	INTERCOOLER BRACKET LH	1		<i>DIT</i> \$225.00
SUB TOTAL				\$19,260.00
LESS 10%				\$1,926.00
PARTS TOTAL				\$17,334.00

NO.	SPECIAL NETT	QTY	UNIT S\$	AMOUNT S\$
1	FERRARI CHASSIS STICKER LH	1		<i>CM</i> \$100.00
S/N TOTAL				\$100.00

TING AN TOTAL \$17,434.00

Head office

8 Kung Chong Road Singapore 159143
Tel: (+65) 6472 1313 | Fax: (+65) 6472 2112

Branch

8A Serangoon North Ave 5 Singapore 554500
Tel: (+65) 6484 9919 | Fax: (+65) 6481 1993

Branch (Motor Insurance Claims)

Blk 10 Ang Mo Kio Ind Park 2A #01-35 Singapore 568047
Tel: (+65) 6481 1522 | Fax: (+65) 6481 1011



SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Actual Driver
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT

Date of Submission	10/10/2022 13:16 (SGT)
Reported by	Driver
Date of Accident	07/10/2022 20:30 (SGT)
Exact Location of Accident	CTE, Singapore
Additional Location Information	BEFORE BUKIT TIMAH EXIT
Country/State of Loss	Singapore

DETAILS OF OWN VEHICLE

Vehicle Registration Number	SME8882M
-----------------------------	----------

INSURED/POLICYHOLDER

Is company?	Yes
Name Of Registered Owner	WONDERFUL KITCHEN PTE. LTD.
Company Reg No	2XXXXX957E
Email Address	jw882jw@yahoo.com.sg
Mobile Phone No	(Phone) +65-96988882
Alternative Phone No	-

VEHICLE PARTICULARS

Manufacturer	Ferrari
Model	F8
Variant	-
Exact purpose for which vehicle was being used at time of accident	Private use
Are you claiming under your own insurance policy for repair to your vehicle?	Yes
Vehicle Category	Commercial vehicle
Transmission	Auto
CC	3902

INSURANCE COMPANY

Name of Insurance Company	EQ Insurance Company Ltd
Policy Number / Cover Note Number	DMPPHQ22-005606

DRIVER

Name of Driver	ONG JUN WU
NRIC No	SXXXX463J
Date Of Birth	16/12/1996
Occupation	Indoor

-

10/10/10

1998, 1999, 2000, 2001, 2002, 2003, 2004, 2005, 2006, 2007, 2008, 2009, 2010, 2011, 2012, 2013, 2014, 2015, 2016, 2017, 2018, 2019, 2020, 2021, 2022, 2023, 2024, 2025, 2026, 2027, 2028, 2029, 2030, 2031, 2032, 2033, 2034, 2035, 2036, 2037, 2038, 2039, 2040, 2041, 2042, 2043, 2044, 2045, 2046, 2047, 2048, 2049, 2050, 2051, 2052, 2053, 2054, 2055, 2056, 2057, 2058, 2059, 2060, 2061, 2062, 2063, 2064, 2065, 2066, 2067, 2068, 2069, 2070, 2071, 2072, 2073, 2074, 2075, 2076, 2077, 2078, 2079, 2080, 2081, 2082, 2083, 2084, 2085, 2086, 2087, 2088, 2089, 2090, 2091, 2092, 2093, 2094, 2095, 2096, 2097, 2098, 2099, 2100, 2101, 2102, 2103, 2104, 2105, 2106, 2107, 2108, 2109, 2110, 2111, 2112, 2113, 2114, 2115, 2116, 2117, 2118, 2119, 2120, 2121, 2122, 2123, 2124, 2125, 2126, 2127, 2128, 2129, 2130, 2131, 2132, 2133, 2134, 2135, 2136, 2137, 2138, 2139, 2140, 2141, 2142, 2143, 2144, 2145, 2146, 2147, 2148, 2149, 2150, 2151, 2152, 2153, 2154, 2155, 2156, 2157, 2158, 2159, 2160, 2161, 2162, 2163, 2164, 2165, 2166, 2167, 2168, 2169, 2170, 2171, 2172, 2173, 2174, 2175, 2176, 2177, 2178, 2179, 2180, 2181, 2182, 2183, 2184, 2185, 2186, 2187, 2188, 2189, 2190, 2191, 2192, 2193, 2194, 2195, 2196, 2197, 2198, 2199, 2200, 2201, 2202, 2203, 2204, 2205, 2206, 2207, 2208, 2209, 2210, 2211, 2212, 2213, 2214, 2215, 2216, 2217, 2218, 2219, 2220, 2221, 2222, 2223, 2224, 2225, 2226, 2227, 2228, 2229, 2230, 2231, 2232, 2233, 2234, 2235, 2236, 2237, 2238, 2239, 2240, 2241, 2242, 2243, 2244, 2245, 2246, 2247, 2248, 2249, 2250, 2251, 2252, 2253, 2254, 2255, 2256, 2257, 2258, 2259, 2260, 2261, 2262, 2263, 2264, 2265, 2266, 2267, 2268, 2269, 2270, 2271, 2272, 2273, 2274, 2275, 2276, 2277, 2278, 2279, 2280, 2281, 2282, 2283, 2284, 2285, 2286, 2287, 2288, 2289, 2290, 2291, 2292, 2293, 2294, 2295, 2296, 2297, 2298, 2299, 2300, 2301, 2302, 2303, 2304, 2305, 2306, 2307, 2308, 2309, 2310, 2311, 2312, 2313, 2314, 2315, 2316, 2317, 2318, 2319, 2320, 2321, 2322, 2323, 2324, 2325, 2326, 2327, 2328, 2329, 2330, 2331, 2332, 2333, 2334, 2335, 2336, 2337, 2338, 2339, 2340, 2341, 2342, 2343, 2344, 2345, 2346, 2347, 2348, 2349, 2350, 2351, 2352, 2353, 2354, 2355, 2356, 2357, 2358, 2359, 2360, 2361, 2362, 2363, 2364, 2365, 2366, 2367, 2368, 2369, 2370, 2371, 2372, 2373, 2374, 2375, 2376, 2377, 2378, 2379, 2380, 2381, 2382, 2383, 2384, 2385, 2386, 2387, 2388, 2389, 2390, 2391, 2392, 2393, 2394, 2395, 2396, 2397, 2398, 2399, 2400, 2401, 2402, 2403, 2404, 2405, 2406, 2407, 2408, 2409, 2410, 2411, 2412, 2413, 2414, 2415, 2416, 2417, 2418, 2419, 2420, 2421, 2422, 2423, 2424, 2425, 2426, 2427, 2428, 2429, 2430, 2431, 2432, 2433, 2434, 2435, 2436, 2437, 2438, 2439, 2440, 2441, 2442, 2443, 2444, 2445, 2446, 2447, 2448, 2449, 2450, 2451, 2452, 2453, 2454, 2455, 2456, 2457, 2458, 2459, 2460, 2461, 2462, 2463, 2464, 2465, 2466, 2467, 2468, 2469, 2470, 2471, 2472, 2473, 2474, 2475, 2476, 2477, 2478, 2479, 2480, 2481, 2482, 2483, 2484, 2485, 2486, 2487, 2488, 2489, 2490, 2491, 2492, 2493, 2494, 2495, 2496, 2497, 2498, 2499, 2500, 2501, 2502, 2503, 2504, 2505, 2506, 2507, 2508, 2509, 2510, 2511, 2512, 2513, 2514, 2515, 2516, 2517, 2518, 2519, 2520, 2521, 2522, 2523, 2524, 2525, 2526, 2527, 2528, 2529, 2530, 2531, 2532, 2533, 2534, 2535, 2536, 2537, 2538, 2539, 2540, 2541, 2542, 2543, 2544, 2545, 2546, 2547, 2548, 2549, 2550, 2551, 2552, 2553, 2554, 2555, 2556, 2557, 2558, 2559, 2560, 2561, 2562, 2563, 2564, 2565, 2566, 2567, 2568, 2569, 2570, 2571, 2572, 2573, 2574, 2575, 2576, 2577, 2578, 2579, 2580, 2581, 2582, 2583, 2584, 2585, 2586, 2587, 2588, 2589, 2590, 2591, 2592, 2593, 2594, 2595, 2596, 2597, 2598, 2599, 2600, 2601, 2602, 2603, 2604, 2605, 2606, 2607, 2608, 2609, 2610, 2611, 2612, 2613, 2614, 2615, 2616, 2617, 2618, 2619, 2620, 2621, 2622, 2623, 2624, 2625, 2626, 2627, 2628, 2629, 2630, 2631, 2632, 2633, 2634, 2635, 2636, 2637, 2638, 2639, 2640, 2641, 2642, 2643, 2644, 2645, 2646, 2647, 2648, 2649, 2650, 2651, 2652, 2653, 2654, 2655, 2656, 2657, 2658, 2659, 2660, 2661, 2662, 2663, 2664, 2665, 2666, 2667, 2668, 2669, 2670, 2671, 2672, 2673, 2674, 2675, 2676, 2677, 2678, 2679, 26

1998

[illegible]



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SME 8882M

INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

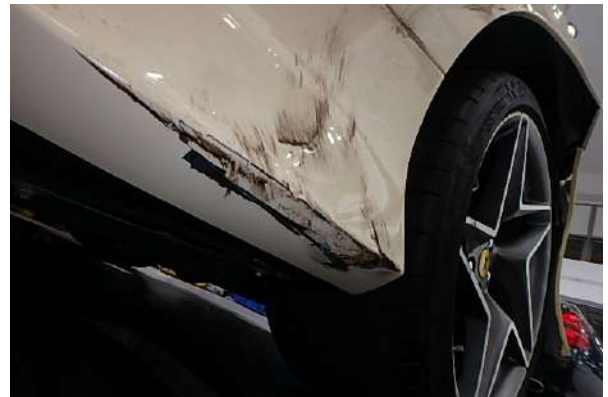




LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

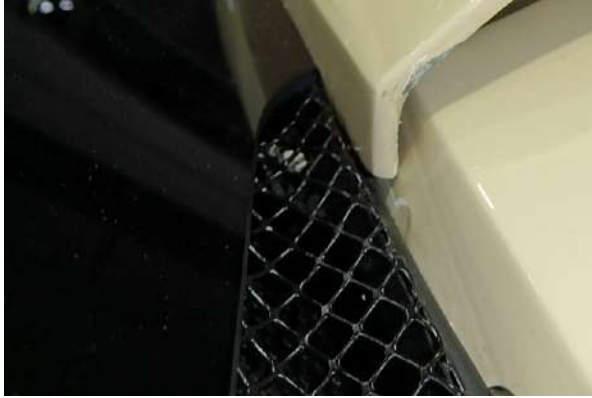



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R







LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SME 8882M

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SME 8882M

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

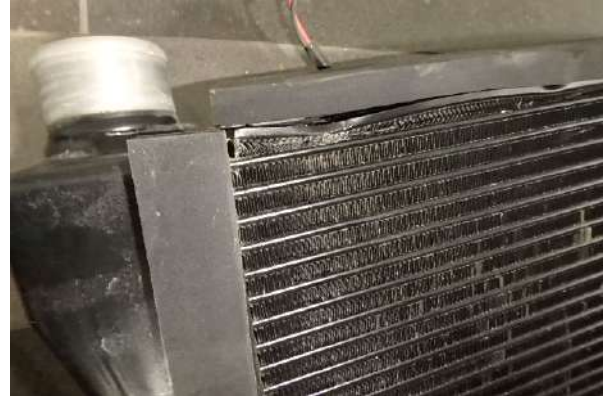



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SME 8882M

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

