

Kenneth

ASS. REC. BY:

REF:

C72/

ASSIGNMENT

From: _____ Date: _____

Estimated Cost: _____

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No: _____

at Workshop m/s Link

of _____

Insured: _____

Policy No. _____

Claims No. _____

Sum Insured: _____

Excess: TBA

(Client's Record)

Make of Veh: _____

(Policy Condition)

Remark: The veh had commenced its repair at the time of inspection.

N/S	O/S

Bal. or Market Value: 8100k

IDAC Accident Report: _____ Consistent? : Yes or No

GIA / PR Seen: _____ Consistent? : Yes or No

Est. Repairs: 06 days Res.: Yes or No

Lum Sum: 1-B1 % 3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date: 4/31

Person Contacted: _____

Vehicle: IN / OUT

Veh No: SMU 5607C Yr Regn: 06, 11

Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make: BMW 523i c.c. 2497

Colour: M. Gold A/C: Insured / Std / NI / NA

Sp. Reading: 120874 T/Radio: Insured / Std / NI / NA

Eng/No: _____

C/No: WRA1-P32060C 888107

Gen. Cond: Good / Fair / Poor / Burnt

Sleering: Inoper / Jammed / Leaked / Burnt or

Brake: Inoper / Jammed / Leaked / Burnt or

Modl: NII / S/Rim / STD A/Rim or

Tyre Size: F: 245/40R19

R: 275/35R19

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or

Front

R/Bal. 7 mm

L/Bal. 7 mm

D.O.A. 19/10/22

Survey held at

Des. of Damages: Rear / O/S / N/S / UIC / Rooftop or

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time Action / Instruction

Date/Time, File Pass to?

☐

: Prell. Report

☐

: Final Report

Date/Time, File Return to?

Days Of Repair: _____

Resurvey No. of Trlp: _____

Survey Fee: _____

Transportation: _____

Add Fee:

☐

: Site Insp (\$

☐

: Interview (\$

☐

: Tech Invs (\$

☐

: Weekend (\$

) \$ + RS. SI

) Extras

) Others

)

TOTAL

Report Format :

Lump Sum / I.B.I: (\$

Lai Huat (Meng Kee) Motor Pte Ltd
160 Sin Ming Drive, #04-01, #04-02 &
#07-03, Sin Ming Autocity
575722

Insurer Reference: DMPCSNW00252832101
Repairer Reference: 73105
Date calculated: 21/10/2022 10:21 AM

Full Report
Registration: SMU 5607C
Printed: 21/10/2022 10:21 AM

Summary Information

Claim		Work Provider:	China Taiping Insurance
Location:	Singapore (SG)		(Singapore) Pte Ltd
Printed by:	Jenny Lim	Currency:	SGD
Claim Reference:	DMPCSNW00252832101	Date of Incident:	19/10/22
Estimated Repair Time:		Hire Car Start:	
Actual Repair Days:		Hire Car End:	

Vehicle Details

Vehicle
Manufacturer: BMW
Model: 5 SERIES F10
Sub Model: 523 I
Model Sheet Number: 01 42 01
Registration: SMU 5607C
VIN number: WBAFP32060C866107
Odometer: 120974

Model Specs

FROM 03.2011	THROUGH LOAD SYSTEM	AIR CON AUTO 2-ZONES	O2 VOLUME
COMFORT ACCESS SYST	DIP REAR VIEW MIRROR	XENON HEADLAMPS	INTER LIGHT AMBIENCE
HEADLAMP WASHERS	DAKOTA LEATHER TRIM	ELEC/SEAT ADJ MEMORY	AUTO TAILGATE CONTR
DIP REAR VIEW MIRROR	FRT/RR PARK DIST CON	2.5 LTR 150KW	SPORT S-WHEEL LEATH
8-GEAR AUTOMATIC	TYRES 225/55 YR 17	WHEELS 8J X 17 ALLOY	INT MOULDING BLACK
TWO COAT METALLIC	TYRE W/FLAT RUNNING	PREPARE OFF VEHICLE	

Not wither
Heavy Bumping
Ex TRA
Ex 8 6 days

Labour

Code	Description	Time Base 12 WU/h	Price = 42.00 SGD/h	
			WU	Price SGD
NO NUMBER	ADD/TIME FOR MAIN WORK		2.0	7.00
51 64 511)	R + R FRONT PANEL SUPPORT		1.0	3.50
51 64 533	RENEW BOTH FRONT PANEL SUPPORTS (FRT BUMPER SUPPORT REMOVED) INCLUDES: HEADLAMP, AIR GUIDE RADIATOR AND DEFORMATION ELEMENT REMOVE AND REFIT		21.0	73.50
51 11 656	R + R FRONT BUMPER		9.0	31.50
51 11 566	R + R BOTH FRONT BUMPER CARRIERS		7.0	24.50
51 11 551	R + R FRONT UPPER BUMPER CARRIER		4.0	14.00
51 11 592	REMOVE/REFIT FRONT BUMPER BAR TRIM (WITH FRONT BUMPER BAR REMOVED)		6.0	21.00
66 20 610	ADD/WORK PARK DISTANCE CONTROL		4.0	14.00
63 12 524	RENEW L/HEADLAMP (REMOVED)		4.0	14.00
63 12 524	RENEW R/HEADLAMP (REMOVED)		4.0	14.00

		WU	Price \$GD
		4.0	14.00
		10.0	35.00
41 61 510	R + R BONNET		
41 61 503	REPLACE BONNET (WITH BONNET REMOVED)	1.0	3.50
51 76 530	R + R REAR BONNET SEAL	1.0	3.50
51 76 535)	R + R R/F MOUNT	5.0*	17.50
0475	L/BONNET HINGE REPAIR	5.0*	17.50
0476	R/BONNET HINGE REPAIR		
Labour Cost		Hrs	WU
Panel / Mechanical Labour		7.30	88.0
Total of Labour			308.00
			308.00

Paint

Paint Work

SYSTEM AZT

Time Basis 10 WU/h

Code	Description - TWO COAT METALLIC	WU	Price SGD
	BONNET NEW PART PAINTING	30.0	
	FRONT BUMPER NEW PART PAINT K1R	15.0	
	FRT TOWING EYE COVER NEW PART PAINT K1R	3.0	
	R/INN U-SONIC SENDER NEW PART PAINT K1R	3.0	
	L/WASHER NOZZLE TRIM NEW PART PAINT K1R	3.0	
	R/WASHER NOZZLE TRIM NEW PART PAINT K1R	3.0	
	L/OUT U-SONIC SENDER SURFACE PAINT PLAST.	3.0	
	R/OUT U-SONIC SENDER SURFACE PAINT PLAST.	3.0	
	L/INN U-SONIC SENDER SURFACE PAINT PLAST.	3.0	

Paint Material Per Part

Code	Description	Price SGD
0471	BONNET NEW PART PAINTING	104.75
0283	FRONT BUMPER NEW PART PAINT K1R	77.74
0313	FRT TOWING EYE COVER NEW PART PAINT K1R	0.49
0346	R/INN U-SONIC SENDER NEW PART PAINT K1R	0.49
0633	L/WASHER NOZZLE TRIM NEW PART PAINT K1R	0.49
0634	R/WASHER NOZZLE TRIM NEW PART PAINT K1R	0.49
0343	L/OUT U-SONIC SENDER SURFACE PAINT PLAST.	0.37
0344	R/OUT U-SONIC SENDER SURFACE PAINT PLAST.	0.37
0345	L/INN U-SONIC SENDER SURFACE PAINT PLAST.	0.37

Labour Cost - Paint

Factor

42.00 SGD/h

Time Paint

66.0

Preparation Main Work Metal

2.50

25.0

105.00

Preparation Comp. Work Plastic

0.50

5.0

21.00

Total

10 WU/h

9.60

96.0

403.20

Total

12 WU/h

9.60

115.2

403.20

Material Cost - Paint
 New Part Painting
 New Part Painting - Plastic K1R
 Surface Painting Plastic
 Material-constant Metal Preparation
 Material-constant Plastic
Total

Price SGD
 104.75
 79.70
 1.11
 28.60
 9.00
 223.16

Spare Parts

prices as at 2022-10-19
Price SGD

Code	Description	Part Number	Part Source		Price SGD
1004	AC DECAL STICKER	9241492	Original		25.00
0471	BONNET	41 61 7 207 194	Original		2,380.00
1003	BONNET LATCH RIVETS	(ORIGINAL) X2	Original		8.00
1005	DECAL	7619382	Original		25.00
0283	FRONT BUMPER COVER	51 11 7 285 961	Original		980.00
0303	FRT BUMPER GRILLE	51 11 7 285 950	Original		60.00
1017	FRT CONNECTING STRUT	51 64 7 200 689	Original		230.00
0313	FRT TOWING EYE COVER	51 11 7 246 868	Original		25.00
0336	FRT UPP BUMPER SUPP	SEE GUIDE NO. 0333	Original		685.00
0340	FRT UPP IMPACT DAMP	51 11 7 200 707	Original		103.00
0431	GRILLE BADGE	51 14 7 057 794	Original		70.00
0415	L/F GRILLE	51 13 7 203 649	Original		100.00
1187	L/F PANEL SUPPORT	51 64 7 200 793	Original		185.00
0633	L/WASHER NOZZLE TRIM	51 11 7 246 869	Original		42.00
0561	LEFT HEADLAMP ASSY	63 11 7 343 911	Original		2,500.00
0308	R/BUMPER AIR GRILLE	51 11 7 200 700	Original		55.00
0330	R/F DEFORMATION ELEM	SEE GUIDE NO. 0333	Original		20.00
0416	R/F GRILLE	51 13 7 203 650	Original		100.00
1020	R/F PANEL SUPPORT	51 64 7 187 096	Original		30.00
1188	R/F PANEL SUPPORT	51 64 7 200 794	Original		185.00
0748	R/F SUPPORT	51 76 7 019 804	Original		160.00
0368	R/F VENT DUCT	51 74 7 200 798	Original		40.00
0346	R/INN U-SONIC SENDER	66 20 9 233 044	Original		235.00
0632	R/WASHER JET CARRIER	51 11 7 200 792	Original		170.00
0634	R/WASHER NOZZLE	51 11 7 246 870	Original		35.00
	TRIM				450.00
1009	RADIATOR AIR GUIDE	51 74 7 200 787	Original		2,200.00
0562	RIGHT HEADLAMP ASSY	63 11 7 343 914	Original		25.00
1002	STICKER	7209617	Original		

f: OEM Parts
 n: Non-OEM Parts
 u: Used parts

Savings
Subtotal
Fixed Sundry Parts Price

0.00
 11,123.00
 100.00
 11,223.00

Total

Extras

Code	Description
1000	CHK/CLEAR FAULT CODE AFTER REPAIR
1001	FRONT NUMBER PLATE
	Total Extras

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Price SGD

120.00*
 35.00*
 155.00

Acknowledged by Repairer

Signature:

Code	Description	Price \$GD	
Final Calculation			
		SGD	SGD
Parts		11,123.00	
Fixed Sundry Parts Price		100.00	
Total Parts			11,223.00
Labour Time Base 12 WU/h			
Total 88.0 WU X 42.00 SGD/h		308.00	
Total of Labour			308.00
Total Of Extras			155.00
Paint Work Time Base 10 WU/h			
Labour Cost 96.0 WU X 42.00 SGD/h		403.20	
Material Cost		223.16	
Total Paint Including Material			626.36
Repair Cost Excludes GST			12,312.36
GST (+7.0%)			861.87
Repair Cost Included GST			13,174.23

Comments

* - USER SUPPLIED DATA
 NN - NO MANUFACTURERS CODE EXISTS
) - WU PARTIAL INCL IN OTHER POSITIONS

Assessment Note

No assessment notes entered.

SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Actual Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT

Date of Submission	19/10/2022 17:50 (SGT)
Reported by	Both
Date of Accident	19/10/2022 14:20 (SGT)
Exact Location of Accident	Race Course Rd, Singapore
Additional Location Information	at slip road towards CTE
Country/State of Loss	Singapore

DETAILS OF OWN VEHICLE

Vehicle Registration Number	SMU5607C
INSURED/POLICYHOLDER	
Is company?	No
Name Of Registered Owner	Joseph Tian Thian Sin
NRIC No	SXXXX059Z
Email Address	jotiansg@yahoo.com
Mobile Phone No	(Phone) +65-94503004
Alternative Phone No	-

VEHICLE PARTICULARS

Manufacturer	BMW
Model	523i
Variant	-
Exact purpose for which vehicle was being used at time of accident	Private use
Are you claiming under your own insurance policy for repair to your vehicle?	Yes
Vehicle Category	Private car
Transmission	Auto
CC	2500

INSURANCE COMPANY

Name of Insurance Company	China Taiping Insurance (Singapore) Pte. Ltd.
Policy Number / Cover Note Number	DMPCSNW00252832101

DRIVER

Name of Driver	Joseph Tian Thian Sin
NRIC No	SXXXX059Z
Date Of Birth	20/01/1958
Occupation	Outdoor

SKETCH PLAN

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Actual Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. **Any false reporting may be referred to the Traffic Police Department for investigation.**
6. This report will be forwarded by the insurers to the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

6. Consent under the Personal Data Protection Act (PDPA)

I understand, acknowledge, agree and consent that:

- (a) My insurer, my workshop and the General Insurance Association of Singapore (GIA) may be permitted to collect, use, disclose and/or process my personal data/personal information set out in this Form and any other personal information provided by me or possessed by my insurer (collectively the **Personal Information**) and disclose and transfer such Personal Information to all insurers who have insured vehicle(s) involved in this accident (all insurers who have insured vehicle(s) involved in this accident shall be collectively referred to as the **Insurers**), the Insurers' lawyers/law firms, the Monetary Authority of Singapore and any relevant government agency/authority (such as the police), for the purpose(s) of:
 - (i) processing, handling and/or dealing with my claims including the settlement of the claims and any necessary investigations relating to the claims;
 - (ii) investigating the accident and/or my claims;
 - (iii) carrying out and/or dealing with my instructions or responding to any enquiries by me;
 - (iv) administering my claims (including the mailing of correspondence, statements, invoices, reports or notices to me, which could involve disclosure of certain personal data about me to bring about delivery of the same as well as on the external cover of envelopes/mail packages); and/or
 - (v) complying with applicable law in administering, processing, handling and/or dealing with my claims.
 (collectively the **Purposes**);
- (b) all insurers, who have insured vehicle(s) involved in this accident and the Insurers' lawyers/law firms, may be permitted to collect, use, disclose and/or process my Personal Information for one or more of the above Purposes; and
- (c) my Personal Information may, can be disclosed by any of the Insurers and/or GIA to their third-party service providers or agents (including their lawyers/law firms) which may be sited outside of Singapore, for one or more of the above Purposes.

[Signature]

Policyholder's Date and Signature


19 OCT 2022

Sketch Plan

Driver's Signature (if driver is not the policyholder, Date & Time)

[Signature: Mr. Lim Lai Foong]

Witness Date, Signature for the sketch plan (Must be a "NANYANG" citizen)

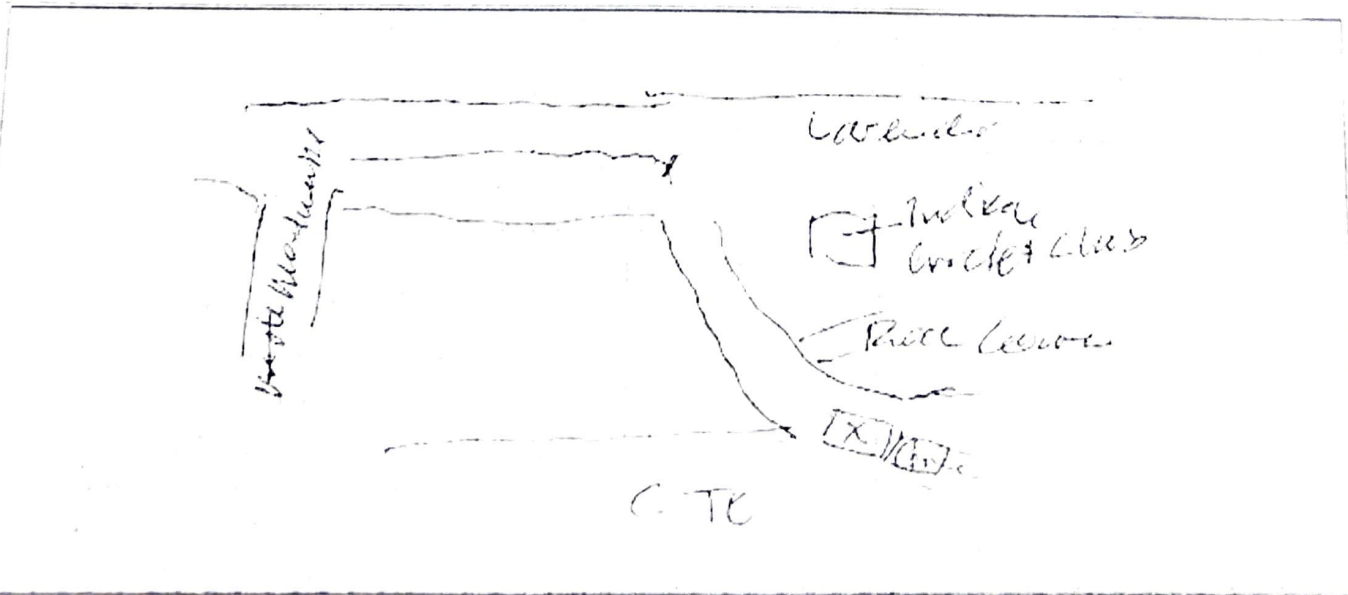

Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars

Owner ID Type:

Owner ID:

Singapore NRIC

059Z

Vehicle Details

Vehicle No.:

SMU5607C

Vehicle to be Exported:

Yes

Intended Deregistration Date:

19 Oct 2022

Vehicle Make:

B.M.W.

Vehicle Model:

523I 2.5 AT ABS D/AB 2WD 4DR GAS/D

Primary Colour:

Silver

Manufacturing Year:

2011

Engine No.:

02627739N52B25AF

Chassis No.:

WBAFP32060C866107

Maximum Power Output:

150.0 kW (201 bhp)

Open Market Value:

\$44,396.00

Original Registration Date:

15 Jun 2011

First Registration Date:

15 Jun 2011

Transfer Count:

2

Actual ARF Paid:

\$44,396.00

Intended PARF Rebate Details

PARF Eligibility:

Forfeited

PARF Eligibility Expiry Date:

-

PARF Rebate Amount:

\$0.00

Intended COE Rebate Details

COE Expiry Date:

30 Apr 2031

COE Category:

B - Car (1601cc & above)

COE Period(Years):

10

PQP Paid:

\$47,316.00

COE Rebate Amount:

\$40,363.00

Total Rebate Amount:

\$40,363.00

The information contained herein is correct as at 19 Oct 2022

OK