

A.S. P.C. BY:

REF:

CS/WOI 22010500/Dgy<sup>3</sup>

## ASSIGNMENT

05 Dec 2026

From: \_\_\_\_\_ Date: \_\_\_\_\_

Estimated Cost: \_\_\_\_\_

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To inspect Vehicle No: \_\_\_\_\_

at Workshop m/s \_\_\_\_\_

of \_\_\_\_\_

Insured: \_\_\_\_\_

Policy No. \_\_\_\_\_

Claims No. \_\_\_\_\_


Sum Insured: \_\_\_\_\_ Excess: \_\_\_\_\_

(Client's Record)

Make of Veh: \_\_\_\_\_

(Policy Condition)

Remark: The veh had commenced its repair at the time of inspection.

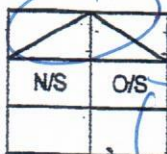

Bal. or Market Value: \_\_\_\_\_

IDAC Accident Rpt: \_\_\_\_\_ Consistent?: Yes or No

GIA / PR Seen: \_\_\_\_\_ Consistent?: Yes or No

Est. Repairs: 18 days Res.: Yes or NoLum Sum: 20 % 3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date: \_\_\_\_\_ Person Contacted: \_\_\_\_\_

Vehicle: IN / OUT

Veh No: 811C 2635U Yr Regn: Dec, 2018

Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make: Hyundai Ioniq C.C. 1580Colour: Blue A/C: Insured / Std / NI / NASp. Reading: M.A. T/Radio: Insured / Std / NI / NAEng/No: G4LEJU133551C/No: KMHG851CVKU122138

Gen. Cond: Good / Fair / Poor / Burnt

Steering: Inorder / Jammed / Leaked / Burnt or

Brake: Inorder / Jammed / Leaked / Burnt or

Modi: Nil / S/Rim / STD A/Rim or

Tyre Size: F: 195/65 R15R: —

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or Westlake

Front \_\_\_\_\_ Rear \_\_\_\_\_

R/Bal. 5 mm R/Bal. 5 mmL/Bal. 5 mm L/Bal. 5 mmD.O.A. 21/10/2022 D.O.I. 26/10/2022Survey held at Bright Sin Ming

Des. of Damages: Fnt / Rear / O/S / N/S / U/C / Rooftop or

Front y O/S R

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time

Action / Instruction

WOI GBS 2830Gtaxi balance 50 minutes. A calculation attached to keep in views. Dont indicate in survey report.14/3/23framed 2/3 26,000/- with 18 days of rep  
cred 51710.34, 67%

Date/Time, File Pass to?



: Prel. Report



: Final Report

Date/Time, File Return to?

2)

Add Fee:



: Site Insp (\$)



: Interview (\$)



: Tech. Inve (\$)

Days Of Repair: 18Resurvey No. of Trip: 2

Survey Fee:

Transportation:

S + RS \$

Photos

Others

Report Format: TP

I certify I have read &amp; understand the



**BIFROST AUTO PTE LTD**

## REPAIR ESTIMATE

DATE: 25-Oct-22

INSURANCE: 901

MODEL: HYUNDAI IONIC

VEHICLE NO.: SHC 2635 U

| Description                                                     | Qty | List Price  | Amount      |
|-----------------------------------------------------------------|-----|-------------|-------------|
| Bonnet <i>Brw</i>                                               | 1   | \$ 2,253.80 | \$ 2,253.80 |
| Bonnet Hinge (LH/RH) <i>st</i>                                  | 2   | \$ 118.70   | \$ 237.40   |
| Bonnet Moulding <i>HH</i>                                       | 1   | \$ 41.40    | \$ 41.40    |
| Bonnet Lock <i>broken</i>                                       | 1   | \$ 127.30   | \$ 127.30   |
| Bonnet Insulator <i>st / crumpled</i>                           | 1   | \$ 230.10   | \$ 230.10   |
| Bonnet Insulator Clips <i>HH</i>                                | 1   | \$ 15.00    | \$ 15.00    |
| Bonnet Cable <i>HH</i>                                          | 1   | \$ 135.60   | \$ 135.60   |
| Radiator Grille <i>broken</i>                                   | 1   | \$ 1,409.10 | \$ 1,409.10 |
| Flap Assy Active Air Upper, (LH/RH) <i>broken</i>               | 2   | \$ 824.60   | \$ 1,649.20 |
| Speaker Assy-VESS <i>broken</i>                                 | 1   | \$ 554.40   | \$ 554.40   |
| Unit Assy-SMART CRU (Radar Sensor) <i>monky broken</i>          | 1   | \$ 3,061.40 | \$ 3,061.40 |
| Flap Assy Active wire <i>turn</i>                               | 1   | \$ 765.30   | \$ 765.30   |
| Front Number Plate garnish <i>broken</i>                        | 1   | \$ 188.00   | \$ 188.00   |
| Front Bumper Cover <i>turn / broken</i>                         | 1   | \$ 481.10   | \$ 481.10   |
| Front bumper top cover <i>Down</i>                              | 1   | \$ 476.30   | \$ 476.30   |
| Front Bumper Sponge <i>turn</i>                                 | 1   | \$ 186.90   | \$ 186.90   |
| Front Bumper Reinforcement <i>broken</i>                        | 1   | \$ 1,136.70 | \$ 1,136.70 |
| Front Bumper Reinforcement ABSORBER (LH/RH) <i>st / Damaged</i> | 2   | \$ 186.50   | \$ 373.00   |
| Front Bumper Towing Cover <i>stx dislodged</i>                  | 1   | \$ 29.00    | \$ 29.00    |
| Front Bumper Moulding Centre Upper <i>broken / cut</i>          | 1   | \$ 368.50   | \$ 368.50   |
| Front Bumper Moulding <i>turn</i>                               | 1   | \$ 93.60    | \$ 93.60    |
| Front Bumper Lower Stiffener <i>broken</i>                      | 1   | \$ 285.10   | \$ 285.10   |
| Front bumper lower grille <i>broken</i>                         | 1   | \$ 365.30   | \$ 365.30   |
| front bumper lower grille moulding <i>broken / st</i>           | 1   | \$ 127.60   | \$ 127.60   |
| Front Bumper Lip <i>turn</i>                                    | 1   | \$ 35.10    | \$ 35.10    |
| Front Bumper Bracket Top (LH/RH) <i>broken</i>                  | 2   | \$ 35.00    | \$ 70.00    |
| Front Bumper Bracket (LH/RH) <i>o/s broken w/s HH</i>           | 2   | \$ 28.00    | \$ 56.00    |
| Front Bumper Retainer Mounting (LH/RH) <i>HH</i>                | 2   | \$ 65.30    | \$ 130.60   |
| Front Bumper Clips 10 pcs <i>HH</i>                             | 1   | \$ 25.00    | \$ 25.00    |
| Front Bumper Grille (LH/RH) <i>o/s dislodged w/s HH</i>         | 2   | \$ 186.90   | \$ 373.80   |
| Front bumper air duct (LH/RH) <i>o/s dislodged w/s HH</i>       | 2   | \$ 153.80   | \$ 307.60   |
| Day Light , LH <i>HH</i>                                        | 1   | \$ 642.50   | \$ 642.50   |
| Day Light , RH <i>broken</i>                                    | 1   | \$ 642.50   | \$ 642.50   |
| Day Light Wire, <i>SVZ</i>                                      | 1   | \$ 585.50   | \$ 585.50   |
| BUZZER ASSY - PIEZO (LH) <i>HH</i>                              | 1   | \$ 388.00   | \$ 388.00   |
| Headlamp Support Panel Assy <i>broken</i>                       | 1   | \$ 1,139.30 | \$ 1,139.30 |
| Headlamp(LH/RH) <i>broken 2110.30 X 2</i>                       | 2   | \$ 3,987.30 | \$ 7,974.60 |
| Horn Unit (LH/RH) <i>HH</i>                                     | 2   | \$ 72.80    | \$ 145.60   |
| Horn Wire <i>HH</i>                                             | 1   | \$ 386.70   | \$ 386.70   |
| Radiator Inverter <i>st / punctured</i>                         | 1   | \$ 884.80   | \$ 884.80   |
| Radiator <i>st / Punctured</i>                                  | 1   | \$ 710.50   | \$ 710.50   |
| Radiator fan blower motor assy <i>broken</i>                    | 1   | \$ 1,459.60 | \$ 1,459.60 |











|                                                                                                                                                                                                                                                                                          |   |          |                    |
|------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|---|----------|--------------------|
| Transfer of Door Mechanism REAR                                                                                                                                                                                                                                                          | 1 | \$80.00  | \$80.00            |
| Re-set Rear Power Window System                                                                                                                                                                                                                                                          | 1 | \$200.00 | \$200.00           |
| Four Wheel Alignment                                                                                                                                                                                                                                                                     | 1 | \$120.00 | \$120.00           |
| Remove/Refix Undercarriage (Frt)                                                                                                                                                                                                                                                         | 1 | \$400.00 | \$400.00           |
| Remove/Refix Radiator                                                                                                                                                                                                                                                                    | 1 | \$90.00  | \$90.00            |
| Remove/Refix Aircon & Refill Gas                                                                                                                                                                                                                                                         | 1 | \$130.00 | \$130.00           |
| Remove/Refix Front Windscreen Glass                                                                                                                                                                                                                                                      | 1 | \$120.00 | \$120.00           |
| Remove/Refix Dashboard                                                                                                                                                                                                                                                                   | 1 | \$350.00 | \$350.00           |
| Remove/Refix Steering Rack/Wheel/Dr Shaft                                                                                                                                                                                                                                                | 1 | \$150.00 | \$150.00           |
| Diagnostic & Resetting To Erase Fault Code                                                                                                                                                                                                                                               | 1 | \$550.00 | \$550.00           |
| Diagnostic & Resetting ADAS Optical sensor                                                                                                                                                                                                                                               | 1 | \$550.00 | \$550.00           |
|                                                                                                                                                                                                                                                                                          |   |          |                    |
| <b>TOTAL LABOUR</b>                                                                                                                                                                                                                                                                      |   |          | <b>\$8,850.00</b>  |
|                                                                                                                                                                                                                                                                                          |   |          |                    |
| <b>ESTIMATE TOTAL</b>                                                                                                                                                                                                                                                                    |   |          | <b>\$70,978.86</b> |
| <p>This is an initial estimate based on a visual inspection of the above vehicle. The final repair quantum will be prepared after the vehicle is surveyed by a motor Surveyor appointed by the insurance company. Please send your book value request to: claims_ltr@bifrostauto.com</p> |   |          |                    |

60/-  
 44  
 60/-  
 150/-  
 50/-  
 80/-  
 80/-  
 44  
 44  
 } 150/-  
 3790.00  
 =

26/10/2022 @ 1300hrs

NA Auto

2/3m

18 days.

1 yr

- Provide EV

LKK Auto

before payment.

- Check part prices.

8

41511.31

4/5 26,000/-

**LKK Auto Consultants** hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer  
 Signature:  
 Date:

77710.34

# BIFROST AUTO PTE LTD

## SUPPLEMENTARY

DATE: 27-Oct-22

INSURANCE: UOI

MODEL: HYUNDAI IONIC

VEHICLE NO.: SHC 2635 U (S)

| Description                          | Qty | List Price  | Amount      |
|--------------------------------------|-----|-------------|-------------|
| Wiper Blade RH <i>new</i>            | 1   | \$ 46.00    | \$ 46.00    |
| Wiper Arm RH <i>new</i>              | 1   | \$ 133.60   | \$ 133.60   |
| Engine Under Cover <i>new</i>        | 1   | \$ 469.40   | \$ 469.40   |
| Engine Crossmember <i>new</i>        | 1   | \$ 1,803.90 | \$ 1,803.90 |
| Electronic Clutch Pump <i>broken</i> | 1   | \$ 4,386.50 | \$ 4,386.50 |
| Rear Crossmember <i>broken</i>       | 1   | \$ 1,468.70 | \$ 1,468.70 |
|                                      |     |             |             |
| SUB TOTAL                            |     |             | \$ 8,308.10 |
| LESS 20%                             |     |             | \$ 1,661.62 |
| DISCOUNTED TOTAL                     |     |             | \$ 6,646.48 |
|                                      |     |             |             |
| Clutch Fluid <i>new</i> SN           | 1   | \$ 85.00    | \$ 85.00    |
|                                      |     |             |             |
|                                      |     |             |             |
| SUB TOTAL                            |     |             | \$ 85.00    |
|                                      |     |             |             |
| ESTIMATE TOTAL                       |     |             | \$6,731.48  |

This is an initial estimate based on a visual inspection of the above vehicle. The final repair quantum will be prepared after the vehicle is surveyed by a motor Surveyor appointed by the insurance company. Please send your book value request to: [claims\\_itr@bifrostauto.com](mailto:claims_itr@bifrostauto.com)

*2*  
*yn*  
*2Kk Auto*

*8,262.10*  
*6,609.68*

*8*

[> Back to OneMotoring](#)

## Enquire PARF/COE Rebate for Registered Vehicle

### Vehicle Owner Particulars

|                |         |
|----------------|---------|
| Owner ID Type: | Company |
| Owner ID:      | 821R    |

### Vehicle Details

|                               |                      |
|-------------------------------|----------------------|
| Vehicle No.:                  | SHC2635U             |
| Vehicle to be Exported:       | Yes                  |
| Intended Deregistration Date: | 31 Oct 2022          |
| Vehicle Make:                 | HYUNDAI              |
| Vehicle Model:                | AE IONIQ HEV 1.6 DCT |
| Primary Colour:               | Blue                 |
| Manufacturing Year:           | 2018                 |
| Engine No.:                   | G4LEJU133551         |
| Chassis No.:                  | KMHC851CVKU122138    |
| Maximum Power Output:         | 103.6 kW (138 bhp)   |
| Open Market Value:            | \$25,070.00          |
| Original Registration Date:   | 11 Dec 2018          |
| First Registration Date:      | 11 Dec 2018          |
| Transfer Count:               | 0                    |
| Actual ARF Paid:              | \$12,098.00          |

### Intended PARF Rebate Details

|                               |             |
|-------------------------------|-------------|
| PARF Eligibility:             | Yes         |
| PARF Eligibility Expiry Date: | 10 Dec 2026 |
| PARF Rebate Amount:           | \$9,073.00  |

### Intended COE Rebate Details

|                             |                                      |
|-----------------------------|--------------------------------------|
| COE Expiry Date:            | 10 Dec 2026                          |
| COE Category:               | A - Car up to 1600cc & 97kW (130bhp) |
| COE Period(Years):          | 8                                    |
| PQP Paid:                   | \$22,057.00                          |
| COE Rebate Amount:          | \$11,332.00                          |
| <b>Total Rebate Amount:</b> | <b>\$20,405.00</b>                   |

### Message

Please note that the 8-year COE for this vehicle cannot be further renewed. The vehicle must be de-registered upon COE expiry or when the vehicle reaches its statutory lifespan (if applicable), whichever is earlier.

The information contained herein is correct as at 22 Oct 2022

OK



## Book Value for SHC 2635U

$$\text{Total purchase cost of taxi} = 69,568.85$$

$$\text{Less TAREF } 7,258.80 = \cancel{63} 62,310.05$$

96

$$\text{Depre / mtn} = 649.06$$

$$\begin{aligned} \text{Left } 50 \text{ mtns} &= 649.06 \times 50 \\ &= 32,453.00 \end{aligned}$$

$$\text{Add TAREF } 7,258.80 = 39,711.80$$

$$\begin{aligned} \text{Less LTA rebate at time} \\ \text{of loss} &= 39,711.80 - 20,405.00 \end{aligned}$$

$$\text{Nett loss BV} = 19,306.80$$

=