

ASS. REC. BY:

REF:

C721-22010554/Kay3

Kenneth

ASSIGNMENT

From:

Date:

Estimated Cost:

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No:

at Workshop m/s

Pulco

of

Insured:

Policy No.

Claims No.

Sum Insured:


Excess:

(Client's Record)

Make of Veh:

(Policy Condition)

Remark: The veh had commenced its
repair at the time of inspection.

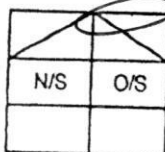

Bal. or Market Value:

IDAC Accident Rpt:

Consistent? : Yes or No

GIA / PR Seen:

Consistent? : Yes or No

Est. Repairs:

3 ~~04~~ days

Res.: Yes or No

Lump Sum:

20 %

3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date:

Person Contacted:

Vehicle: IN / OUT

Veh No:

SL7 4402A

Yr Regn:

10, 17

Type: M/Car / M/Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make:

Kia Niro

c.c.

1580

Colour

M. Red

A/C:

Insured / Std / NI / NA

Sp. Reading

93156

T/Radio:

Insured / Std / NI / NA

Eng/No:

C/No:

KNA6681CV11-5887728

Gen. Cond: Good / Fair / Poor / Burnt

Steering: Inorder / Jammed / Leaked / Burnt or

Brake: Inorder / Jammed / Leaked / Burnt or

Modl: Nil / S/Rlm / STD / Rlm or

Tyre Size:

F: Giti

205/60R16

R: YOKO

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /
TOYO / YOKO or

Front

R/Bal.

8

mm

Rear

R/Bal.

4

mm

L/Bal.

8

mm

L/Bal.

4

mm

D.O.A.

21/10/22

D.O.I.

28/10/2022

Survey held at

Des. of Damages: Frt / Rear / O/S / N/S / UIC / Rooftop or

Rt O/S

The UIC / Chassis frame / Body Structure affected due to collision.

Date / Time

Action / Instruction

1/ EM not ready

4/11 612pm @ 24006 Rmmr 1/12/22

1/12/22

confirmed with Jenny Lump sum \$2400 and 3 days
(Red, 9377.40, 80%)

Date/Time, File Pass to?



: Prell. Report

1)



: Final Report

Date/Time, File Return to?

2)

Days Of Repair:

3

Resurvey No. of Trlp:

Add Fee:



: Site Insp (\$



: Interview (\$



Tech Invs (\$



Weekend (\$

Survey Fee:

Transportation:

S + RS. SI

Fees

Others

TOTAL

Report Format :

Lump Sum / I.B.I: (\$


Fulco Autocare Pte Ltd

176 Sin Ming Drive #03-02 Sin Ming Autocare Singapore 575721
 Tel: (65) 6552 0302 Fax: (65) 6552 0780 Email: admin@fulcoautocare.com

Make/Model: KIA NIRO HYBRID
 Engine/Chassis No.: KNACC81CVH5087726
 Date of accident:
 Damaged area: O/S Front

Date: 28/10/2022
 Claim Type: TP
 VRN: SLT4402A

Not Authorized
11Ry & 2400p
Phenomenon After Painting
3 days



List items					
S/N	Parts description	QTY	UNIT PRICE	AMOUNT	
1	Bonnet	1	\$ 1,183.00	\$ 1,183.00	X
2	Bonnet lock	1	\$ 139.00	\$ 139.00	X
3	Bonnet bottom lock assy	1	\$ 58.00	\$ 58.00	X
4	Bonnet lock sensor	1	\$ 139.00	\$ 139.00	X
5	Front fender o/s	1	\$ 620.00	\$ 620.00	X
6	Front fender cowl o/s	1	\$ 189.00	\$ 189.00	X
7	Headlamp o/s 904	1	\$ 2,996.00	\$ 2,996.00	✓
8	Headlamp lower bracket o/s	1	\$ 168.00	\$ 168.00	X
9	Front bumper 688	1	\$ 986.00	\$ 986.00	✓
10	Front bumper top panel	1	\$ 475.00	\$ 475.00	X
11	Front bumper top panel "KIA" emblem	1	\$ 76.00	\$ 76.00	✓
12	Front bumper side retainer O/S D/R	2	\$ 48.00	\$ 96.00	✓
13	Front bumper bracket	2	\$ 44.00	\$ 88.00	X
14	Front bumper grille	1	\$ 457.00	\$ 457.00	X
15	Front bumper grille chrome moulding	1	\$ 189.00	\$ 189.00	X
16	Front bumper lower grille 131	1	\$ 294.00	\$ 294.00	✓
17	Front bumper side vent o/s	1	\$ 193.00	\$ 193.00	X
18	Fog lamp o/s 388	1	\$ 412.00	\$ 412.00	✓
19	Fog lamp silver moulding o/s 121	1	\$ 232.00	\$ 232.00	✓
20	Front bumper towing cap	1	\$ 68.00	\$ 68.00	X
21	Front bumper sponge 68	1	\$ 118.00	\$ 118.00	✓
22	Front bumper reinforcement	1	\$ 389.00	\$ 389.00	X
23	Front bumper lower skirt	1	\$ 280.00	\$ 280.00	X
24	Fog lamp cover o/s 56	1	\$ 121.00	\$ 121.00	✓
Subtotal				\$ 9,966.00	
List discount				10.00%	
Total				\$ 8,969.40	

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

Repair Estimate

Special nett items				
No.	Parts description	QTY	UNIT PRICE	AMOUNT
1	Bonnet insulator clips	nn 10	\$ 5.50	\$ 55.00
2	Front fender cowlings clips o/s	nn 8	\$ 5.50	\$ 44.00
3	Front bumper clips	nn 10	\$ 5.50	\$ 55.00
4	Engine under cowlings clips	nn 8	\$ 5.50	\$ 44.00
5	Radiator coolant	nn 1	\$ 60.00	\$ 60.00
6	Sundries	nn 1	\$ 50.00	\$ 50.00
Total				\$ 308.00

Labour			
No.	Description	Work unit	Amount
1	To dismantle / renew accident damaged portions. To panel beat, reshape, straighten, orientate and align repair / replacement parts.	6	\$ 1,200.00
2	To disconnect front wire harness of electrical components to facilitate repairs, reconnect and check functions including focusing headlamps.	0.25	\$ 50.00
3	To remove and refit radiator to facilitate repair. To perform pressure test and check cooling system functionality.	0.75	\$ nn 150.00
4	Supply spray paint material and necessary items to respray affected area / panel.	5	\$ 1,000.00
5	To rust proof all affected portions after repair.	0.5	\$ 100.00
Total labour			\$ 2,500.00

Estimate Grand Total	\$ 11,777.40
----------------------	--------------

LKK Auto Consultants hence notify the Repaire of the following:

- To resurvey before spray painting
- To display damaged parts during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a Without Prejudice basis
- No illegal modifications is allowed
- Supplemental items must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repaire

Signature: _____

Date: _____