

LKT GROUP PTE LTD

BLK 3006 UBI ROAD 1

#01-384 SINGAPORE 408700

OFFICE NO. : 6846 6260 / FAX NO. : 6477 9002

E-MAIL : lkt.mabel@gmail.com / claims.lkt@gmail.com

Date : 26-Oct-22

Registration no. : SJX6414E / TOYOTA VIOS J AUTO / 2010

DOA : 25-Oct-22

Estimate No. : LKT006_SJX6414E_VIOS

S/N	Qty	Item	Amount
<u>LIST ITEMS</u>			
1	1	Roof panel	870.30
2	2	Roof panel side moulding x2	512.20
3	1	Roof lining	594.50
4	1	Front windscreen	1430.00
5	1	Front windscreen pillar RH To Repair	0.00
6	1	Front windscreen pillar inner garnish RH	141.70
7	1	Front windscreen pillar LH To Repair	0.00
8	1	Front windscreen moulding	176.45
9	1	IU bracket	25.00
10	1	Rear view mirror	212.64
11	1	Rear windscreen moulding	138.00
12	1	Front wiper garnish RH	75.82
13	1	Front wiper garnish LH	75.82
14	1	Bonnet	821.00
15	1	Front bumper	745.30
16	2	Front bumper side retainer x2	248.00
17	2	Front bumper bracket x2	141.00
18	1	Headlamp RH	680.40
19	1	Front fender RH	674.90
20	1	Front fender emblem 'VVTI' RH	82.60
21	1	Front door RH	773.60
22	1	Front door black tape RH	97.30
23	1	Front door LH To Repair	0.00
24	1	Front door black tape LH	97.30
25	1	Wing mirror assy RH	475.00
26	1	Rear door RH To Repair	0.00
27	1	Rear door black tape RH	94.00
28	1	Rear fender RH To Repair	0.00
29	1	Bootlid To Repair	0.00
30	1	Bootlid logo	95.40
31	1	Bootlid emblem 'VIOS'	78.20
32	1	Bootlid emblem 'J'	68.50
33	1	Rear bumper To Repair	0.00
34	2	Rear bumper side retainer x2	240.40
			9665.33
Less 25%			2416.33
			7249.00

LKT GROUP PTE LTD

BLK 3006 UBI ROAD 1

#01-384 SINGAPORE 408700

OFFICE NO. : 6846 6260 / FAX NO. : 6477 9002

E-MAIL : lkt.mabel@gmail.com / claims.lkt@gmail.com

Date : 26-Oct-22

Registration no. : SJX6414E / TOYOTA VIOS J AUTO / 2010

DOA : 25-Oct-22


Estmate No. : LKT006_SJX6414E_VIOS

S/N	Qty	Item	Amount
<u>SPECIAL NETT ITEMS</u>			
1	1	Sundries	60.00
2	1set	Front bumper clips	80.00
3	1set	Rear bumper clips	80.00
4	1	Front door inner seal RH	100.00
5	1set	Front door trimboard clips RH	65.00
6	1	Front door inner seal LH	100.00
7	1set	Front door trimboard clips LH	65.00
8	1	Rear door inner seal RH	100.00
9	1set	Rear door trimboard clips RH	60.00
10	1	Rear fender inner trim clips RH	70.00
11	1	Front windscreen primer & cleaner	100.00
12	1	Front windscreen sealant	80.00
13	1	Front windscreen inner seal	60.00
14	1	Rear windscreen primer & cleaner	100.00
15	1	Rear windscreen sealant	80.00
16	1	Rear windscreen inner seal	60.00
			1260.00
Parts Total			8509.00
<u>LABOUR & MISC CHARGES</u>			
1	1	Panel beating and strenghten parts on accident area.	1750.00
2	1	Check wiring system after disconnect and connect.	80.00
3	1	To R&R front windscreen for replacement parts.	150.00
4	1	To R&R rear windscreen for replacement parts.	150.00
5	1	To R&R interior upholstery for replacement parts.	200.00
6	1	To apply undercoating for rust roofing.	200.00
7	1	Spray painting on accident area.	2400.00
Labour Total			4930.00
Total Parts and Labour Cost of Repair			13439.00

20% Lump sum
COR (L/S)

Pre-Repair Survey :-

Name :

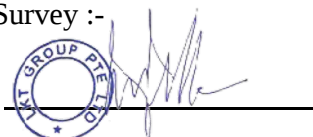

Contact no. : 68466260 / 98300271

Date / Time : 27/10/22

