



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

CHINA TAIPING INSURANCE (S) PTE LTD

INV No. AC2303828

3 ANSON ROAD #16-00
SPRINGLEAF TOWER
SINGAPORE 079909

INV Date 16/06/2023
Reference CC6/CTI22010760/Uya3q2
Code CTI

PROFESSIONAL SERVICE FEE

Vehicle No. SLD 8771S
Insured Veh. XD 161M
Claim No. SNM22D207736/C02
Policy No. DMCVSNA00095252201
Accident Date 27/10/2022
Inspection Date 31/10/2022

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (8%)	32.00
Grand Total	432.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
CHINA TAIPING INSURANCE (S) PTE LTD 3 ANSON ROAD #16-00 SPRINGLEAF TOWERSINGAPORE 079909			Ref: CC6/CTI22010760/Uya3q2 Date: 16/06/2023 Code: CTI	
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	XD 161M	Veh. Inspected	SLD 8771S	
Policy No.	DMCVSNA00095252201	Coverage (\$)	0.00	
Claim No.	SNM22D207736/C02	Excess (\$)	0.00	
Assign From		Assign Date	31/10/2022	
2. Vehicle Particulars & Condition				
Make & Model	MAZDA 3 SP (A)	c.c	1496	
Engine No.	HIDDEN	Year of Reg.	2016	
Chassis No.	JM6BM42A8G0338563	Colour	BLUE	
Odometer	67869 KM	Steering	IN ORDER	
Brakes	IN ORDER	Modification	SPORTS RIM	
General	GOOD			
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre	205/60 R16	WEST LAKE	6 mm	
L/H Front Tyre	205/60 R16	WEST LAKE	6 mm	
R/H Rear Tyre	205/60 R16	WEST LAKE	6 mm	
L/H Rear Tyre	205/60 R16	WEST LAKE	6 mm	
4. Description of Damages				
THE VEHICLE SUSTAINED DAMAGES AT THE O/S REAR PORTION. DAMAGES SEE DETAILS.				
5. General Information				
Accident Date	27/10/2022	Inspection Date	31/10/2022	
Survey held at	T K LEE AUTOMOTIVE PTE LTD NO. 1 KAKI BUKIT AVE 6 #02-47 AUTOBAY SINGAPORE 417883			
5a. Remarks				
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
5b. Estimate Days of Repair				
ESTIMATED NORMAL PERIOD FOR REPAIR:			5 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SLD 8771S

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
<u>REPLACEMENT OF PARTS</u>				
1	REAR BUMPER	TORN	1,074.00	1,074.00
2	REAR BUMPER SIDE RETAINERS -R/L @\$64.60	O/S BENT	129.20	64.60
1	REAR BUMPER REFLECTOR -RH	NOT NECESSARY	89.50	-
1	REAR BUMPER SPLASH SHIELD -RH	TORN	110.60	110.60
1	REAR DOOR-RH	TO REPAIR SEE LABOUR	1,251.60	-
1	REAR FENDER -RH	BADLY DENTED	1,745.00	1,415.00
1	REAR FENDER AIR VENT	NOT NECESSARY	121.30	-
1	REAR FENDER INNER PANEL	TO REPAIR SEE LABOUR	845.00	-
1	REAR SPORT WHEEL -RH	NOT NECESSARY	851.90	-
1	REAR TAILLAMP -RH	NOT NECESSARY	951.30	-
1	SET REAR WINDSCREEN MOULDING	NECESSARY	120.20	120.20
	LESS 20% DISCOUNT		-1,457.92	-556.88
			5,831.68	2,227.52
<u>SPECIAL NETT ITEMS</u>				
1	SET REAR BUMPER CLIP (SN)	NECESSARY	45.00	45.00
1	SET REAR REVERSE SENSOR (SN)	NOT NECESSARY	280.00	-
1	SET REAR WINDSCREEN SEALANT (SN)	NECESSARY	80.00	40.00
1	REAR TYRE -RH (SN)	NOT NECESSARY	280.00	-
			685.00	85.00
<u>LABOUR</u>				
	TO REMOVE ,REFIX REAR WINDSCREEN .		180.00	120.00
	TO REMOVE & REFIX REAR INTERIOR TRIMS TO ASSIST REPAIR .		120.00	60.00
	TO REMOVE,REPLACE REVERSE SENSOR .		60.00	50.00
	TO CHECK REAR ELECTRICAL WIRING .		50.00	20.00
	TO CONDUCT COMPUTERISED WHEEL ALIGNMENT .	NOT NECESSARY	120.00	-
	TO TUFF KOTE.		80.00	30.00
	TO PUTTY ,SPRAY PAINT & POLISH AFFECTED PARTS.		1,200.00	600.00



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	TO PANEL BEAT ,CUT ,WELD ,REMOVE & REPLACE DAMAGED PARTS.INCLUSIVE OF THE REPAIR OF REAR DOOR-RH AND REAR FENDER INNER PANEL .		1,200.00	600.00
			3,010.00	1,480.00
GRAND TOTAL			9,526.68	3,792.52
RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)				3,000.00

Report Ref No. CC6/CTI22010760/Uya3q2

CHUA KANG SENG

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SLD 8771S

INSPECTION






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

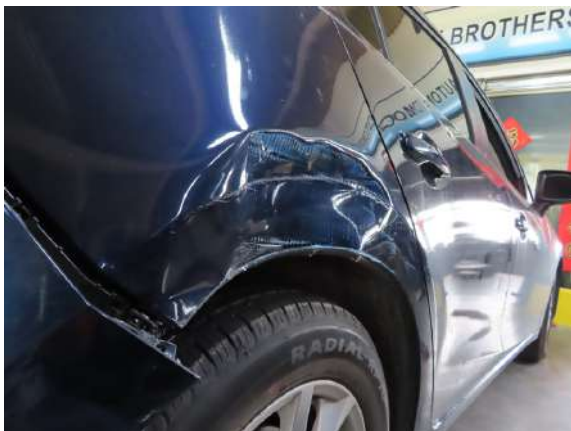




LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

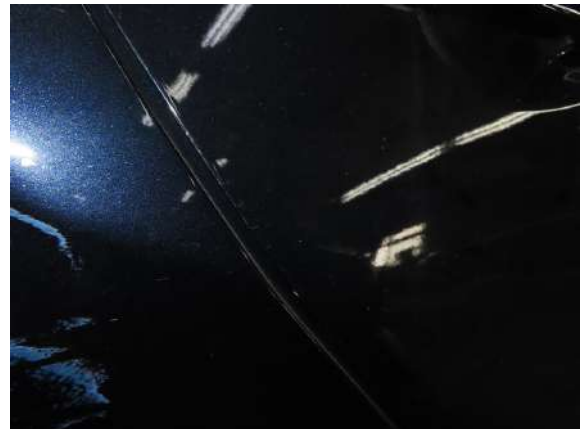



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

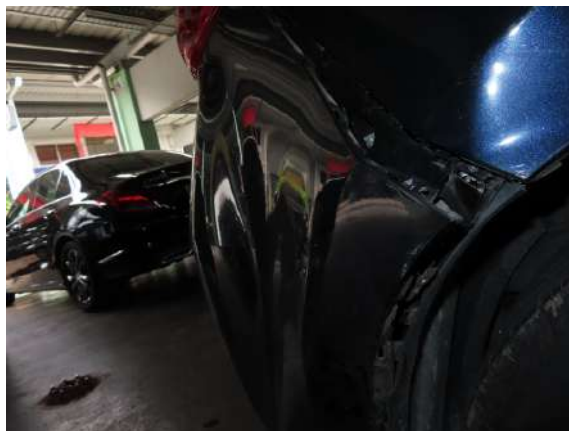



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SLD 8771S

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

