

ASS. REC. BY:

REF:

AISI

Kenneth

ASSIGNMENT

From:

Date:

Estimated Cost:

OD/TP/WS/TP RES/OD RES/EVA/INV/MV

To Inspect Vehicle No:

at Workshop m/s

Munich

of

Insured:

Policy No.

Claims No.

Sum Insured:

Excess:


2k

(Client's Record)

Make of Veh:

(Policy Condition)

Remark: The veh had commenced its
repair at the time of inspection.

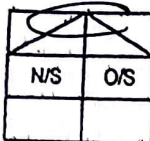

Bal. or Market Value:

890k

IDAC Accident Report:

Consistent? : Yes or No

GIA / PR Seen:

Consistent? : Yes or No

Est. Repairs:

12

days

Res.: Yes or No

Lum Sum:

1.31 %

3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date:

Person Contacted:

Vehicle: IN / OUT

Veh No:

SMT 4501M Yr Regn: C31 19

Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Wagon

Make:

Kia Carex

C.C

Colour

m Silver

A/C: Insured / Std / NI / NA

Sp. Reading

355957

T/Radio: Insured / Std / NI / NA

Eng/No:

C/No:

KNAHU815VJ 7212043

Gen. Cond: Good / Fair / Poor / Burnt

Steering: In order / Jammed / Leaked / Burnt or

Brake: In order / Jammed / Leaked / Burnt or

Modl: NII / S/Rim / STD A/Rim or

Tyre Size:

F:

205/55R16

Firelander

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or

Front

Rear

R/Bal.

7

mm

R/Bal.

9

mm

L/Bal.

7

mm

L/Bal.

9

mm

D.O.A.

26/10/22

D.O.I.

4/11/2022

Survey held at

Des. of Damages: Frt / Rear / O/S / N/S / UIC / Rooftop or

The UIC / Chassis frame / Body Structure affected due to collision.

Date / Time

Action / Instruction

Date/Time, File Pass to?

☐

: Prell. Report

Days Of Repair:

Resurvey No. of Trlp:

Survey Fee:

Date/Time, File Return to?

☐

: Final Report

Transportation:

Add Fee:

☐

: Site Insp (\$

☐

: Interview (\$

☐

Tech Invs (\$

☐

Weekend (\$

) S - RS. SI

) P. Ins

) Others

Report Format :

Lump Sum / I.B.I: (\$

TOTAL

> Back to OneMotoring

Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars

Owner ID Type:

Company

Owner ID:

055D

Vehicle Details

Vehicle No.:

SMJ4501M

Vehicle to be Exported:

Yes

Intended Deregistration Date:

26 Oct 2022

Vehicle Make:

KIA

Vehicle Model:

CARENS 1.7 DCT DIESEL 5DR FWD

Primary Colour:

Silver

Manufacturing Year:

2018

Engine No.:

D4FDJD028220

Chassis No.:

KNAHU815VJ7212043

Maximum Power Output:

104.0 kW (139 bhp)

Open Market Value:

\$19,854.00

Original Registration Date:

05 Mar 2019

First Registration Date:

05 Mar 2019

Transfer Count:

0

Actual ARF Paid:

\$19,854.00

Intended PARF Rebate Details

PARF Eligibility:

Yes

PARF Eligibility Expiry Date:

04 Mar 2029

PARF Rebate Amount:

\$14,890.00

Intended COE Rebate Details

COE Expiry Date:

04 Mar 2029

COE Category:

B - Car above 1600cc or 97kW (130bhp)

COE Period(Years):

10

QP Paid:

\$35,403.00

COE Rebate Amount:

\$22,481.00

Total Rebate Amount:

\$37,371.00

The information contained herein is correct as at 26 Oct 2022

OK

Munich Autocare Pte Ltd (Co.Reg.No:201832250M)

60 Jalan Lam Huat, #07-43

Singapore 737869

Tel: 62552288 Fax: 62655388 Email: dennis.deng@munichautocare.com.sg

INSURER: Allianz Insurance Singapore Pte. Ltd. (HQ)

PARTICULARS OF CLAIM

Claim Type:	OD (OWN DAMAGE)	Ref. No:	26/10/2022
Policy No:	SP2002451400	Date of Loss:	
Vehicle Reg. No.:	SMJ4501M	Driveable?	
Driver Age/Info:		Party At Fault:	UNKNOWN
TP Injury Involved?	NO	Third Party Involved?	YES
Insured/Claimant:	BIS MOTORING PTE LTD		

Make/Model:	KIA CARENS, 1.7 D DCT DIESEL 5DR FWD (A)	Vehicle Reg. Date:	05/03/2019
Vehicle Colour:	SILVER	Chassis No:	KNAHU815VJ7212043
Engine No:	D4FDJD028220		
Odometer:	355957 KM		

Paint Type:
Total Loss?
Est. Duration of Repair
(day)

NO

14/2

*Not with work
Repairing by painting
Est 820000.*

Present Location: MUNICH AUTOCARE PTE LTD (HQ)

COST OF CLAIMS

Amount

Parts	19,086.10
Miscellaneous Items	343.00
Labour	7,040.00
Paintwork Labour	0.00
Towing	0.00
Calculated Gross Total (S\$)	26,469.10
- Excess (S\$)	2,000.00
(S\$)	24,469.10
+ GST 7.00% (S\$)	1,712.84
Nett Amount (S\$)	26,181.94

This claim is handled by: LIM JIA HAW

Generated using Merimen e-Claims Internet Estimation & Adjusting System

**LKK Auto Consultants hence notify
the Repairer of the following:**

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

REPAIR DETAILS

Reference

Part Source: MRM-SG Version: 1.0 (Last Synchronised: 31 Oct 2022)

Parts: M1-MPV KIA CARENS 1.7 D DCT DIESEL 5DR FWD (A) (Catalogue:Merimen Singapore 1.0)

Labour: Repairer's (Price-denominated Standard List)

Print Code: Munich Autocare Pte Ltd/SMJ4501M/31/10/2022 14:01

Validity: These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page

Further Info: Items/values not in reference catalogue are prefixed with an asterisk *.

Estimates on Parts

No.	Qty	Part No.	Particulars	%Disc	%Depr	Amount	
1	1		*front wiper garnish assy	Sm 0.00	0.00	*114.00 F	X
2	1	A66400A4000	*front bonnet	Bu 0.00	0.00	*384.00 F	✓
3	1	A86320A4000	*front bonnet logo <i>Gn</i>	hi 0.00	0.00	*33.00 F	✓
4	1	A81124A4000	*front bonnet insulation	bu 0.00	0.00	*180.00 F	X
5	1	A79100A4000	*front bonnet hinge LH	di 0.00	0.00	*18.00 F	✓
6	1		*Front bonnet hinge RH	di 0.00	0.00	*18.00 F	✓
7	1	A81130A4900	*Front bonnet lock	di 0.00	0.00	*36.00 F	✓
8	1	A81190A4800	*Front bonnet lock cable	0.00	0.00	*12.00 F	✓
9	1	A86511A4800	*Front bumper	Ti 0.00	0.00	*288.00 F	✓
10	1	A86525A4800	*front bumper lip seal	Ti 0.00	0.00	*24.00 F	✓
11	1	A86357A4000	*front bumper top seal	Sm 0.00	0.00	*14.00 F	✓
12	1	A86350A4810	*front radiator grille	CM 0.00	0.00	*234.00 F	✓
13	1		*front radiator grille moulding (chrome)	CM 0.00	0.00	*252.00 F	✓
14	1	A86561A4810	*front bumper lower grille	CM 0.00	0.00	*78.00 F	✓
15	1	A86565A4800	*front bumper lower lip (silver)	CM 0.00	0.00	*90.00 F	✓
16	1	A86560A4800	*stiffener assy - front bumper lower	CM 0.00	0.00	*54.00 F	✓
17	1	A86517A4800	*front bumper towing cover	hi 0.00	0.00	*12.00 F	✓
18	1	A86366A4000	*front bumper top cover	CM 0.00	0.00	*42.00 F	✓
19	1	A86585A4800	*front bumper top inner garnish	hi 0.00	0.00	*5.00 F	✓
20	1	A86585A4800	*front headlamp LH	Br 0.00	0.00	*576.00 F	✓
21	1	A92102A4160	*front headlamp RH	mi, Br 0.00	0.00	*576.00 F	✓
22	1	A86511A4000	*front headlamp bracket LH	CM 0.00	0.00	*10.00 F	✓
23	1	A86552A4000	*front headlamp bracket RH	CM 0.00	0.00	*10.00 F	✓
24	1	A86513A4800	*front bumper rentainer LH	di 0.00	0.00	*10.00 F	✓
25	1	A86514A4800	*front bumper rentainer RH	CM 0.00	0.00	*10.00 F	✓
26	1	A86521A4810	*front bumper fog lamp cover LH	nd 0.00	0.00	*66.00 F	✓
27	1	A86522A4810	*front bumper fog lamp cover RH	Sm 0.00	0.00	*66.00 F	X
28	1	A92201A4500	*front bumper fog lamp LH	0.00	0.00	*90.00 F	?
29	1	A92202A4500	*front bumper fog lamp RH	Sm 0.00	0.00	*90.00 F	X
30	1	A86520A4800	*Front bumper sponge	Ti 0.00	0.00	*54.00 F	✓
31	1	A86530A4000	*front bumper reinforcement	Ri 0.00	0.00	*192.00 F	✓
32	1	A64101A4000	*front support panel	CM 0.00	0.00	*300.00 F	✓
33	1		*front chassis LH	R 0.00	0.00	*480.00 F	X
34	1		*front chassis RH	R 0.00	0.00	*480.00 F	X
35	1	A66311A4000	*front fender LH	Bu 0.00	0.00	*210.00 F	✓
36	1	A66321A4000	*front fender RH	Bu 0.00	0.00	*210.00 F	✓
37	1	A86810A4000	*front fender inner shield LH	Sm 0.00	0.00	*46.00 F	X
38	1	A86820A4000	*front fender inner shield RH	CM 0.00	0.00	*46.00 F	✓
39	1	A98610A4100	*front wiper washing tank	Sm 0.00	0.00	*96.00 F	X
40	1	A282702A480	*front inter cooler	Pu 0.00	0.00	*720.00 F	✓
41	1	CD00891	*Front a/cond condensor	Ri 0.00	0.00	*360.00 F	✓
42	1	A97775A4500	*front aircon lower pressure pipe comp to evap	0.00	0.00	*276.00 F	?
43	1	A97762A4500	*front aircon high pressure pipe cond to comp	0.00	0.00	*105.00 F	?
44	1	25310A4560	*front radiator assy	Bi, Pu 0.00	0.00	*360.00 F	✓
45	7	A253362P000	*insurator radiator mtg	0.00	0.00	*35.00 F	?

10/31/22, 2:02 PM

Repairer Estimates

No.	Qty	Part No.	Particulars	%Disc	%Depr	Amount	
46	1	A25414A4600	*front radiator upper hose	0.00	0.00	*66.00 F	7
47	1		*front radiator lower hose	0.00	0.00	*95.00 F	7
48	1	A29134A4000	*front radiator protector LH	CMA 0.00	0.00	*22.00 F	7
49	1	A29136A4000	*front radiator protector RH	CM 0.00	0.00	*22.00 F	7
50	1	A25380A4510	*fan cooling fan coving	CMA 0.00	0.00	*360.00 F	7
51	1	A28210A4000	*front intake cover upp	Pu 0.00	0.00	*24.00 F	X
52	1	A28220A4000	*front intake cover ctr	0.00	0.00	*22.00 F	7
53	1	A28220A4200	*front intake blower low	0.00	0.00	*84.00 F	7
54	1	A28221A4000	*front intake top cover LH	Pu 0.00	0.00	*10.00 F	X
55	1	A28221A4100	*front intake top cover RH	Pu 0.00	0.00	*10.00 F	X
56	1		*front engine harnesses	0.00	0.00	*1,500.00 F	7
57	1	283102A690M	*front outlet manifold	0.00	0.00	*700.00 F	7
58	1	A96610A4100	*front engine horn LH	0.00	0.00	*48.00 F	7
59	1	A96620A4100	*front engine horn RH	Pu 0.00	0.00	*48.00 F	7
60	1		*front windscreen pillar LH	R 0.00	0.00	*900.00 F	X
61	1		*front windscreen pillar RH	R 0.00	0.00	*900.00 F	X
62	1	KS292402A880	*front engine top cover	Pu 0.00	0.00	*96.00 F	X
63	1	A281103Z350	*Front engine air resonator with filter	0.00	0.00	*72.00 F	7
64	1		*front engine oil check level dipstick	Pu 0.00	0.00	*12.00 F	X
65	1		*front engine inter cooler upper pipe	Pu 0.00	0.00	*156.00 F	7
66	1		*front dash board assy	Th 0.00	0.00	*960.00 F	7
67	1	KS56900A4000	*front steering air bag	Avon 0.00	0.00	*960.00 F	7
68	1	KS84530A4000	*front passenger air bag	u 0.00	0.00	*660.00 F	7
69	1	KS88810A4000	*front seat belt LH	Th 0.00	0.00	*276.00 F	7
70	1	KS88820A4200	*front seat belt RH	Th 0.00	0.00	*276.00 F	7
71	1	KS88841A4200	*front seat belt tensioner RH	0.00	0.00	*252.00 F	7
72	1		*front steering clock spring	Mc 0.00	0.00	*108.00 F	7
73	1	KS95910A4350	*air bag computer unit	Mc 0.00	0.00	*1,032.00 F	7
74	1	A95930A4100	*front abs sensor LH	Mc 0.00	0.00	*114.00 F	7
75	1	A95930A4100	*front abs sensor RH	Mc 0.00	0.00	*114.00 F	7
76	1	A29110-A4600	*shield , protector engine	CMA 0.00	0.00	*90.00 F	7

F=Franchise part.

Sub Total (\$\$)	17,351.00
+ Margin on L,N Items 10.00% (\$\$)	1,735.10
Total Parts (\$\$)	19,086.10

Munich Autocare Pte Ltd/SMJ4501M/31/10/2022 14:01. Not valid without Reference section.
Generated using Merimen e-Claims IEAS

10/31/22, 2:02 PM

Repairer Estimates

Estimates on Miscellaneous Items

Amount

No Qty Particulars

Miscellaneous Items

1	15	FENDER INNER SHIELD CLIP LH/RH
2	7	FRONT BUMPER CLIP
3	1	FRONT ENGINE COOLANT
4	1	FRONT BUMPER PLATE
5	2	FRONT QUARTER GLASS SEALANT
6	7	FRONT RADIATOR TOP GARNISH CLIPS

<i>old n</i>	105.00	<i>4</i>
<i>n</i>	49.00	<i>—</i>
<i>n</i>	25.00	<i>—</i>
<i>n</i>	45.00	<i>—</i>
<i>n</i>	70.00	<i>X</i>
<i>n</i>	49.00	<i>✓</i>

Sub Total (\$\$) 343.00

Estimates on Labour

No Particulars

Lab.Type

Amount

Labour Items

1	TO REMOVE & REFIX, REPAIR, KNOCKING, WELDING FRONT PORTION, BONNET , BUMPER, SUPPORT PANEL , FENDER LH/RH, WHEEL HOUSE LH/RH CHASSIS LH/RH AND DAMAGE AREA	New	<i>800-1100</i> 2,000.00	
2	TO CHECK ALL WIRING FOR OPERATION AND PARKING SENSOR FOR OPERATION	New	<i>601</i> 120.00	
3	TO CHECK AND ADJUST HEADLAMP LH/RH FOCUS	New	<i>201</i> 120.00	
4	TO REMOVE/INSTALL RADIATOR COOLING SYSTEM & ALL NECESSARY PARTS, INCLUDING PRESSURE TEST, BLEED COOLING SYSTEM & CHECK LEAKS FOR REPLACE FRONT SUPPORT PANEL AND DAMAGE AREA	New	<i>801</i> 350.00	
5	TO CONDUCT RE-PROGRAMME AIR BAG SYSTEM AND SETTING OF ECU SYSTEM TO CLEAR FAULT CODE	New	<i>200</i> 380.00	
6	TO REFILL A/COND GAS	New	<i>1001</i> 120.00	
7	1.00 \$120.00 TO CONDUCT 4 WHEEL ALIGNMENT	New	120.00	<i>7</i>
8	TO REMOVE FRONT QUARTER GLASS LH/RH AND REPLACE FRONT FENDER LH/RH	New	<i>22</i> 120.00	<i>X</i>
9	TO DISMANTLE & REFIX FRONT SEAT BELT LH & RH AND TENSIONER RH AND REAR SEAT BELT LH & RH AND BUCKLE LH & RH	New	<i>120</i> 380.00	
10	TO DISMANTLE & REFIX DASHBOARD , INCLUDING TO REMOVE & REPLACE PASSENGER SEAT AIR BAG AND DRIVER SEAT AIRBAG	New	<i>2501</i> 480.00	
11	TO REMOVE AND INSTALL FUSE BOX IN ORDER TO CARRY OUT NECESSARY REPAIR JOB IN FRONT WHEEL HOUSING	New	200.00	<i>7</i>
12	TO REMOVE AND INSTALL ENGINE AND AUTO TRANSMISSION TO FACLLLTATE JACKING OF CHASSIS AND MOUNTING AND REPAIR JOB IN FRONT WHEEL HOUSIN	New	600.00	<i>7</i>
13	TO REMOVE AND REFIX ENGINE WIRE HARNESS	New	250.00	<i>7</i>
14	TO RESPRAY FRONT PORTION, BONNET INNER / OUTER ,FRONT PILAR LH/RH, FRONT BUMPER, SUPPORT PANEL , FRONT FENDER LH/RH WHEEL HOUSE LH/RH AND POLISH DAMAGE AREAS	New	<i>10001</i> 1,800.00	
15	TO RESPRAY FRONT PORTION, BONNET INNER / OUTER ,FRONT PILAR LH/RH, FRONT BUMPER, SUPPORT PANEL , FRONT FENDER LH/RH WHEEL HOUSE LH/RH AND POLISH DAMAGE AREAS	New	-	

Gross Labour Cost (\$\$) 7,040.00

Munich Autocare Pte Ltd/SMJ4501M/31/10/2022 14:01. Not valid without Reference section.
Generated using Merimen e-Claims IEAS

< END OF ESTIMATES >