

Thiam Heng Huat Pte Ltd

176 Sin Ming Drive #05-14 Sin Ming Autocare Singapore 575721

Mobile: 82636295 Email: thiamhenghuat@gmail.com

Make/Model: HONDA CIVIC

Date: 08/11/2022


Engine/Chassis No.: JHMFD1630AS200098

Claim Type: TP

Date of accident: 02.11.22

VRN: SJY7004T

Damaged area: Front

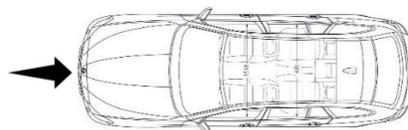

List items				
S/N	Parts description	QTY	UNIT PRICE	AMOUNT
1	Bonnet	1	\$ 953.00	\$ 953.00
2	Bonnet insulator	1	\$ 225.00	\$ 225.00
3	Front bumper	1	\$ 981.00	\$ 981.00
4	Front bumper side retainer	2	\$ 55.00	\$ 110.00
5	Front bumper top panel	1	\$ 189.00	\$ 189.00
6	Radiator grille	1	\$ 325.00	\$ 325.00
7	Radiator grille "HONDA" logo	1	\$ 55.00	\$ 55.00
8	Support panel	1	\$ 687.00	\$ 687.00
9	Front licence plate garnish	1	\$ 106.00	\$ 106.00
10	Headlamp o/s	1	\$ 1,345.00	\$ 1,345.00
11	Headlamp lower bracket o/s	1	\$ 59.00	\$ 59.00
12	Front bumper tow cover	1	\$ 49.00	\$ 49.00
13	Front bumper lower lip	1	\$ 214.00	\$ 214.00
14	Front foglamp	2	\$ 229.00	\$ 458.00
15	Front foglamp outer garnish	2	\$ 179.00	\$ 358.00
16	Radiator assy	1	\$ 921.00	\$ 921.00
17	Aircon condensor	1	\$ 1,021.00	\$ 1,021.00
18	Radiator / condensor fan	2	\$ 543.00	\$ 1,086.00
19	Radiator fan cowling	1	\$ 432.00	\$ 432.00
20	Front bumper reinforcement	1	\$ 538.00	\$ 538.00
21	Headlamp panel o/s	1	\$ 194.00	\$ 194.00
22	Front fender o/s	1	\$ 1,067.00	\$ 1,067.00
23	Front fender top moulding o/s	1	\$ 98.00	\$ 98.00
24	Bonnet hinge	2	\$ 145.00	\$ 290.00
Subtotal				\$ 11,761.00
List discount				20.00%
Total				\$ 9,408.80

Repair Estimate

Special nett items				
No.	Parts description	QTY	UNIT PRICE	AMOUNT
1	Bonnet insulator clips	10	\$ 4.50	\$ 45.00
2	Front bumper clips	12	\$ 4.50	\$ 54.00
3	Front licence plate & frame	1	\$ 55.00	\$ 55.00
4	Radiator coolant	1	\$ 60.00	\$ 60.00
5	Sundries	1	\$ 50.00	\$ 50.00
Total				\$ 264.00

Labour			
No.	Description	Work unit	Amount
1	To dismantle / renew accident damaged portion. To panel beat, reshape, straighten, orientate and align repair / replacement parts.	5	\$ 1,000.00
2	To disconnect wire harness of electrical component to facilitate repairs, reconnect and check functions.	0.25	\$ 50.00
3	Supply spray paint material and necessary items to respray affected area / panel.	4	\$ 800.00
4	To rust proof accident affected portions.	0.5	\$ 100.00
Total labour			\$ 1,950.00

Estimate Grand Total	\$ 11,622.80
-----------------------------	---------------------