



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

CHINA TAIPING INSURANCE (S) PTE LTD

INV No. AC2302503

3 ANSON ROAD #16-00
SPRINGLEAF TOWER
SINGAPORE 079909

INV Date 20/04/2023
Reference CC6/CTI22011026/Uya3q2
Code CTI

PROFESSIONAL SERVICE FEE

Vehicle No. GBG 684R
Insured Veh. GBF 1727A
Claim No. SNM22D207942/C02
Policy No. DMCVSNW00083192203
Accident Date 03/11/2022
Inspection Date 04/11/2022

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (8%)	32.00
Grand Total	432.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
CHINA TAIPING INSURANCE (S) PTE LTD 3 ANSON ROAD #16-00 SPRINGLEAF TOWERSINGAPORE 079909			Ref: CC6/CTI22011026/Uya3q2 Date: 20/04/2023 Code: CTI	
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	GBF 1727A	Veh. Inspected	GBG 684R	
Policy No.	DMCVSNW00083192203	Coverage (\$)	0.00	
Claim No.	SNM22D207942/C02	Excess (\$)	0.00	
Assign From		Assign Date	04/11/2022	
2. Vehicle Particulars & Condition				
Make & Model	NISSAN NV200 (M)	c.c	1461	
Engine No.	HIDDEN	Year of Reg.	2017	
Chassis No.	VSKYBAM20Z0143582	Colour	GREY	
Odometer	104408 KM	Steering	IN ORDER	
Brakes	IN ORDER	Modification	NIL	
General	GOOD			
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre	185/70 R14	DUNLOP	6 mm	
L/H Front Tyre	185/70 R14	DUNLOP	6 mm	
R/H Rear Tyre	185/70 R14	DUNLOP	6 mm	
L/H Rear Tyre	185/70 R14	DUNLOP	6 mm	
4. Description of Damages				
THE VEHICLE SUSTAINED DAMAGES AT THE REAR PORTION. DAMAGES SEE DETAILS.				
5. General Information				
Accident Date	03/11/2022	Inspection Date	04/11/2022	
Survey held at	SPEEDWERKZ PTE LTD 1 KAKI BUKIT AVE 6 #01-73, AUTOBAY @KAKI BUKIT SINGAPORE 417883			
5a. Remarks				
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
5b. Estimate Days of Repair				
ESTIMATED NORMAL PERIOD FOR REPAIR:		7 Working Days		



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 3

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. GBG 684R

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	REAR DOOR TOP LOCK LH	NOT NECESSARY	323.00	-
2	REAR DOOR HINGE @\$112.60	NOT NECESSARY	225.20	-
1	REAR DOOR LOCK LOWER LH	TWISTED / SHORTED	182.30	115.00
1	REAR DOOR LH	BADLY DENTED	1,926.50	1,469.50
1	REAR DOOR CENTER GARNISH LH	DEFORMED /TORN	312.00	208.00
1	REAR DOOR INNER BOARD LH	NOT NECESSARY	356.80	-
1	REAR DOOR RH	BADLY DENTED	1,895.20	1,102.20
1	REAR DOOR INNER BOARD RH	NOT NECESSARY	315.10	-
2	REAR DOOR HINGE RH @\$112.60	NOT NECESSARY	225.20	-
1	REAR DOOR RUBBER	TORN	215.50	118.00
1	REAR DOOR TOP LOCK RH	NOT NECESSARY	258.80	-
1	REAR DOOR POWER LOCK RH	TWISTED / SHORTED	182.00	115.00
2	REAR FENDER @\$1798.50	NOT NECESSARY	3,597.00	-
1	REAR FLOOR BOARD PANEL	TO REPAIR SEE LABOUR	1,835.50	-
1	REAR BUMPER	DENTED	628.50	485.90
1	REAR BUMPER INNER SPONGE	TORN	115.60	94.40
2	REAR BUMPER SIDE BRACKET @\$119.20	CRACKED	238.40	120.00
1	REAR END PENAL (OUTER)	BADLY DENTED	765.50	248.80
1	REAR END PENAL (INNER)	BADLY DENTED	958.20	697.00
2	REAR BUMPER REFLECTOR @\$63.60	O/S CRACKED	127.20	36.80
1	REAR DOOR EMBLEM (NV 200)	NOT FITTED	100.70	-
1	REAR DOOR EMBLEM LOGO	NOT FITTED	70.90	-
1	REAR DOOR CHECKER LH	NOT NECESSARY	178.00	-
1	REAR DOOR CHECKER RH	NOT NECESSARY	178.00	-
2	REAR NUMBER PLATE LAMP @\$70.20	NOT NECESSARY	140.40	-
1	REAR BOOT RUBBER	TWISTED	258.50	242.00
1	REAR BOOT TOP GARNISH	TWISTED	142.00	83.30
2	REAR TAILLAMP @\$364.50	NOT NECESSARY	729.00	-
1	REAR SPARE TYRE CARRIER	NOT NECESSARY	395.20	-

Report Ref No. CC6/CTI22011026/Uya3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	REAR EXHAUST PIPE	NOT NECESSARY	825.50	-
2	REAR EXHAUST RUBBER @\$35.00	NOT NECESSARY	70.00	-
1	REAR CARRIER FLOOR CARPET	NOT NECESSARY	475.00	-
	LESS 10% DISCOUNT		-1,824.67	-513.59
			16,422.03	4,622.31
	<u>SPECIAL NETT ITEMS</u>			
4	REAR END PANEL TOP GARNISH CLIPS @\$6.50 (SN)	NOT NECESSARY	26.00	-
20	REAR DOOR INNER COVER BOARD CLIPS @\$6.50 (SN)	NOT NECESSARY	130.00	-
8	REAR DOOR STICKER (70KM/H) (SN)	NECESSARY	25.00	10.00
6	REAR DOOR STICKER (SN)	NOT FITTED	25.00	-
4	REAR TAIL LAMP CLIPS @\$6.50 (SN)	NOT NECESSARY	26.00	-
2	REAR WINDSCREEN SEALANT (SN)	NECESSARY	120.00	80.00
1	REAR NUMBER PLATE WITH HOUSING (SN)	SERVICEABLE	80.00	-
2	REAR END PANEL SEALANT (SN)	NECESSARY	80.00	50.00
1	SET REAR REVERSE SENSOR (SN)	SHORTED	450.00	200.00
1	REAR CARRIER WOODEN PAZEL (SN)	NOT NECESSARY	450.00	-
1	SET DESIGNER WRAP ,STICKER ,DECALS (SN)	NECESSARY	1,800.00	800.00
			3,212.00	1,140.00
	<u>LABOUR</u>			
	TO CHECK WIRING .		180.00	20.00
	APPLY UNDER COATING RUST PROOF .		250.00	90.00
	TO REMOVE AND REPLACE FLOOR MAT .	NOT NECESSARY	100.00	-
	TO REMOVE AND REFIX REAR DOOR GLASS .		240.00	200.00
	TO REMOVE AND REPLACE EXHAUST PIPE .	NOT NECESSARY	160.00	-
	TO REMOVE AND REPLACE REVERSE SENSOR .		160.00	50.00
	TO REMOVE AND REFIX REAR CARPETS.	NOT NECESSARY	180.00	-
	TO REMOVE AND REPLACE SPARE PARTS AND PANEL BEATING.INCLUSIVE OF THE REPAIR OF REAR FLOOR BOARD PANEL.		2,200.00	1,100.00
	TO SPRAY PAINTING .		1,800.00	800.00
			5,270.00	2,260.00
GRAND TOTAL			24,904.03	8,022.31

Report Ref No. CC6/CTI22011026/Uya3q2



RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)			6,400.00
---	--	--	-----------------

Report Ref No. CC6/CTI22011026/Uya3q2

CHUA KANG SENG

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. GBG 684R

INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

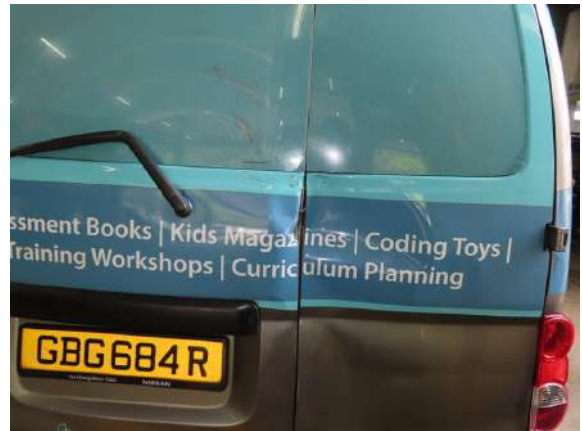



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. GBG 684R

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. GBG 684R

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

