


REF: AG/22011030/kp

ASSIGNMENT

Y: _____ Date: _____
 Post: _____
 To Inspect Vehicle No: _____
 at Workshop m/s SMART
 of _____
 Insured: _____
 Policy No. _____
 Claims No. _____
 Sum Insured: _____ Excess: _____
 (Client's Record)
 Make of Veh: _____

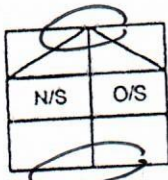

(Policy Condition)
 Remark: The veh had commenced its repair at the time of inspection.

Bal. or Market Value: _____
 IDAC Accident Rpt: _____ Consistent? : Yes or No
 GIA / PR Seen: _____ Consistent? : Yes or No
 Est. Repairs: 18 days Res.: Yes or No
 Lum Sum: 20 % 3 Val.: Yes or No
 CA / REV / REP. / 24 HRS
 Date: _____ Person Contacted: _____

Vehicle: IN / OUT

Veh No: S14D 6044T Yr Regn: 10, 15
 Type: M.Car / M.Cycle / Bus / Van / Lorry ☒ Taxi / Prime Mover /
 Truck / Trailer or _____
 Make: Toy Pro C.C. 1798
 Colour M. Brown A/C: Insured / Std / NI / NA
 Sp. Reading 464847 T/Radio: Insured / Std / NI / NA
 Eng/No: JTDKN36U605765914
 C/No: _____
 Gen. Cond: Good / Fair / Poor / Burnt
 Steering: Inorder / Jammed / Leaked / Burnt or
 Brake: Inorder / Jammed / Leaked / Burnt or
 Modl: NII / S/Rim / STD A/Rim or
 Tyre Size: F: Giti 195/65R15
 R: Pailun
 BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /
 TOYO / YOKO or

Front	Rear
R/Bal. <u>9</u> mm	R/Bal. <u>8</u> mm
L/Bal. <u>P</u> mm	L/Bal. <u>P</u> mm
D.O.A. <u>3/11/22</u>	D.O.I. <u>4/11/2022</u>

Survey held at _____
 Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or
8/15
 The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time	Action / Instruction
1	Answer for Book Value. CTA rebate @ 8157.00
	BV @ 12319.00
	★ Pending Letters Finalized. (Not in the views)
	- Saved in Calculation slip (Excel)

Date/Time, File Pass to? ☐ : Prel. Report
☐ : Final Report

Days Of Repair: _____

Resurvey No. of Trip: _____

Survey Fee: _____

Date/Time, File Return to?

1)

2)

Add Fee: ☐ : Site Insp (\$)
☐ : Interview (\$)
☐ : Tech Invs (\$)
☐ : Weekend (\$)

Transportation

\$ + RS. \$

Photos

Others

Report Format :

Lump Sum / I.B.I. (\$)

TOTAL



Case Details

Case Reference Number : TAX/11/22/2004
 Type of Repair : Accident Repair
 Vehicle Registration Number : SHD6044T

Company Type : Strides Taxi Pte Ltd
 Estimation ID : EST-19736-ID
 Assigned By : Taxi Claims Manager Team

Insurance Company Name : AIG Asia Pacific Insurance Pte Ltd
 Accident Date and Time : 03/11/2022 09:20 AM
 Vehicle Age(In Months) : -

Documents / Photographs

View Documents / Photographs

Total Documents: 0

Not Authored
7/loss, 1/Pr &
↑

Estimation Details

Spare Part's Cost Detail

SMRT Recommendation											Surveyor Approval			
BOM Type	Costing Type	Portion	Material Number	Part Name	Qty	List Price Per Unit(\$)	List Price(\$)	Dis(%)	Final Price(\$)	Repair/ Replace	Surveyor Quantity	Surveyor Final Price(\$)	Repair/Replace	Remarks
Standard	Main			BUMPER FRT	1	602.60	602.60	25.00	451.95	Replace	1	451.95	Replace	<i>Re ✓</i>
Standard	Main			CLIPS PIECE, FRT & RR BUMPER	10	4.80	48.00	25.00	36.00	Replace	10	36.00	Replace	<i>Re ✓</i>
Standard	Main			BUMPER SUPPORT F/RH	1	86.20	86.20	25.00	64.65	Replace	1	64.65	Replace	<i>Re ✓</i>
Standard	Main			BUMPER SUPPORT F/LH	1	86.20	86.20	25.00	64.65	Replace	1	64.65	Replace	<i>Re ✓</i>
Standard	Main			BUMPER ENERGY ABSORBER FRT	1	97.60	97.60	25.00	73.20	Replace	1	73.20	Replace	<i>CM ✓</i>
Standard	Main			BUMPER REINFORCEMENT FRT	1	567.90	567.90	25.00	425.92	Replace	0	0	Check	✓
Standard	Main			ARM SUB-ASSY,FR BUMPER LH	1	284.00	284.00	25.00	213.00	Replace	0	0	Not Give	✓ <i>Re</i>
Standard	Main			ARM SUB-ASSY,FR BUMPER RH	1	284.00	284.00	25.00	213.00	Replace	1	213.00	Replace	<i>Re ✓</i>
Standard	Main			DEFLECTOR, RADIATOR RH	1	94.30	94.30	25.00	70.73	Replace	1	70.72	Replace	<i>Re ✓</i>
Standard	Main			DEFLECTOR, RADIATOR LH	1	86.90	86.90	25.00	65.18	Replace	0	0	Not Give	✓ <i>Re X</i>
Standard	Main			BRACKET, FR BUMPER	1	126.10	126.10	25.00	94.57	Replace	1	94.57	Replace	<i>Re ✓</i>
Standard	Main			NUMBER PLATE FRAME	1	25.00	25.00	0.00	25.00	Replace	1	25.00	Replace	<i>Re ✓</i>
Standard	Main			NUMBER PLATE	1	35.00	35.00	0.00	35.00	Replace	1	35.00	Replace	<i>Re ✓</i>
Standard	Main			COVER, FR BUMPER HOLE LH	1	21.40	21.40	25.00	16.05	Replace	1	16.05	Replace	<i>Re ✓</i>
Standard	Main			COVER, FR BUMPER HOLE RH	1	21.40	21.40	25.00	16.05	Replace	1	16.05	Replace	<i>Re ✓</i>
Standard	Main			BUMPER GRILLE SUB-ASSY,LOWER	1	389.90	389.90	25.00	292.42	Replace	1	292.42	Replace	<i>CM ✓</i>

Total Spare Part Cost 34,740.27

Surveyor Total 13,898.62

Lump Sum Discount (%) 20.00

Lump Sum Dis (%) 20.00

Final Spare Part Cost 27,346.82

Final Sur Total 11,118.90

SMRT Recommendation											Surveyor Approval			
BOM Type	Costing Type	Portion	Material Number	Part Name	Qty	List Price Per Unit(\$)	List Price(\$)	Dis(%)	Final Price(\$)	Repair/ Replace	Surveyor Quantity	Surveyor Final Price(\$)	Repair/Replace	Remarks
Standard	Main			WIRE, ENGINE ROOM, NO.3	1	318.50	318.50	10.00	286.65	Replace	0	0	Check	
Standard	Main			THERMISTOR ASSY	1	142.30	142.30	10.00	128.07	Replace	0	0	Check	
Standard	Main			FOG LAMP RH	1	335.60	335.60	10.00	302.04	Replace	0	0	Not Give	Sn X
Standard	Main			FOG LAMP LH	1	319.30	319.30	10.00	287.37	Replace	0	0	Not Give	Sn X
Standard	Main			LENS & BODY,FR TURN LH	1	581.40	581.40	10.00	523.26	Replace	0	0	Not Give	Sn X
Standard	Main			LENS & BODY, FR TURN RH	1	581.40	581.40	10.00	523.26	Replace	0	0	Not Give	Sn X
Standard	Main			EMBLEM FRONT	1	98.70	98.70	25.00	74.03	Replace	1	74.03	Replace	Me -
Standard	Main			HOOD END PANEL SEAL	1	80.60	80.60	25.00	60.45	Replace	1	60.45	Replace	Me -
Standard	Main			COVER, RADIATOR	1	139.30	139.30	25.00	104.48	Replace	0	0	Check	
Standard	Main			GRILLE, RADIATOR	1	389.30	389.30	25.00	291.98	Replace	1	291.98	Replace	CM -
Standard	Main			GRILLE, RADIATOR LOWER NO.2	1	118.30	118.30	25.00	88.73	Replace	1	88.72	Replace	CM -
Standard	Main			BUMPER LIP FRT	1	182.70	182.70	25.00	137.02	Replace	0	0	Not Give	Sn X
Standard	Main			BUMPER FRT ABSORBER LOWER	1	159.30	159.30	25.00	119.48	Replace	0	0	Check	
Standard	Main			UNDER COVER CENTER	1	511.20	511.20	25.00	383.40	Replace	0	0	Check	
Standard	Main			UNDER COVER SIDE/LH	1	52.50	52.50	25.00	39.38	Replace	0	0	Check	
Standard	Main			UNDER COVER SIDE/RH	1	52.50	52.50	25.00	39.38	Replace	0	0	Check	
Standard	Main			HOOD PANEL	1	988.50	988.50	25.00	741.38	Replace	1	741.38	Replace	Bt -
Standard	Main			HOOD PANEL INSULATOR	1	445.00	445.00	25.00	333.75	Replace	0	0	Not Give	Sn X
Standard	Main			HOOD HINRE LH	1	63.70	63.70	25.00	47.78	Replace	1	47.78	Replace	Di -
Standard	Main			HOOD HINGE RH	1	63.70	63.70	25.00	47.78	Replace	1	47.78	Replace	Di -
Standard	Main			WIPER GARNISH	1	699.00	699.00	25.00	524.25	Replace	0	0	Not Give	Sn X
Standard	Main			WIPER GARNISH COVER,LH	1	27.30	27.30	25.00	20.48	Replace	0	0	Not Give	Sn X
Standard	Main			WIPER GARNISH COVER,RH	1	27.30	27.30	25.00	20.48	Replace	0	0	Not Give	Sn X
Standard	Main			HOOD LOCK	1	146.10	146.10	25.00	109.57	Replace	1	109.57	Replace	Bt -
Standard	Main			SUPPORT SUB-ASSY	1	1,839.70	1,839.70	25.00	1,379.78	Replace	1	1,379.78	Replace	Bt -

Total Spare Part Cost 34,740.27

Surveyor Total 13,898.62

Lump Sum Discount (%) 20.00

Lump Sum Dis (%) 20.00

Final Spare Part Cost 27,346.82

Final Sur Total 11,118.90

SMRT Recommendation											Surveyor Approval			
BOM Type	Costing Type	Portion	Material Number	Part Name	Qty	List Price Per Unit(\$)	List Price(\$)	Dis(%)	Final Price(\$)	Repair/ Replace	Surveyor Quantity	Surveyor Final Price(\$)	Repair/Replace	Remarks
Standard	Main			HEAD LAMP LH	1	1,075.40	1,075.40	10.00	967.86	Replace	1	967.86	Replace	my CMA ✓
Standard	Main			HEAD LAMP RH	1	1,075.40	1,075.40	10.00	967.86	Replace	1	967.86	Replace	CMA ✓
Standard	Main			A/C CONDENSER	1	1,695.90	1,695.90	25.00	1,271.93	Replace	0	0	Check	✓
Standard	Main			TUBE & ACCESSORY	1	830.50	830.50	25.00	622.88	Replace	0	0	Check	✓
Standard	Main			HOSE SUB-ASSY DISCHARGE	1	509.80	509.80	25.00	382.35	Replace	0	0	Check	✓
Standard	Main			HOSE SUB-ASSY SUCTION	1	534.40	534.40	25.00	400.80	Replace	0	0	Check	✓
Standard	Main			RADIATOR ASSY UPPER	1	888.20	888.20	25.00	666.15	Replace	0	0	Check	✓
Standard	Main			RADIATOR ASSY	1	2,245.70	2,245.70	25.00	1,684.27	Replace	0	0	Check	✓
Standard	Main			HOSE, INVERTER NO.1	1	104.70	104.70	25.00	78.53	Replace	0	0	Check	✓
Standard	Main			HOSE, INVERTER COOLING NO.5	1	164.70	164.70	25.00	123.52	Replace	0	0	Check	✓
Standard	Main			COOLANT	4	12.32	49.28	0.00	49.28	Replace	4	49.28	Replace	✓
Standard	Main			SUPPORT RADIATOR, LH	1	23.40	23.40	25.00	17.55	Replace	0	0	Check	✓
Standard	Main			SUPPORT RADIATOR, RH	1	72.00	72.00	25.00	54.00	Replace	0	0	Check	✓
Standard	Main			SUPPORT, RADIATOR (2 PCS)	2	24.80	49.60	25.00	37.20	Replace	0	0	Check	✓
Standard	Main			RADIATOR LOWER SUPPORT	1	1,004.70	1,004.70	25.00	753.53	Replace	1	0	Repair	✓
Standard	Main			RADIATOR HOSE LOWER	1	56.00	56.00	25.00	42.00	Replace	0	0	Check	✓
Standard	Main			RADIATOR TOP HOSE NO 1	1	56.00	56.00	25.00	42.00	Replace	0	0	Check	✓
Standard	Main			FAN SHROUD	1	321.40	321.40	25.00	241.05	Replace	0	0	Check	✓
Standard	Main			FAN SHROUD TOP	1	131.50	131.50	25.00	98.63	Replace	0	0	Check	✓
Standard	Main			FAN BLADE	1	236.90	236.90	25.00	177.68	Replace	0	0	Check	✓
Standard	Main			FAN BLADE NO.2	1	305.50	305.50	25.00	229.13	Replace	0	0	Check	✓
Standard	Main			FAN MOTOR NO.1	1	708.40	708.40	10.00	637.56	Replace	0	0	Check	✓
Standard	Main			FAN MOTOR NO.2	1	708.40	708.40	10.00	637.56	Replace	0	0	Check	✓
Standard	Main			COVER CYLINDER	1	218.10	218.10	25.00	163.58	Replace	0	0	Not Give	✓
Standard	Main			FENDER FRT/RH	1	916.30	916.30	25.00	687.22	Replace	1	687.22	Replace	✓

Total Spare Part Cost 34,740.27

Surveyor Total 13,898.62

Lump Sum Discount (%) 20.00

Lump Sum Dis (%) 20.00

Final Spare Part Cost 27,346.82

Final Sur Total 11,118.90

SMRT Recommendation												Surveyor Approval			Remarks
BOM Type	Costing Type	Portion	Material Number	Part Name	Qty	List Price Per Unit(\$)	List Price(\$)	Dis(%)	Final Price(\$)	Repair/ Replace	Surveyor Quantity	Surveyor Final Price(\$)	Repair/Replace		
Standard	Main			NAME PLATE (HYBRID)	1	59.20	59.20	25.00	44.40	Replace	1	44.40	Replace	✓	✓
Standard	Main			FENDER LINER FRT/RH	1	195.40	195.40	25.00	146.55	Replace	0	0	Not Give	✓	
Standard	Main			FENDER FRT/LH	1	916.30	916.30	25.00	687.22	Replace	1	0	Repair	✓	
Standard	Main			NAME PLATE (HYBRID)	1	59.20	59.20	25.00	44.40	Replace	1	44.40	Replace	✓	✓
Standard	Main			FENDER LINER FRT/LH	1	195.40	195.40	25.00	146.55	Replace	0	0	Not Give	✓	
Standard	Main			BUMPER REAR	1	478.90	478.90	25.00	359.17	Replace	1	359.17	Replace	✓	✓
Standard	Main			BUMPER CLIPS (10 PCS)	10	2.40	24.00	25.00	18.00	Replace	10	18.00	Replace	✓	✓
Standard	Main			BUMPER REINFORCEMENT REAR	1	234.70	234.70	25.00	176.02	Replace	1	176.02	Replace	✓	?
Standard	Main			ARM SUB-ASSY. RR BUMPER RH	1	157.90	157.90	25.00	118.43	Replace	1	118.43	Replace	✓	?
Standard	Main			ARM SUB-ASSY. RR BUMPER LH	1	157.90	157.90	25.00	118.43	Replace	1	118.43	Replace	✓	?
Standard	Main			ANTENNA,ELECTRICAL LOWER REAR	1	208.10	208.10	10.00	187.29	Replace	0	0	Check	✓	
Standard	Main			SENSOR REVERSE	1	180.00	180.00	0.00	180.00	Replace	1	180.00	Replace	✓	✓
Standard	Main			BUMPER SIDE RETAINER RR/LH	1	108.70	108.70	25.00	81.53	Replace	1	81.53	Replace	✓	✓
Standard	Main			BUMPER SIDE RETAINER RR/RH	1	108.70	108.70	25.00	81.53	Replace	1	81.53	Replace	✓	✓
Standard	Main			BUMPER SEAL, RR LH	1	101.80	101.80	25.00	76.35	Replace	0	0	Not Give	✓	X
Standard	Main			BUMPER SEAL, RR RH	1	74.40	74.40	25.00	55.80	Replace	1	55.80	Replace	✓	✓
Standard	Main			BUMPER LIP COVER RR/LH	1	93.90	93.90	25.00	70.43	Replace	1	70.43	Replace	✓	X
Standard	Main			BUMPER LIP COVER RR/RH	1	155.40	155.40	25.00	116.55	Replace	1	116.55	Replace	✓	
Standard	Main			BUMPER LIP REAR	1	301.90	301.90	25.00	226.42	Replace	1	226.42	Replace	✓	✓
Standard	Main			UNDER COVER SUB-ASSY, RR FLOOR	1	586.10	586.10	25.00	439.58	Replace	1	439.58	Replace	✓	✓
Standard	Main			UNDER COVER RR SHIELD	1	66.10	66.10	25.00	49.57	Replace	0	0	Check	✓	
Standard	Main			END PANEL	1	755.10	755.10	25.00	566.33	Replace	1	566.33	Replace	✓	✓
Standard	Main			END PANEL COVER, DECK TRIM HOLE	1	52.60	52.60	25.00	39.45	Replace	1	39.45	Replace	✓	✓
Standard	Main			END PANEL COVER, DECK TRIM, RR	1	137.30	137.30	25.00	102.98	Replace	1	102.98	Replace	✓	✓
Standard	Main			SEALANT SIKAFLEX	1	37.00	37.00	0.00	37.00	Replace	1	37.00	Replace	✓	✓
Total Spare Part Cost									34,740.27	Surveyor Total			13,898.62		
Lump Sum Discount (%)									20.00	Lump Sum Dis (%)			20.00		
Final Spare Part Cost									27,346.82	Final Sur Total			11,118.90		

SMRT Recommendation											Surveyor Approval			
BOM Type	Costing Type	Portion	Material Number	Part Name	Qty	List Price Per Unit(\$)	List Price(\$)	Dis(%)	Final Price(\$)	Repair/ Replace	Surveyor Quantity	Surveyor Final Price(\$)	Repair/Replace	Remarks
Standard	Main			MEMBER SUB-ASSY, RR RH	1	229.70	229.70	25.00	172.27	Replace	1	0	Repair	▼
Standard	Main			BATTERY	1	278.00	278.00	0.00	278.00	Replace	0	0	Check	▼
Standard	Main			TAILGATE ASY	1	1,260.70	1,260.70	25.00	945.53	Replace	1	945.53	Replace	▼ By —
Standard	Main			TAILGATE DOOR GLASS MOULDING, RH	1	33.60	33.60	25.00	25.20	Replace	1	25.20	Replace	▼ Mc —
Standard	Main			TAILGATE DOOR GLASS MOULDING, RH	1	33.60	33.60	25.00	25.20	Replace	1	25.20	Replace	▼ Mc —
Standard	Main			TAILGATE DOOR GLASS	1	1,273.10	1,273.10	25.00	954.82	Replace	0	0	Not Give	▼
Standard	Main			MOULDING BACK WINDOW, LOWER NO.1	1	33.60	33.60	25.00	25.20	Replace	1	25.20	Replace	▼
Standard	Main			MOULDING, BACK WINDOW, LOWER NO.2	1	33.60	33.60	25.00	25.20	Replace	1	25.20	Replace	▼ Mc —
Standard	Main			TAILGATE LOWER WINDOW GLASS	1	827.50	827.50	25.00	620.63	Replace	0	0	Not Give	▼
Standard	Main			TAIL GATE DAM, BACK DOOR GLASS UPPER ADHESIVE	1	31.30	31.30	25.00	23.48	Replace	1	23.48	Replace	▼ Mc —
Standard	Main			DAM, BACK DOOR GLASS ADHESIVE, NO.2	1	22.30	22.30	25.00	16.73	Replace	1	16.73	Replace	▼
Standard	Main			TROUGH, BACK DOOR	1	126.80	126.80	25.00	95.10	Replace	1	95.10	Replace	▼ Mc —
Standard	Main			SEALANT W/SCREEN (3PCS)	3	37.00	111.00	0.00	111.00	Replace	3	111.00	Replace	▼ Mc —
Standard	Main			TAILGATE DOOR HINGE LH/RH (2 PCS)	2	61.20	122.40	25.00	91.80	Replace	2	0	Repair	▼
Standard	Main			TAILGATE DOOR STAY LH	1	253.40	253.40	25.00	190.05	Replace	0	0	Not Give	▼
Standard	Main			TAILGATE DOOR STAY RH	1	253.40	253.40	25.00	190.05	Replace	0	0	Not Give	▼
Standard	Main			TAILGATE DOOR LOCK	1	631.90	631.90	10.00	568.71	Replace	1	568.71	Replace	▼ Dis —
Standard	Main			TAILGATE LOCK, COVER	1	20.70	20.70	25.00	15.52	Replace	1	15.52	Replace	▼ R X
Standard	Main			STRIKER, BACK DOOR	1	55.80	55.80	25.00	41.85	Replace	0	0	Check	▼
Standard	Main			TAILGATE DOOR WEATHER STRIP	1	402.50	402.50	25.00	301.88	Replace	1	301.88	Replace	▼
Standard	Main			TAILGATE TRIM, LOWER	1	205.40	205.40	25.00	154.05	Replace	0	0	Check	▼
Standard	Main			TAILGATE OUTSIDE GARNISH	1	574.80	574.80	25.00	431.10	Replace	0	0	Not Give	▼
Standard	Main			EMBLEM REAR	1	68.70	68.70	25.00	51.53	Replace	0	0	Not Give	▼
Standard	Main			NAME PLATE (HYBRID)	1	59.20	59.20	25.00	44.40	Replace	1	44.40	Replace	▼ Mc —
Standard	Main			NAME PLATE (PRUIS)	1	69.40	69.40	25.00	52.05	Replace	0	0	Not Give	▼
Total Spare Part Cost									34,740.27	Surveyor Total		13,898.62		
Lump Sum Discount (%)									20.00	Lump Sum Dis (%)		20.00		
Final Spare Part Cost									27,346.82	Final Sur Total		11,118.90		

SMRT Recommendation											Surveyor Approval				Remarks
BOM Type	Costing Type	Portion	Material Number	Part Name	Qty	List Price Per Unit(\$)	List Price(\$)	Dis(%)	Final Price(\$)	Repair/ Replace	Surveyor Quantity	Surveyor Final Price(\$)	Repair/Replace		
Standard	Main			NAME PLATE (TOYOTA)	1	59.20	59.20	25.00	44.40	Replace	0	0 <i>na</i>	Not Give	✓	
Standard	Main			STRIDES LOGO	1	7.80	7.80	0.00	7.80	Replace	0	0 <i>na</i>	Not Give	✓	
Standard	Main			STICKER DECAL 65558888	1	21.60	21.60	0.00	21.60	Replace	0	0 <i>na</i>	Not Give	✓	
One Time Key In	Main			DOOR RR/RH	1	1,213.70	1,213.70	25.00	910.28	Replace	0	0 <i>na</i>	Not Give	✓	
One Time Key In	Main			FENDER RR/RH	1	980.80	980.80	25.00	735.60	Replace	1 <i>Bu</i>	735.60	Replace	✓	
One Time Key In	Main			STRIDES LOGO	1	7.80	7.80	0.00	7.80	Replace	1 <i>na</i>	7.80	Replace	✓	
One Time Key In	Main			STICKER DECAL 65558888	1	21.60	21.60	0.00	21.60	Replace	1 <i>na</i>	21.60	Replace	✓	
One Time Key In	Main			QUARTER GLASS RR/RH	1	556.70	556.70	25.00	417.53	Replace	1 <i>Repair Access</i>	417.53	Replace	✓	
One Time Key In	Main			SEALANT W/SCREEN	1	37.00	37.00	0.00	37.00	Replace	1	37.00	Replace	✓ <i>na</i>	
Standard	Main			FENDER LINE RR/RH	1	159.80	159.80	25.00	119.85	Replace	0	0	Not Give	✓	
Standard	Main			TAIL LAMP BRACKET, RH	1	35.20	35.20	25.00	26.40	Replace	1	26.40	Replace	✓ <i>cm</i>	
Standard	Main			TAIL LAMP RH	1	618.60	618.60	10.00	556.74	Replace	1	556.74	Replace	✓ <i>cm</i>	
Standard	Main			FENDER RR/LH	1	980.80	980.80	25.00	735.60	Replace	1	0	Repair	✓	
Standard	Main			STRIDES LOGO	1	7.80	7.80	0.00	7.80	Replace	1	7.80	Replace	✓ <i>na</i>	
Standard	Main			STICKER DECAL 65558888	1	21.60	21.60	0.00	21.60	Replace	1	21.60	Replace	✓ <i>na</i>	
Standard	Main			FENDER LINER R/LH	1	159.80	159.80	25.00	119.85	Replace	0	0	Not Give	✓	
Standard	Main			TAIL LAMP BRACKET, LH	1	35.20	35.20	25.00	26.40	Replace	0	0	Not Give	✓	
Standard	Main			TAIL LAMP LH	1	618.60	618.60	10.00	556.74	Replace	0	0	Not Give	✓	
One Time Key In	Main			EXHAUST TAIL PIPE	1	855.10	855.10	25.00	641.33	Replace	0	0	Check	✓	
One Time Key In	Main			SUPPORT EXHAUST PIPE, NO.4 (2 PCS)	2	53.20	106.40	25.00	79.80	Replace	0	0	Check	✓	
One Time Key In	Main			SUPPORT, EXHAUST REAR (2 PCS)	2	44.40	88.80	25.00	66.60	Replace	0	0	Check	✓	
One Time Key In	Main			BATTERY CLAMP	1	21.40	21.40	25.00	16.05	Replace	0	0	Check	✓	
Total Spare Part Cost									34,740.27	Surveyor Total			13,898.62		
Lump Sum Discount (%)									20.00	Lump Sum Dis (%)			20.00		
Final Spare Part Cost									27,346.82	Final Sur Total			11,118.90		

SMRT Recommendation											Surveyor Approval			Remarks
BOM Type	Costing Type	Portion	Material Number	Part Name	Qty	List Price Per Unit(\$)	List Price(\$)	Dis(%)	Final Price(\$)	Repair/ Replace	Surveyor Quantity	Surveyor Final Price(\$)	Repair/Replace	
One Time Key In	Main			BATTERY TRAY	1	56.80	56.80	25.00	42.60	Replace	0	0	Check	✓
One Time Key In	Main			EXHAUST HEAT SHIELD, REAR	1	123.00	123.00	25.00	92.25	Replace	0	0	Check	✓
Total Spare Part Cost									34,740.27	Surveyor Total		13,898.62		
Lump Sum Discount (%)									20.00	Lump Sum Dis (%)		20.00		
Final Spare Part Cost									27,346.82	Final Sur Total		11,118.90		

Labour's Cost Detail

S.No.	Costing Type	Job Scope	SMRT Recommendation(\$)	Surveyor Adjustment(\$)	Remarks
1	Main	TO REPAIR FRONT PORTION	1,014.00	600	
2	Main	TO REPAIR REAR PORTION	2,028.00	1,600	
Total:			3,042.00	2,200.00	

Spray Cost Detail

S.No.	Costing Type	Job Scope	SMRT Recommendation(\$)	Surveyor Adjustment(\$)	Remarks
1	Main	TO RESPRAY FRONT BUMPER	378.00	200	
2	Main	TO RESPRAY FRONT HOOD	378.00	200	
3	Main	TO RESPRAY FRONT SUPPORT PANEL	180.00	150	
4	Main	TO RESPRAY FRONT FENDER RH	378.00	200	
5	Main	TO RESPRAY FRONT FENDER LH	378.00	200	
6	Main	TO RESPRAY REAR BUMPER	378.00	200	
7	Main	TO RESPRAY FLOOR CORNER PANEL RH	180.00	100	
8	Main	TO RESPRAY REAR PANEL	180.00	150	
9	Main	TO RESPRAY REAR FLOOR SIDE PANEL RH	180.00	0	
10	Main	TO RESPRAY REAR SPARE TYRE PANEL	180.00	150	
11	Main	TO RESPRAY TAILGATE OUTSIDE GARNISH	180.00	0	
12	Main	TO RESPRAY TAIL GATE	378.00	200	
Total:			4,482.00	2,150.00	

S.No.	Costing Type	Job Scope	SMRT Recommendation(\$)	Surveyor Adjustment(\$)	Remarks
13	Main	TO RESPRAY REAR FENDER RH	378.00	200	
14	Main	TO RESPRAY REAR FENDER LH	378.00	200	
15	Main	TO RESPRAY RH REAR DOOR	378.00	0	
Total:			4,482.00	2,150.00	

Other Cost Detail

S.No.	Costing Type	Job Scope	SMRT Recommendation(\$)	Surveyor Adjustment(\$)	Remarks
1	Main	TOWING CHARGE	56.00	56	
2	Main	TO CHECK WIRING AND SYSTEM FUNCTION	120.00	40	
3	Main	TO APPLY RUST-PROOFING ON AFFECTED AREA	200.00	120	
4	Main	TO TOP UP A/C GAS	120.00	100	
5	Main	TO ALIGN CHASSIS	350.00	250	
6	Main	TO TRANSFER REAR TAILGATE MECHANISM	120.00	60	
7	Main	TO TEST AND REFIX REVERSE SENSOR SYSTEM	120.00	50	
8	Main	TO REMOVE AND REFIX REAR WINDSCREEN	240.00	180	
9	Main	TO REMOVE & REFIT REAR QUARTER GLASS RH	120.00	60	
10	Main	TO WASH AND VACUUM	60.00	0	
11	Main	TO REPLACE SUNDRY PARTS	100.00	30	
12	Main	TO CONDUCT RADIATOR PRESSURE CHECK	120.00	50	
Total:			1,726.00	996.00	

Summary

	Estimator Assesment(\$)	Surveyor Assesment(\$)
Total Spare Part Detail	27,346.82	11,118.90
Total Labour Cost	3,042.00	2,200.00
Total Spray Painting	4,482.00	2,150.00
Other	1,726.00	996.00
Overall Total	36,596.82	16,464.90

Estimator Assessment(\$)		Surveyor Assessment(\$)
Lump Sum Repair Option	☐	☒
Lump Sum Total	36,600.00	16,450.00
Surveyor Approved Amount		16,450.00
No of Repair Days*	18	18
Remarks	-	REQ NBV , LUPMSUM REPAIR , AFTER PAINT PHOTOS, FOR CHECK ITEM and REPLACE ITEM PLEASE CALL SURVEYOR Kenneth Kong (LKK) HP: 9801 0882 /
Surveyor Name		Kenneth Kong (LKK)
Signature		
Survey Date	04/11/2022	Save Clear

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date: