



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

LONPAC INSURANCE BHD
300 BEACH ROAD
#17-04/07 THE CONCOURSE
SINGAPORE 199555

INV No. AC2302159
INV Date 09/04/2023
Reference CC4/LPC22011038/Aya3q2
Code LPC2

PROFESSIONAL SERVICE FEE

Vehicle No. SLT 5753E
Insured Veh. GBJ 2925S
Claim No. 22/22/22/VC05/026511
Policy No. Z22VC05010505
Accident Date 02/11/2022
Inspection Date 21/11/2022

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (8%)	32.00
Grand Total	432.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile

LONPAC INSURANCE BHD

300 BEACH ROAD

#17-04/07 THE CONCOURSESINGAPORE 199555

Ref: CC4/LPC22011038/Aya3q2

Date: 09/04/2023

Code: LPC2

1. Policy Particulars :- THIRD PARTY CLAIM

Insured Veh.	GBJ 2925S	Veh. Inspected	SLT 5753E
Policy No.	Z22VC05010505	Coverage (\$)	0.00
Claim No.	22/22/22/VC05/026511	Excess (\$)	0.00
Assign From	GERALD	Assign Date	04/11/2022

2. Vehicle Particulars & Condition

Make & Model	HONDA HRV	c.c	1496
Engine No.	HIDDEN	Year of Reg.	2017
Chassis No.	JHMRU1810GX203280	Colour	GOLD
Odometer	104052 KM	Steering	IN ORDER
Brakes	IN ORDER	Modification	SPORTS RIM
General	GOOD		

3. Conditions of Tyres

	Size	Make	Balance
R/H Front Tyre	215/60 R16	DUNLOP	6 mm
L/H Front Tyre	215/60 R16	DUNLOP	6 mm
R/H Rear Tyre	215/60 R16	DUNLOP	6 mm
L/H Rear Tyre	215/60 R16	DUNLOP	6 mm

4. Description of Damages

THE VEHICLE SUSTAINED DAMAGES AT THE O/S BODY.

DAMAGES SEE DETAILS.

5. General Information

Accident Date	02/11/2022	Inspection Date	21/11/2022
Survey held at	HD PERFECT AUTOWORK PTE LTD 8 KAKI BUKIT AVENUE 4, #08-09, PREMIER @ KAKI BUKIT, SINGAPORE 415875		

5a. Remarks

A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS.
B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.

5b. Estimate Days of Repair

ESTIMATED NORMAL PERIOD FOR REPAIR:	4 Working Days
-------------------------------------	-----------------------



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SLT 5753E

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
<u>REPLACEMENT OF PARTS</u>				
1	SIDE SKIRT RH	TORN	435.00	435.00
1	REAR DOOR RH	DENTED	1,135.00	985.00
2	REAR DOOR HINGE RH @\$55.00	NOT NECESSARY	110.00	-
1	REAR DOOR INNER LOCK RH	DAMAGED	285.00	285.00
1	REAR DOOR LOCK CATCHER RH	NOT NECESSARY	25.00	-
1	REAR DOOR INNER TRIM RH	NOT NECESSARY	725.00	-
1	REAR DOOR WEATHER STRIP RH	CUT	145.00	145.00
1	REAR DOOR POWER WINDOW MOTOR C/W REGULATOR RH	NOT NECESSARY	490.00	-
1	REAR DOOR OUTER STRIP RH	NOT NECESSARY	110.00	-
1	REAR DOOR STICKER (BLACK) RH	NECESSARY	105.00	105.00
1	REAR DOOR FRAME WEATHER STRIP RH	NOT NECESSARY	170.00	-
1	REAR FENDER RH	TO REPAIR SEE LABOUR	1,120.00	-
1	REAR FENDER COWLING RH	NOT NECESSARY	150.20	-
1	REAR FENDER ARCED GARNISH RH	DEFORMED	184.70	184.70
1	REAR ABS SENSOR RH	NOT NECESSARY	430.00	-
1	REAR AXLE	NOT NECESSARY	1,670.00	-
1	REAR SHOCK ABSORBER RH	NOT NECESSARY	398.00	-
1	REAR WHEEL HUP COME WITH BEARING RH	NOT NECESSARY	435.00	-
	LESS 20% DISCOUNT		-1,624.58	-427.94
			6,498.32	1,711.76
1	REAR WHEEL RIM RH (SN)	CUT	1,450.00	600.00
	LESS 20% DISCOUNT		-290.00	-
			1,160.00	600.00
<u>SPECIAL NETT ITEMS</u>				
1	SIDE SKIRT CLIP RH (SN)	NECESSARY	80.00	30.00
1	SET REAR BUMPER CLIP RH (SN)	NOT NECESSARY	80.00	-
1	SET TAIL LAMP CLIP (SN)	NOT NECESSARY	60.00	-
1	SET REAR DOOR INNER TRIM CLIP RH (SN)	NOT NECESSARY	80.00	-

Report Ref No. CC4/LPC22011038/Aya3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	SET REAR FENDER COWLING CLIP (SN)	NOT NECESSARY	80.00	-
1	SET REAR FENDER ARCED GARNISH CLIP RH (SN)	NECESSARY	80.00	20.00
1	SET REAR FENDER INNER TRIM CLIP RH (SN)	NOT NECESSARY	80.00	-
1	REAR WHEEL TYRE RH (SN)	NOT NECESSARY	450.00	-
1	BRAKE OIL (SN)	NOT NECESSARY	40.00	-
			1,030.00	50.00
	LABOUR			
	PANEL BEATING, REMOVAL AND REPLACING PARTS. INCLUSIVE OF THE REPAIR OF REAR FENDER RH. TO SPRAY PAINT AFFECTED AREA.		1,400.00	500.00
	TUFF COAT.		1,000.00	400.00
	WIRING CHECK.		250.00	60.00
	REMOVE AND REFIX CUSHION SEAT/UPHOLSTRY AND ROOF LINNING TO FACILITATE REPAIR.		120.00	30.00
	REMOVE AND REFIX REVERSE SENSOR AND DISTANCE SETTING.	NOT NECESSARY	350.00	60.00
	TRANSFER REAR DOOR MECHANISM RH.		80.00	-
	REMOVE AND REFIX REAR UNDERCARRIAGE.	NOT NECESSARY	80.00	60.00
	FOUR WHEEL ALIGNMENT.	NOT NECESSARY	650.00	-
	TO CHECK DIAGNOSTICS OF VEHICLE MANAGEMENT/CONTROL UNITS,RESET MEMORIES TO SPECIFICATION ETC.	NOT NECESSARY	120.00	-
		NOT NECESSARY	180.00	-
			4,230.00	1,110.00
GRAND TOTAL			12,918.32	3,471.76
RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)				2,750.00

Report Ref No. CC4/LPC22011038/Aya3q2

ADRIAN LING WAI PING

B.Eng,AMSOE,AMIRTE,AMSAE-A,M.MATAI

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd




51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SLT 5753E

INSPECTION

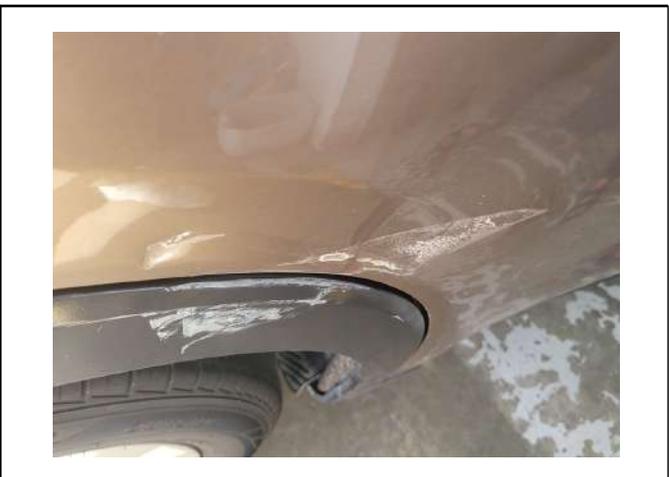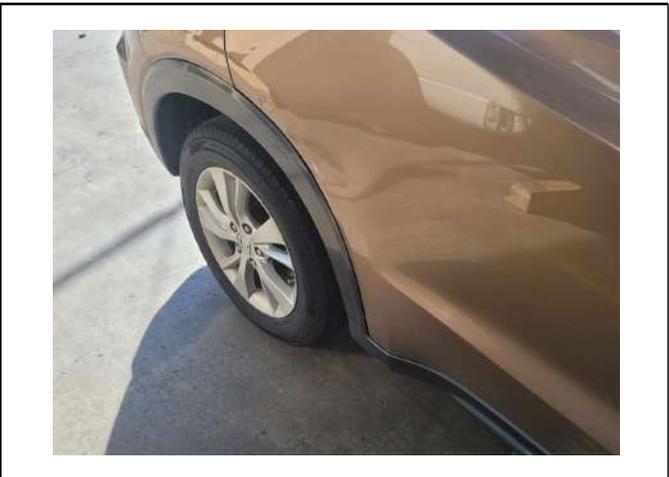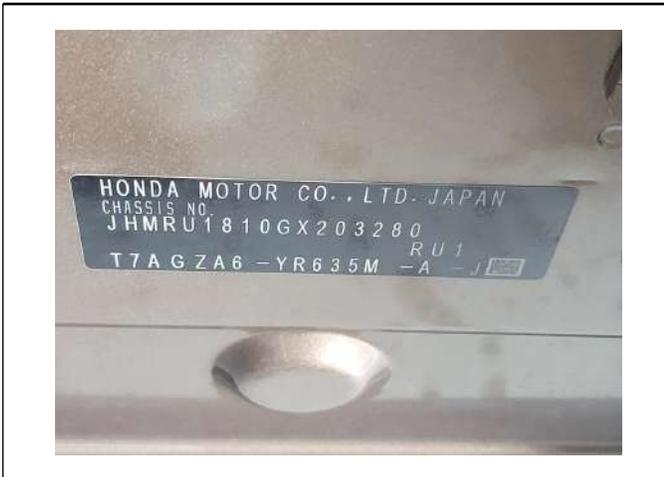



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd







51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SLT 5753E

RE-INSPECTION

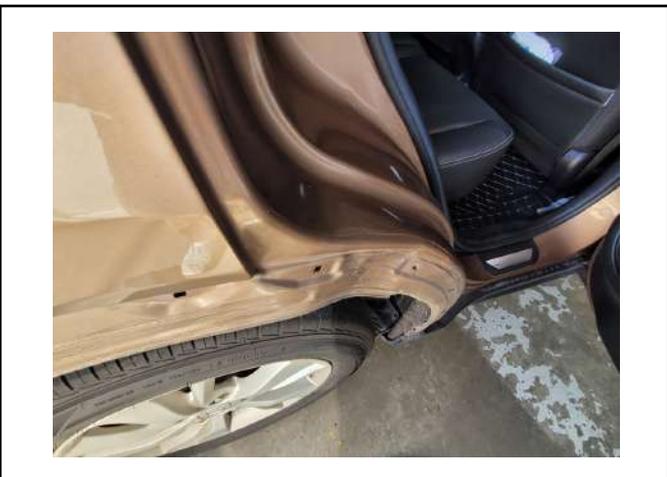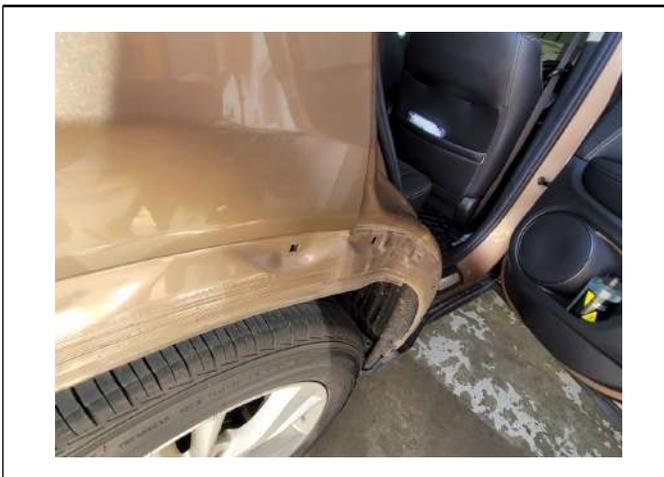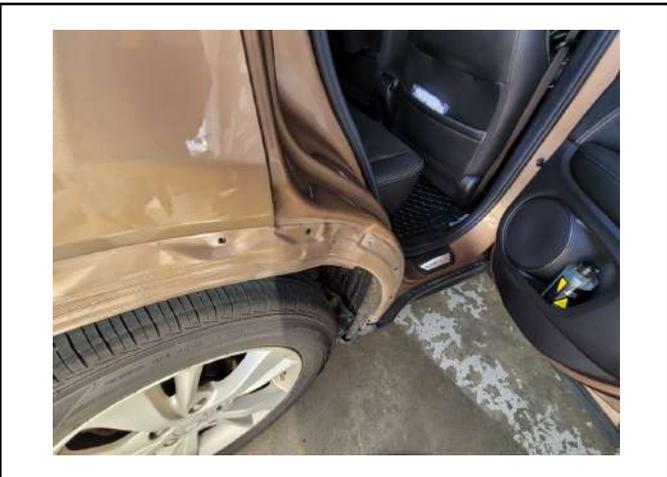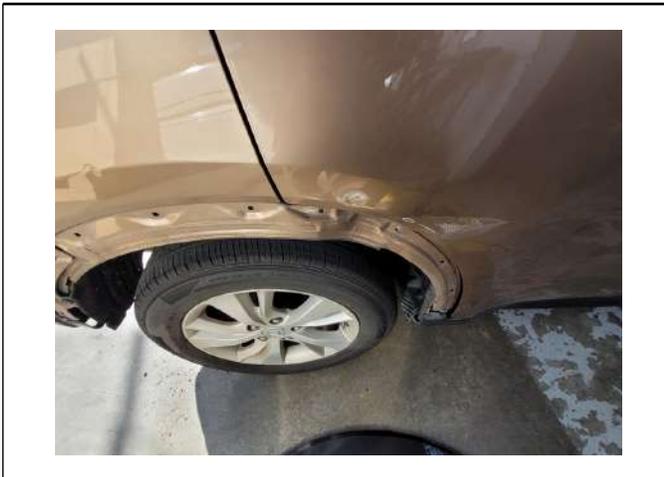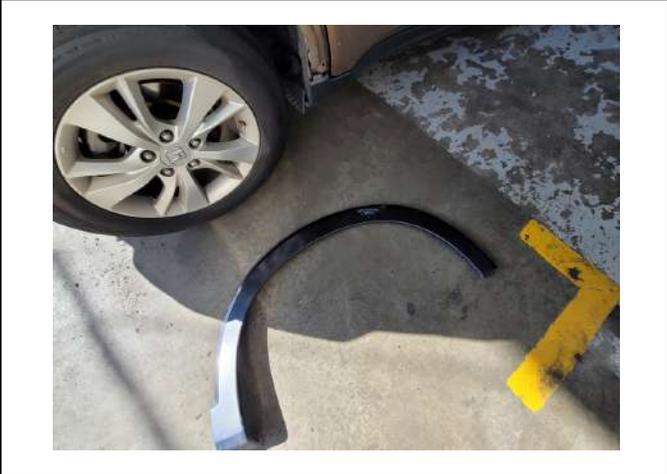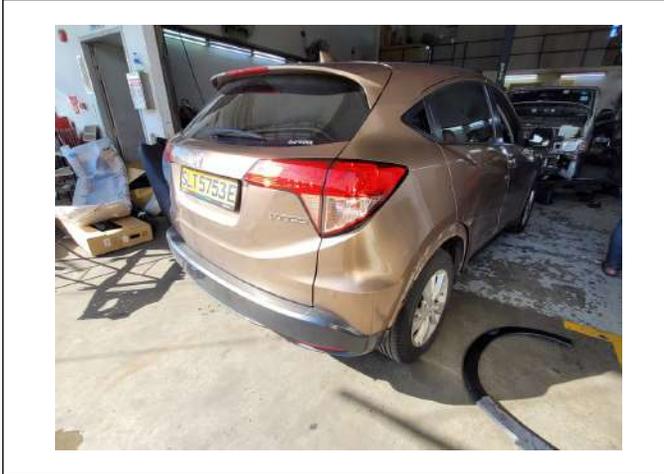



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

