

**Auto Insure Pte. Ltd**  
**6 Marsiling Lane**  
**739145**



**Insurer Reference: SLZ1870U**  
**Repairer Reference: M6746/SLZ1870U**  
**Date calculated: 11/11/2022 9:30 AM**

**Full Report**  
**Registration: SLZ1870U**  
**Printed: 11/11/2022 9:30 AM**

### Summary Information

---

**Claim**

|                        |                |                   |                                                |
|------------------------|----------------|-------------------|------------------------------------------------|
| Location:              | Singapore (SG) | Work Provider:    | China Taiping Insurance<br>(Singapore) Pte Ltd |
| Printed by:            | Marvyn Chua    | Currency:         | SGD                                            |
| Claim Reference:       | SLZ1870U       | Date of Incident: | 07/11/22                                       |
| Estimated Repair Time: | 5              | Hire Car Start:   |                                                |
| Actual Repair Days:    | 5              | Hire Car End:     |                                                |

### Vehicle Details

---

**Vehicle**

|                     |                   |
|---------------------|-------------------|
| Manufacturer:       | MAZDA             |
| Model:              | 6 (GL)            |
| Sub Model:          | BASE MODEL        |
| Model Sheet Number: | 36 M6 01          |
| Registration:       | SLZ1870U          |
| VIN number:         | JM6GL1071J0146059 |
| Odometer:           |                   |

**Model Specs**

|              |               |                   |                     |
|--------------|---------------|-------------------|---------------------|
| FROM 03.2018 | LED FOG LAMPS | TWO COAT METALLIC | PREPARE OFF VEHICLE |
|--------------|---------------|-------------------|---------------------|

## Vehicle Condition


### Vehicle Status

Pre-Accident Damage:

Date of Inspection:

### Damage Areas

All ☐  
Underbody ☐

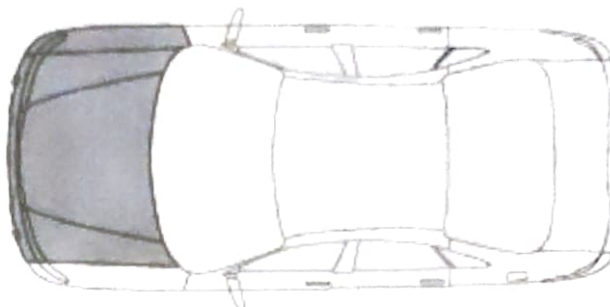

### Tyres Condition

| Tyre Brand | Tread (Left Middle), mm | Tread (Left Outer), mm | Tread (Left Inner), mm | Tread (Right Inner), mm | Tread (Right Outer), mm | Tread (Right Middle), mm | Condition |
|------------|-------------------------|------------------------|------------------------|-------------------------|-------------------------|--------------------------|-----------|
|------------|-------------------------|------------------------|------------------------|-------------------------|-------------------------|--------------------------|-----------|

| Spare Tyre Brand | Tread (Spare), mm |
|------------------|-------------------|
|------------------|-------------------|

### Labour

| Code        | Description                                                 | Time Base 10 WU/h | Price = 42.00 SGD/h |           |
|-------------|-------------------------------------------------------------|-------------------|---------------------|-----------|
|             |                                                             |                   | WU                  | Price SGD |
| A0109A-A-X  | ALIGN FRONT TOE                                             |                   | 6.0                 | 25.20     |
| S0201S-R-X  | RENEW FRONT BUMPER                                          |                   | 9.0                 | 37.80     |
|             | INCLUDES: R + R BUMPER AND NECESSARY ATTACHED PARTS         |                   |                     |           |
| S0503E-R-X  | RENEW BONNET                                                |                   | 9.0                 | 37.80     |
|             | INCLUDES: R + R BONNET AND REQUIRED ATTACHED PARTS ASSEMBLE |                   |                     |           |
| S1601X-R-X) | R + R FRONT WASHER RESERVOIR/PUMP                           |                   | 1.0                 | 4.20      |
| S0201X-R-X) | R + R FRONT BUMPER SUPPORT                                  |                   | 10.0                | 42.00     |
| NO NUMBER   | R + R LOCK SUPPORT COVER                                    |                   | 1.0                 | 4.20      |
| S0204B-R-X) | RENEW RADIATOR GRILLE                                       |                   | 10.0                | 42.00     |
| S0504B-R-X) | R + R L/BONNET SEAL                                         |                   | 1.0                 | 4.20      |
| S0504A-R-X) | R + R R/BONNET HINGE                                        |                   | 1.0                 | 4.20      |
| S0601A-R-X) | RENEW R/F WING                                              |                   | 3.0                 | 12.60     |
|             | INCLUDES: WING, WHEELHOUSE AND HEADLAMP REMOVE + REFIT      |                   |                     |           |
|             | NOT INCLUDED : FRONT BUMPER R + R ADJUST HEADLAMPS          |                   |                     |           |

| Code               | Description                           | WU               | Price SGD       |
|--------------------|---------------------------------------|------------------|-----------------|
| NO NUMBER          | RENEW RIGHT FRONT WHEEL HOUSE BRACKET | 5.0              | 21.00           |
| NO NUMBER          | DETACH + REFIT EXHAUST                | 3.0              | 12.60           |
| N0201E-R-X)        | R + R STEERING BOX                    | 3.0              | 12.60           |
| N0206H-R-X)        | R + R R/STEERING SHAFT                | 2.0              | 8.40            |
| NO NUMBER          | R + R FRONT AXLE MEMBER               | 7.0              | 29.40           |
| R0402A-R-X         | R + R R/F STABILIZER CONNECTING ROD   | 3.0              | 12.60           |
| M0201A-R-X)        | R + R R/F STEERING KNUCKLE            | 5.0              | 21.00           |
| R0106A-R-X)        | R + R R/F CONTROL ARM REAR            | 3.0              | 12.60           |
| NO NUMBER          | DETACH + REFIT R/FR BRAKE CALIPER     | 1.0              | 4.20            |
| Q0105A-R-X)        | R + R WHEEL/S (ADD/WORK)              | 1.0              | 4.20            |
| Q0105A-R-X)        | R + R L/F WHEEL                       | 1.0              | 4.20            |
| Q0105A-R-X)        | R + R R/F WHEEL                       | 1.0              | 4.20            |
| 1118               | R/F WHEELHOUSE REPAIR                 | 20.0*            | 84.00           |
| 1482               | RIGHT FRONT DOOR REPAIR               | 15.0*            | 63.00           |
| <b>Labour Cost</b> |                                       |                  |                 |
|                    | <b>Panel / Mechanical Labour</b>      | <b>Hrs 11.50</b> | <b>WU 115.0</b> |
|                    | <b>Alignment</b>                      |                  |                 |
|                    | <b>Measuring Work</b>                 | <b>0.60</b>      | <b>6.0</b>      |
|                    | <b>Total of Labour</b>                |                  | <b>508.20</b>   |

## Paint

| Paint Work | SYSTEM AZT                            | Time Basis 10 WU/h |
|------------|---------------------------------------|--------------------|
| Code       | Description - TWO COAT METALLIC       | WU Price SGD       |
|            | BONNET NEW PART PAINTING              | 26.0               |
|            | R/F WING NEW PART PAINTING            | 11.0               |
|            | R/F LWR WING BRACKET SURFACE PAINT    | 4.0                |
|            | R/F W-HOUSE SUPPORT SURFACE PAINT     | 4.0                |
|            | FRONT BUMPER NEW PART PAINT K1R       | 10.0               |
|            | RIGHT FRONT DOOR REPAIR PAINTING <50% | 17.0               |
|            | R/F WHEELHOUSE SURFACE PAINT          | 6.0                |

## Paint Material Per Part

| Code | Description                           | Price SGD |
|------|---------------------------------------|-----------|
| 0471 | BONNET NEW PART PAINTING              | 88.24     |
| 0742 | R/F WING NEW PART PAINTING            | 23.74     |
| 0794 | R/F LWR WING BRACKET SURFACE PAINT    | 1.25      |
| 1132 | R/F W-HOUSE SUPPORT SURFACE PAINT     | 3.74      |
| 0281 | FRONT BUMPER NEW PART PAINT K1R       | 46.25     |
| 1482 | RIGHT FRONT DOOR REPAIR PAINTING <50% | 28.42     |
| 1118 | R/F WHEELHOUSE SURFACE PAINT          | 11.45     |

| Labour Cost - Paint            | Hrs            | WU           | Price SGD    |
|--------------------------------|----------------|--------------|--------------|
| Factor                         | 42.00 SGD/h    |              |              |
| Time Paint                     |                | 78.0         |              |
| Preparation Main Work Metal    | 2.50           | 25.0         | 105.00       |
| Preparation Comp. Work Plastic | 0.50           | 5.0          | 21.00        |
| <b>Total</b>                   | <b>10 WU/h</b> | <b>10.80</b> | <b>108.0</b> |



**Material Cost - Paint**

|                                     |               |
|-------------------------------------|---------------|
| New Part Painting                   | 111.98        |
| New Part Painting - Plastic K1R     | 46.25         |
| Repair Painting                     | 28.42         |
| Surface-/Blend Paint                | 16.44         |
| Material-constant Metal Preparation | 28.60         |
| Material-constant Plastic           | 9.00          |
| <b>Total</b>                        | <b>240.69</b> |

Price SGD

111.98

46.25

28.42

16.44

28.60

9.00

240.69

**Spare Parts**

|      |                            |              |             | prices as at 2015-06-01/01 |
|------|----------------------------|--------------|-------------|----------------------------|
| Code | Description                | Part Number  | Part Source | Price SGD                  |
| 0281 | CAA / FRONT BUMPER         | GHP950031C8N | Original    | 1,020.00                   |
| 0293 | ? FRT BUMPER ABSORBER      | G48F50111    | Original    | 70.00                      |
| 0320 | CAA / R/F BUMPER BRACKET   | GHP9500T1B   | Original    | 15.00                      |
| 0326 | ? R/BUMPER MNTG PLATE      | GSH7501U0    | Original    | 15.00                      |
| 0340 | ? FRT BUMPER SUPPORT       | GSH750070    | Original    | 300.00                     |
| 0356 | CAA / R/BUMP GRIL LWR MLDG | GSH750M32    | Original    | 15.00                      |
| 0395 | cut / FRT LWR BUMPER       | GRF2500S0A   | Original    | 75.00                      |
|      | COVER                      |              |             |                            |
| 0410 | ? GRILLE                   | GSH750719    | Original    | 80.00                      |
| 0412 | ? R/AIR GRILL LWR TRIM     | GSH7507J0B   | Original    | 90.00                      |
| 0415 | ? UPP RAD GRILLE COVER     | GSH7507E151  | Original    | 210.00                     |
| 0416 | ? GRILLE FRAME             | GSH750717A   | Original    | 90.00                      |
| 0418 | ? RAD GRILLE REINF         | GSH750712B   | Original    | 80.00                      |
| 0431 | ? MANUFACTURER BADGE       | GSH751730    | Original    | 30.00                      |
| 0433 | ? GRILLE BADGE BRACKET     | GBVH50716    | Original    | 25.00                      |
| 0471 | BT / BONNET                | GBY05231XB   | Original    | 580.00                     |
| 0475 | BT / L/BONNET HINGE        | GBFT52420E   | Original    | 50.00                      |
| 0476 | BT / R/BONNET HINGE        | GBFT52410E   | Original    | 50.00                      |
| 0494 | re / UP/CVR RADIAT GRILLE  | GHR1501A1    | Original    | 35.00                      |
| 0524 | tri / FRONT BONNET SEAL    | GHP956770    | Original    | 55.00                      |
| 0527 | XFRONT BONNET SEAL         | GHP956750    | Original    | 25.00                      |
| 0562 | CAA / R/F HEADLAMP         | GSK151031A   | Original    | 460.00                     |
| 0606 | ? R/H-LAMP PROTECTION      | GRF551065A   | Original    | 60.00                      |
| 0742 | ? R/F WING                 | GHP952111A   | Original    | 160.00                     |
| 0792 | AT / R/F WING BRACKET      | GHZ9521R0A   | Original    | 50.00                      |
| 0794 | AT / R/F LWR WING BRACKET  | GRF256114    | Original    | 25.00                      |
| 0842 | TV / R/F WHEELHOUSE        | GRF256130    | Original    | 115.00                     |
|      | COVER                      |              |             |                            |
| 1132 | ? R/F W-HOUSE SUPPORT      | G48F53140    | Original    | 75.00                      |
| 1436 | CAA / WASHER RESERVOIR     | GHR167481    | Original    | 55.00                      |
| 1437 | ? WASH TANK PUMP           | GHK167482    | Original    | 50.00                      |
| 1439 | ? FILLER NECK              | GHP967484A   | Original    | 25.00                      |
| 4886 | re / R/F UPP WING INSULAT  | GHP956915B   | Original    | 25.00                      |
| 7054 | ? R/F LWR CONTROL ARM      | G46C34300J   | Original    | 240.00                     |
| 7082 | ? R/STEERING KNUCKLE       | GBFN33021    | Original    | 180.00                     |
| 7132 | ? R/F WHEEL HUB            | KD353304XF   | Original    | 285.00                     |
| 7272 | ? R/F STABILISER ROD       | KD3534170    | Original    | 55.00                      |
| 7310 | ? R/TIE ROD                | GBEF32240    | Original    | 75.00                      |
| 7312 | ? R/TIE ROD BALL JOINT     | GBEF32280    | Original    | 145.00                     |

f: OEM Parts

n: Non-OEM Parts

u: Used parts

**Savings****Subtotal**

0.00

4,990.00

**4,990.00**

|                                           | SGD      | SGD             |
|-------------------------------------------|----------|-----------------|
| <b>Parts</b>                              | 4,990.00 |                 |
| <b>Total Parts</b>                        |          | <b>4,990.00</b> |
| <b>Labour Time Base 10 WU/h</b>           |          |                 |
| Total 115.0 WU X 42.00 SGD/h              | 483.00   |                 |
| Alignment                                 |          |                 |
| Measuring Work                            | 25.20    |                 |
| <b>Total of Labour</b>                    |          | <b>508.20</b>   |
| <b>Paint Work Time Base 10 WU/h</b>       |          |                 |
| Labour Cost 108.0 WU X 42.00 SGD/h        | 453.60   |                 |
| Material Cost                             | 240.69   |                 |
| <b>Total Paint Including Material</b>     |          | <b>694.29</b>   |
| <b>Repair Cost Excludes GST</b>           |          | <b>6,192.49</b> |
| GST (+7.00%)                              |          | <b>433.47</b>   |
| <b>Repair Cost Included GST</b>           |          | <b>6,625.96</b> |
| <b>Deductions (Excludes GST)</b>          |          |                 |
| Deduction For Excess                      | -750.00  |                 |
| <b>Total Of Deductions (Excludes GST)</b> |          | <b>-750.00</b>  |
| <b>Grand Total Excludes GST</b>           |          | <b>5,442.49</b> |
| GST (+7.00%)                              |          | <b>380.97</b>   |
| <b>Grand Total Included GST</b>           |          | <b>5,823.46</b> |

\* - USER SUPPLIED DATA  
NN - NO MANUFACTURERS CODE EXISTS  
) - WU PARTIAL INCL IN OTHER POSITIONS

**No assessment notes entered.**

5 Days. Not Authorised.  
 US Excess: TRA  
 After nprn plus  
 Give Q: ap - 8/8/22  
 11/11/22

Date: