



Auto Insure Pte. Ltd.
6 Marsiling Lane
Singapore (739145)
E: claims01@autoinsure.com.sg
W: www.autoinsure.com.sg
T: 3157 2626 F: 6368 0081
GST No.: 201437380M

Page No.1

AUTOMOBILE ASSESSMENT REPORT

Our Ref: **SNG2991Z (MARVYN)**
Your Ref: **SHB5785E**

Date: **10-Nov-22**

BY EMAIL ONLY
(claims01@autoinsure.com.sg)

ATTENTION: MOTOR CLAIMS DEPT

Email : motor_claims@first-insurance.com.sg

First Capital Insurance Limited

6 Raffles Quay #21-00
Singapore 048580

Assessed Vehicle No : **SNG2991Z**
Car Make and Model : **HYUNDAI TL TUCSON FL 1.6 GLS T-GDI DCT 2WD**
Date of Accident : **27-Oct-22**
Date of Assessment : **10-Nov-22**

We have carried out a physical assessment of SNG2991Z at our workshop Auto Insure Pte Ltd
sustained damages to the REAR portion of the vehicle.


4. DESCRIPTION OF DAMAGE

At the time of the inspection observed that this vehicle had
sustained damages to the REAR portion of the vehicle.

Please see attached schedule for details.

Remarks: **NIL**

Estimated Amount	:	L/S
Adjusted Amount	:	\$ 9,833.47
Est. Repair Days	:	6

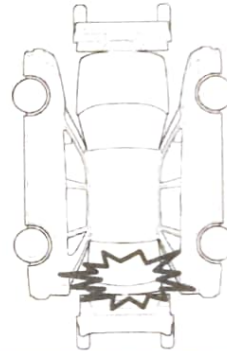

Pursuant to your instruction, we have **NOT AUTHORIZED** repair.
The assessment was conducted on a "**WITHOUT PREJUDICE**" basis.

If we are not notified of anything within 14 Days from the date hereof, this report shall be treated
as correct.

Disclaimer

This report is intended for the exclusive use of the addressee solely in relation to the loss of occurrence in which
the assessed vehicle is involved.

No liability or responsibility whatsoever shall be held by

AUTO INSURE PTE. LTD. For any reliance on this report by any third party.

Our Ref: SNG2991Z

Your Ref: SHB5785E

S/NO	QTY	DESCRIPTIONS	ASSESSED CONDITION	EST. BY WORKSHOP
PARTS REPLACEMENT - LIST ITEMS				
1	1	REAR TAILGATE X <i>repi</i>		\$ 1,862.10
2	1	REAR TAILGATE HINGE RH X } <i>nan</i>		\$ 64.70
3	1	REAR TAILGATE HINGE LH X }		\$ 64.70
4	1	REAR TAILGATE LOGO / <i>mc</i>		\$ 142.30 ✓
5	1	REAR TAILGATE REFLECTOR RH X } <i>nan</i>		\$ 124.10
6	1	REAR BUMPER REFLECTOR RH X }		\$ 124.10
7	1	REAR BUMPER / <i>CRA</i>		\$ 1,269.40 494 ✓
8	1	REAR BUMPER SIDE RETAINER LH X } <i>nan</i>		\$ 84.20
9	1	REAR BUMPER SIDE RETAINER RH X }		\$ 84.20
10	1	REAR BUMPER REINFORCEMENT ? X <i>nn</i>	<i>nn</i>	\$ 648.50
11	1	REAR BUMPER LOWER COVER / <i>CRA</i>		\$ 621.80 415 ✓
12	1	REAR END PANEL ? X <i>nn</i>		\$ 878.60
13	1	REAR FENDER RH X ? X <i>nn</i>		\$ 2,241.90
14	1	REAR BUMPER TOWING COVER RH / <i>CRA</i>		\$ 64.20 38 ✓
15	1	REAR PARKING SENSOR OUTER RH ? X <i>nn</i>	<i>nn</i>	\$ 325.20
16	1	REAR PARKING SENSOR INNER RH ? X <i>nn</i>	<i>nn</i>	\$ 325.20
			SUB TOTAL	\$ 8,925.20
		1089.30 -20% 871.44	LESS 20%	\$ 1,785.04
			TOTAL AMOUNT	\$ 7,140.16

Our Ref: SNG2991Z

Your Ref: SHB5785E

S/NO	QTY	SPECIAL NETT ITEMS	ASSESSED CONDITION	EST. BY WORKSHOP
1	1	REAR BUMPER CLIPS / <i>mc</i>		\$ 50.00 30 ✓
2	1	REAR END PANEL SEALANT ? X <i>nn</i>	<i>nn</i>	\$ 60.00
			SUB TOTAL	\$ 110.00
			TOTAL PARTS COST	\$ 7,250.16

Our Ref: **SNG2991Z**

Your Ref: **SHB5785E**

S/NO	DESCRIPTION	EST. BY WORKSHOP
LABOUR & PAINTWORK		
1	TO REMOVE THE AFFECTED PARTS & FITTINGS TO COMMENCE REPAIRS; PANEL BEAT & RESHAPE THE AFFECTED AREAS AND REPLACED THE DAMAGED PARTS AND COMPONENTS	\$ 800.00
2	TO REMOVE & REFIT WIRING SYSTEM AT ACCIDENT AND CHECK FOR PROPER FUNCTIONS	\$ 100.00
3	TO REMOVE & REFIT REAR BUMPER REVERSE SENSORS	\$ 100.00
4	TO REMOVE & REFIT UPHOLSTERY GARNISH AND ATTACHMENT PARTS	\$ 120.00
5	TO RESPRAY AND SUPPLY EXPANDABLE ITEMS & PUFFY ON PARTS REPLACED	\$ 600.00
6	TO PERFORM ANTI-RUST TREATMENT ON AFFECTED AREAS	\$ 60.00
7	SUNDRIES (SAND PAPER, WELDING WIRE ETC.)	\$ 50.00
8	TO VACUUM, WAXING & CLEAN	\$ 60.00
9	TO PERFORM WATER SEEPAGE TEST ON REPAIRED PORTIONS	\$ 50.00
TOTAL BEFORE GST		\$ 9,190.16
GST 7%		\$ 643.31
TOTAL (PARTS & LABOUR):		\$ 9,833.47

Adjustments / Recommendations

Our estimator have thoroughly inspected each and every item on the estimate against physical damage found on the vehicle and have listed the breakdown of our finding and recommendation.

Our Workshop has agreed to undertake the job at a sum of \$ 9,800.00 for LUMP SUM with the third party insurance.

1741.44

L/S - 1393.15
- 1400

Yours Faithfully,

Jason Heng
Claims Director

4 Days.
4/3
After repair photos.
Gone AW4
8288082
11/11/22

<p>LKK Auto Consultants hence notify the Repairer of the following:</p> <ul style="list-style-type: none">• To resurvey before repair• To display• Parts• Third party• No• Sup <p>Acknowledged by repairer</p> <p>Signature:</p> <p>Date:</p>
--