

ASS. REC. BY:

REF:

CS/CT122011359/Kqy3

Kenneth

ASSIGNMENT

From: \_\_\_\_\_ Date: \_\_\_\_\_

Estimated Cost: \_\_\_\_\_

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No: \_\_\_\_\_

at Workshop m/s \_\_\_\_\_

of \_\_\_\_\_

Insured: \_\_\_\_\_

Policy No. \_\_\_\_\_

Claims No. \_\_\_\_\_

Sum Insured: \_\_\_\_\_ Excess: \_\_\_\_\_

(Client's Record)

Make of Veh: \_\_\_\_\_

(Policy Condition)

Remark: The veh had commenced its repair at the time of inspection.

N/S	O/S

Bal. or Market Value: \$894

IDAC Accident Rport: \_\_\_\_\_ Consistent?: Yes or No

GIA / PR Seen: \_\_\_\_\_ Consistent?: Yes or No

Est. Repairs: 18 days Res.: Yes or No

Lum Sum: 20 % 3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date: \_\_\_\_\_ Person Contacted: \_\_\_\_\_

Vehicle: IN / OUT

Veh No: GBK 77754 Tr Regn: 11, 20

Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or \_\_\_\_\_

Make: Toy Hiace c.c. 2750

Colour: Silver A/C: Insured / Std / NI / NA

Sp.Reading: \_\_\_\_\_ T/Radio: Insured / Std / NI / NA

Eng/No: \_\_\_\_\_

C/No: GD14201 2014363

Gen. Cond: Good / Fair / Poor / Burnt

Steering: In order / Jammed / Leaked / Burnt or

Brake: In order / Jammed / Leaked / Burnt or

Mod: Alloy / Std A/Rim / STD A/Rim or

Tyre Size: F: 245/40 R18

R: \_\_\_\_\_

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or Hapsen

Front Rear

R/Bal. 3 mm R/Bal. 4 mm

L/Bal. 3 mm L/Bal. 4 mm

D.O.A. 7/11/22 D.O.I. 14/11/2022

Survey held at \_\_\_\_\_

Des. of Damages: Frt / Rear / O/S / N/S / UIC / Rooftop or

FR N/S

The UIC / Chassis frame / Body Structure affected due to collision.

Date / Time Action / Instruction

1 Bottom Flat

Kenneth finalised LS \$14700 (Red \$15744.49, 52%)

Date/Time, File Pass to?

: Prell. Report

Days Of Repair: 18

04/05 Typist

: Final Report

Resurvey No. of Trip: 2

Date/Time, File Return to?

Survey Fee:

Add Fee: : Site Insp (\$

Transportation

: Interview (\$

S - RS, SI

: Tech Invs (\$

Fees

: Weekend (\$

Other

Report Format: MER-OD

Lump Sum / +B.L (\$ 14700

TOTAL

**Vehicle Condition**


**Vehicle Status**

Pre-Accident Damage:

Date of Inspection:

**Damage Areas**

- All
- Underbody

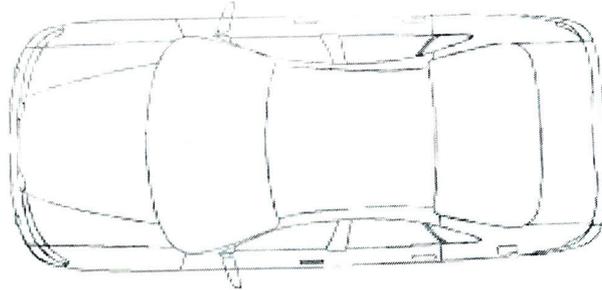

**Tyres Condition**

Tyre Brand	Tread (Left Middle), Tread (Left Outer), Tread (Left Inner), Tread (Right Inner), Tread (Right Outer), Tread (Right Middle), mm						Condition
	mm	mm	mm	mm	mm	mm	
Spare Tyre Brand	Tread (Spare), mm						

*NOT WITHERN  
L1 Pny &  
Penny After Pain  
Ex @1500.*

**Labour**

Code	Description	Time Base 10 WU/h	Price = 42.00 SGD/h	
			WU	Price SGD
B091	R + R RIGHT FRONT WING		1.0	4.20
B091	RENEW L/F WING (BUMPER AND HEADLAMP REMOVED) INCLUDES: R + R WING, CONVERT ATTACHED PARTS		7.0	29.40
NO NUMBER	RENEW LEFT REAR INNER SIDE PANEL		21.0	88.20
NO NUMBER	RENEW L/SIDE SECTION		42.0	176.40
NO NUMBER	RENEW L/INN SIDE RAIL		21.0	88.20
B020)	RENEW FRONT BUMPER REINFORCEMENT		3.0	12.60
B020	RENEW FRONT BUMPER (RADIATOR GRILLE REMOVED) INCLUDES: FRONT BUMPER AND REQUIRED ATTACHED PARTS R + R		7.0	29.40
NO NUMBER	R + R L/F BUMPER MOUNTING		1.0	4.20
NO NUMBER	R + R CENTRE LOWER RADIATOR GRILLE		2.0	8.40
B030	R + R RADIATOR GRILLE		2.0	8.40
B040	R + R HEADLAMPS (BUMPER REMOVED)		4.0	16.80

Code	Description	WU	Price SGD
NO NUMBER 530051	INCLUDES: ADJUST HEADLAMPS R + R BONNET STAY RENEW BONNET	1.0 3.0	4.20 12.60
B085	INCLUDES: ASS ATTACHED PARTS AND IF NECE RENEW R + R COWL PANEL TRIM INCLUDES: WIPER ARMS REMOVE AND REFIT	2.0	8.40
B080 B085) B085) G010	R + R BONNET HINGE/S RENEW WINDSCREEN FRAME COVER (REMOVED) R + R WIPER MOTOR R + R WINDSCREEN	1.0 1.0 1.0 31.0	4.20 4.20 4.20 130.20
NO NUMBER	INCLUDES: R + R WIPER ARMS, COWL GRILLE, A-PILLAR TRIMS, INSIDE MIRROR AND ALL NECESSARY ATTACHED PARTS	6.0	25.20
NO NUMBER	RENEW AIR CHANNEL	84.0	352.80
NO NUMBER	RENEW FRONT WALL CPL	15.0	63.00
NO NUMBER	RENEW WATER HOSE CONNECTION HOUSING	8.0	33.60
B135 25	RENEW FR/LWR CROSSMEMBER RENEW FRONT LOCK CARRIER	5.0	21.00
NO NUMBER	RENEW L/FRT SIDE MEMBER	15.0	63.00
671351	R + R LEFT FRONT DOOR SEAL	4.0	16.80
743511)	R + R FRONT FLOOR CARPET	2.0	8.40
NO NUMBER	R + R L/F LATCH	2.0	8.40
NO NUMBER	RENEW L/A-PILLAR INCLUDES: R + R A-PILLAR TRIMS	62.0	260.40
NO NUMBER	R + R L/SILL TRIM	1.0	4.20
NO NUMBER	R + R L/F CROSS MEMBER BRKT	5.0	21.00
NO NUMBER	R + R R/F CROSS MEMBER BRKT	5.0	21.00
B194	RENEW L/STEP BOARD	10.0	42.00
B210	RENEW LEFT FRONT DOOR INCLUDES: R + R AND ALIGN LEFT FRONT DOOR, CONVERT ATTACHED PARTS, RENEW IF NECESSARY	23.0	96.60
B210)	RENEW L/DOOR HINGES	1.0	4.20
B380	R + R TAILGATE INCLUDES: ALIGN TAILGATE	11.0	46.20
B400	R + R L/TAILGATE HINGE	1.0	4.20
B400	R + R RIGHT TAILGATE HINGE	1.0	4.20
NO NUMBER	RENEW ROOF	173.0	726.60
B430	R + R FRONT HEADLINING	7.0	29.40
B430)	R + R CENTRE HEADLINING	3.0	12.60
B430)	R + R REAR HEADLINING	3.0	12.60
M170	R + R UPPER STEERING COLUMN	7.0	29.40
M230	R + R INSTRUMENT PANEL INCLUDES: R + R STEERING WHEEL, COMBINATION SWITCH AND INSTRUMENT CLUSTER	20.0	84.00
M230	R + R INSTRUMENT PANEL REINFORCER	7.0	29.40
M220)	RENEW HEATER BLOWER (REMOVED)	1.0	4.20
M220	R + R HEATER BLOWER	2.0	8.40
NO NUMBER	R + R AIR CHANNEL	4.0	16.80
B440	R + R LEFT FRONT SEAT	3.0	12.60
B440	R + R RIGHT FRONT SEAT	2.0	8.40

Code	Description	WU	Price SGD
NO NUMBER	R + R UPPER RADIATOR SHROUD	1.0	4.20
NO NUMBER	R + R FUSE BOX HOUSING	3.0	12.60
M010)	R + R RADIATOR (BUMPER REMOVED) INCLUDES: INTERCOOLER AND ELECTRIC FAN CPL REMOVE AND REFIT. COOLING SYSTEM BLEED	15.0	63.00
M150)	RENEW CHARGE AIR COOLER (REMOVED)	1.0	4.20
1002	INSTRUMENT PANEL DASHBOARD	6cl	250.00*
1004	FRT DOOR LH DOOR	6cl	250.00*
1005	ROOF PANEL ROOF		550.00* 7
1006	WINDSCREEN GLASS WINDSCREEN	nn	150.00* X
<b>Labour Cost</b>		<b>Hrs</b>	<b>WU</b>
<b>Panel / Mechanical Labour</b>		66.40	664.0
<b>Fixed Rate</b>			2,788.80
			1200.00
<b>Total of Labour</b>			<b>3,988.80</b>

### Paint

Paint Work		SYSTEM AZT	Time Basis 10 WU/h
Code	Description	WU	Price SGD
	BONNET NEW PART PAINTING	16.0	
	L/F WING NEW PART PAINTING	9.0	
	CTR FRT PANEL STRUT SURFACE PAINT	4.0	
	FRT PANEL C-MEMBER SURFACE PAINT	5.0	
	L/F C-MEMBER BRACKET SURFACE PAINT	5.0	
	R/F C-MEMBER BRACKET SURFACE PAINT	5.0	
	FRT LOCK CARRIER CPL SURFACE PAINT	4.0	
	L/F SIDE PANEL SURFACE PAINT	5.0	
	WATER BOX SURFACE PAINT	4.0	
	FRT LWR CROSSMEMBER SURFACE PAINT	5.0	
	ENGINE FIREWALL SURFACE PAINT	5.0	
	LEFT FRONT DOOR NEW PART PAINTING	14.0	
	L/F FOOTREST SURFACE PAINT	4.0	
	L/F STEP SURFACE PAINT	4.0	
	LEFT A-PILLAR NEW PART PAINTING	20.0	
	L/SIDE RAIL SURFACE PAINT	4.0	
	L/R SIDE PANEL FRT SURFACE PAINT	4.0	
	L/LWR A-PILLAR REINF SURFACE PAINT	4.0	
	L/LOWER FRAME REINF SURFACE PAINT	4.0	
	ROOF NEW PART PAINTING	107.0	

### Paint Material Per Part

Code	Description	Price SGD
0471	BONNET NEW PART PAINTING	40.70
0741	L/F WING NEW PART PAINTING	14.91
0988	CTR FRT PANEL STRUT SURFACE PAINT	1.94
1003	FRT PANEL C-MEMBER SURFACE PAINT	4.40
1005	L/F C-MEMBER BRACKET SURFACE PAINT	4.40
1006	R/F C-MEMBER BRACKET SURFACE PAINT	4.40
1015	FRT LOCK CARRIER CPL SURFACE PAINT	2.64

**Paint Material Per Part**

Code	Description	Price SGD
1131	L/F SIDE PANEL SURFACE PAINT	6.16
1311	WATER BOX SURFACE PAINT	2.64
1320	FRT LWR CROSSMEMBER SURFACE PAINT	4.40
1321	ENGINE FIREWALL SURFACE PAINT	7.92
1481	LEFT FRONT DOOR NEW PART PAINTING	33.45
2141	L/F FOOTREST SURFACE PAINT	2.46
2145	L/F STEP SURFACE PAINT	2.46
2227	LEFT A-PILLAR NEW PART PAINTING	21.85
2243	L/SIDE RAIL SURFACE PAINT	3.34
2245	L/R SIDE PANEL FRT SURFACE PAINT	1.94
2269	L/LWR A-PILLAR REINF SURFACE PAINT	2.64
2271	L/LOWER FRAME REINF SURFACE PAINT	3.52
2351	ROOF NEW PART PAINTING	165.62

**Labour Cost - Paint**

	Hrs	WU	Price SGD
Factor	42.00 SGD/h		
Time Paint		232.0	
Preparation Main Work Metal	1.70	17.0	71.40
<b>Total</b>	<b>10 WU/h</b>	<b>249.0</b>	<b>1,045.80</b>

**Material Cost - Paint**

	Price SGD
New Part Painting	276.53
Surface-/Blend Paint	55.26
Material-constant Metal	18.10
<b>Total</b>	<b>349.89</b>

**Spare Parts**

Code	Description	Part Number	Part Source	Price SGD
0253	L/F BMPR BLANK CAP	53113 26060	Original	40.00 ?
0281	FRONT BUMPER	52119 26651	Original	Tn 280.00 ✓
0293	L/F BUMPER COVER	52127 26120	Original	in 20.00 X
0317	L/F INNER COVER BRKT	52116 26170	Original	nit 55.00 ✓
0331	FRT BUMPER SUPPORT	52131 26020	Original	R 185.00 X
0341	FT BUMPER AIR GRILLE	53112 26070	Original	C/M 160.00 ✓
0410	LWR RADIATOR GRILLE	53111 26510	Original	nit 265.00 ✓
0411	UPP RADIATOR GRILLE	53111 26500	Original	nit 180.00 ✓
0413	GRILLE BACKING	53112 26090	Original	nit 285.00 ✓
0431	GRILLE BADGE	90975 02086	Original	nit 70.00 ✓
0471	BONNET	53301 26080	Original	R 300.00 ✓
0475	LEFT BONNET HINGE	53420 26040	Original	R 35.00 ✓
0476	RIGHT BONNET HINGE	53410 26040	Original	R 35.00 X
0493	BONNET LOCK	53510 0L010	Original	R 65.00 X
0495	BONNET SUPPORT	53451 26050	Original	R 20.00 X
0561	LEFT HEADLAMP ASSY	81170 26731	Original	AV 990.00 ✓
0562	RIGHT HEADLAMP ASSY	81130 26731	Original	in 990.00 X
0741	L/F WING	53802 26021	Original	R 80.00 ✓
0988	CTR FRT PANEL STRUT	53209 26100	Original	R 55.00 X
1003	FRT PANEL C-MEMBER	57053 26030	Original	R 120.00 ✓

Code	Description	Part Number	Part Source	Price SGD
1005	L/F C-MEMBER BRACKET	53036 26020	Original	120.00 X
1006	R/F C-MEMBER BRACKET	58127 26050	Original	120.00 X
1015	FRT LOCK CARRIER CPL	53201 26082	Original	220.00 ✓
1131	L/F SIDE PANEL	53702 26130	Original	300.00 ?
1201	L/F SIDE MEMBER CPL	57004 26440	Original	250.00 ?
1310	AIR DUCT	55757 26040	Original	30.00 ?
1311	WATER BOX	55700 26440	Original	100.00 X
1320	FRT LWR CROSSMEMBER	57109 26021	Original	180.00 X
1321	ENGINE FIREWALL	55015 26E60	Original	420.00 X
1392	AIR GUIDE TRIM	55708 26090	Original	140.00 ?
1401	WINDSCREEN	56101 26011	Original	650.00 ✓
1409	LWR WINDSCREEN SEAL	56118 26020	Original	0.00
1411	WINDSCREEN BOND KIT	PZ491 00C1131		0.00
1413	FRONT SCREEN SPACER	56116 35050		0.00
1423	WINDSCREEN MOULDING	75531 26071	Original	70.00 ✓
1436	WASHER CONTAINER	85315 26130	Original	75.00 ✓
1450	WIPER MOTOR	85110 26231	Original	185.00 ?
1453	L/FR WIPER ARM	85221 0L011	Original	105.00 ✓
1454	R/FR WIPER ARM	85211 0L011	Original	105.00 X
57	L/F WIPER BLADE	85222 0L020	Original	30.00 ✓
1458	R/F WIPER BLADE	85222 0L010	Original	30.00 ✓
1461	WIPER LINKAGE	85150 26110	Original	180.00 ?
1481	LEFT FRONT DOOR	67002 26292	Original	680.00 ✓
1487	L/F UPPER DOOR HINGE	68730 26012	Original	45.00 ✓
1495	L/F LOWER DOOR HINGE	68710 26022	Original	45.00 ✓
1505	L/F DOOR CHECK	68610 26041	Original	40.00 ?
1509	L/F DOOR SEAL	67862 26050	Original	180.00 ✓
1519	L/F DOOR WINDOW	68102 0L011	Original	285.00 ✓
1547	L/F WINDOW REGULATOR	69820 26060	Original	120.00 ?
1571	L/F INN DOOR HANDLE	69206 12200B1	Original	20.00 X
1575	L/F WINDOW WINDER	69260 12080B3	Original	25.00 X
1577	L/F DOOR LOCK	69320 26060	Original	180.00 ?
1581	L/F LOCK STRIKER	69410 20110	Original	35.00 X
1595	L/F DOOR FRAME SEAL	62314 26010C0	Original	120.00 ✓
1597	L/F WINDOW CHANNEL	68151 26010	Original	120.00 ✓
1613	L/F RAIL REAR	67404 26060	Original	55.00 ?
1661	L/F WINDOW MOULDING	68162 26040	Original	75.00 ?
1711	L/F DOOR TRIM	67620 26660B0	Original	240.00 ✓
1731	L/F DOOR HANDLE	74814 26030B0	Original	25.00 ?
1737	L/DOOR MIRROR	87940 26700	Original	350.00 ✓
1747	L/INNER MIRROR TRIM	67492 26050	Original	30.00 ?
2141	L/F FOOTREST	61416 26021	Original	120.00 X
2145	L/F STEP	61132 26121	Original	90.00 X
2193	L/F STEP TRIM	51774 26023	Original	65.00 ?
2227	LEFT A-PILLAR	61112 26361	Original	980.00 ✓
2243	L/SIDE RAIL	57046 26330	Original	100.00 X
2245	L/R SIDE PANEL FRT	53708 26100	Original	50.00 ?
2269	L/LWR A-PILLAR REINF	61109 26010	Original	60.00 ?
2271	L/LOWER FRAME REINF	61102 26030	Original	90.00 ?
2351	ROOF	63111 26471	Original	3,050.00 X
4324	UPP INST PANEL COVER	55041 26070B1	Original	90.00 ?
4330	INSTR PANEL SUPPORT	55330 26310	Original	455.00 ?
4331	INSTRUMENT PANEL	55300 26110B0	Original	480.00 ✓
4350	UPP INSTR PANEL TRIM	55405 26220B1	Original	220.00 ?

Code	Description	Part Number	Part Source	Price SGD
4411	LWR WARM AIR HOUSING	87130 26210	Original	1,950.00 ✓
4414	BLOWER MOTOR	87103 26101	Original	450.00 ✓
4431	CTR VENTILATION HSG	87211 26130	Original	110.00 X
4433	L/AIR GUIDE PANEL	87211 26090	Original	60.00 ✓
4875	FRONT FLOOR CARPET	58510 26Q10B0	Original	580.00 ✓
4890	FLOOR LINING COVER	58530 26731B2	Original	100.00 ✓
4947	L/F SILL PANEL TRIM	67914 26062B1	Original	140.00 ✓
4957	HEADLINING 1	63310 0L010B0	Original	450.00 ✓
7752	UPP RADIATOR BRACKET	53292 26070	Original	70.00 X
7761	RADIATOR	16400 11A40	Original	780.00 ✓
7767	FAN HOUSING	16712 75122	Original	165.00 ✓
8405	EXPANSION TANK	16470 75123	Original	90.00 ✓
8739	HEAT EXCHANGER	17940 30051	Original	680.00 ✓
9575	CABLE CONNECT BLOCK	82730 26110	Original	75.00 ✓
9660	RELAY BOX HOUSING	82741 26080	Original	65.00 ✓
9661	RELAY BLOCK	82660 26300	Original	40.00 ✓
1000	CONDENSOR ASSY CPL	CONDENSOR	Original	580.00 ✓
1001	H/LAMP HARNESS WIRE	WIRE	Original	500.00 ✓
<b>Savings</b>				<b>0.00</b>
<b>Subtotal</b>				<b>22,945.00</b>
<b>Total</b>				<b>22,945.00</b>

OEM Parts  
 n: Non-OEM Parts  
 u: Used parts

### Final Calculation

	SGD	SGD
<b>Parts</b>		
<b>Total Parts</b>	22,945.00	22,945.00
<b>Labour Time Base 10 WU/h</b>		
Total 664.0 WU X 42.00 SGD/h	27,888.80	
Fixed Rate	1,200.00	
<b>Total of Labour</b>		3,988.80
<b>Paint Work Time Base 10 WU/h</b>		
Labour Cost 249.0 WU X 42.00 SGD/h	10,458.80	
Material Cost	349.89	
<b>Total Paint Including Material</b>		1,395.69
<b>Repair Cost Excludes GST</b>		<b>28,329.49</b>
GST (+7.0%)		1,983.06
<b>Repair Cost Included GST</b>		<b>30,312.55</b>

**LKK Auto Consultants hence notify the Repairer of the following:**  
 • To resurvey before/after spray painting  
 • To display damaged part(s) during resurvey  
 • Parts prices are subject to confirmation  
 • Third party survey is on a "Without Prejudice" basis  
 • No illegal modification(s) is allowed  
 • Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company  
 Acknowledged by Repairer  
 Signature:  
 Date:

**Comments**  
 \* - USER SUPPLIED DATA  
 NN - NO MANUFACTURERS CODE EXISTS  
 ) - WU PARTIAL INCL IN OTHER POSITIONS

### Assessment Note

## SINGAPORE ACCIDENT STATEMENT

### IMPORTANT NOTICE

1. Please report **correctly** the details of the accident to speed up the claims process.
2. This Form must be **completed by the Policyholder and/or the Actual Driver**
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. **Any false reporting may be referred to the Police for investigation.**
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

### ACCIDENT STATEMENT

Date of Submission ..... 08/11/2022 17:25 (SGT)  
Reported by ..... Driver  
Date of Accident ..... 07/11/2022 10:30 (SGT)  
Exact Location of Accident ..... Singapore  
Additional Location Information ..... KPE (TPE) 1.1KM  
Country/State of Loss ..... Singapore

### DETAILS OF OWN VEHICLE

Vehicle Registration Number ..... GBK7775U

#### INSURED/POLICYHOLDER

Is company? ..... Yes  
Name Of Registered Owner ..... SSL LIMOUSINE PTE LTD  
Company Reg No ..... 2XXXXX894E  
Email Address ..... GARYONG66@ICLOUD.COM  
Mobile Phone No ..... (Phone) +65-97458239  
Alternative Phone No ..... -

#### VEHICLE PARTICULARS

Manufacturer ..... Toyota  
Model ..... Hiace  
Variant ..... -  
Exact purpose for which vehicle was being used at time of accident ..... Employment  
Are you claiming under your own insurance policy for repair to your vehicle? ..... Yes  
Vehicle Category ..... Commercial vehicle  
Transmission ..... Auto  
CC ..... 2982

#### INSURANCE COMPANY

Name of Insurance Company ..... China Taiping Insurance (Singapore) Pte. Ltd.  
Policy Number / Cover Note Number ..... DMCVSNW00138232101

#### DRIVER

Name of Driver ..... MUHAMMAD AZAHARI BIN ZAINAL  
NRIC No ..... SXXXX539H  
Date Of Birth ..... 18/10/1997  
Occupation ..... Outdoor



> Back to OneMotoring

## Enquire PARF/COE Rebate for Registered Vehicle

### Vehicle Owner Particulars

Owner ID Type: Company  
Owner ID: 894E

### Vehicle Details

Vehicle No.: GBK7775U  
Vehicle to be Exported: Yes  
Intended Deregistration Date: 18 Nov 2022  
Vehicle Make: TOYOTA  
Vehicle Model: HIACE DX 2.8 AUTO  
Primary Colour: Silver  
Manufacturing Year: 2020  
Engine No.: 1GD8613892  
Chassis No.: GDH2012014363  
Maximum Power Output: -  
Open Market Value: \$36,866.00  
Original Registration Date: 30 Nov 2020  
First Registration Date: 30 Nov 2020  
Transfer Count: 0  
Actual ARF Paid: \$1,844.00

### Intended PARF Rebate Details

PARF Eligibility: No  
PARF Eligibility Expiry Date: -  
PARF Rebate Amount: \$0.00

### Intended COE Rebate Details

COE Expiry Date: 29 Nov 2030  
COE Category: C - Goods Vehicle & Bus  
COE Period(Years): 10  
PQP Paid: \$26,854.00  
COE Rebate Amount: \$21,483.00  
**Total Rebate Amount: \$21,483.00**

The information contained herein is correct as at 14 Nov 2022

OK