



TY5 CONSULTANCY

(Registration No.: 53429875C)

Address : 50 Chin Swee Road #09-04, Thong Chai Building, Singapore 169874

Contact : +65 8788 5345 | Email Address : admin@ty5group.com.sg

*Our Services : Automotive Surveying | Vehicle Valuation
Motor Claims Investigation | Evaluation & Consultation*

Reference : TY5/TA/10103/6831/TP/02.22
Date : 14 May 2022
Vehicle no : FBD 6831J

To: Liberty Credit Pte Ltd
c/o 25 Kaki Bukit Road 4
#01-69, Synergy @ Kaki Bukit
Singapore 417800

INVOICE

PARTICULARS

AMOUNT

Registration No. : FBD 6831J
Date of accident : 21 February 2022
Make / Model : Yamaha FZ6S
Invoice No. : 10103

Being work done and services rendered as follows:

- ✓ Inspection of Vehicle
- ✓ Re-Inspection
- ✓ Appraisal Report
- ✓ 100 Colored Photographs
- ✓ Transport Charges

SGD 670.00

TOTAL SGD 670.00

Dollars: Six Hundred and Seventy Only

(Cheque should be crossed and make payable to "TY5 CONSULTANCY")

TY5 CONSULTANCY



TY5 CONSULTANCY

(Registration No.: 53429875C)

Address : 50 Chin Swee Road #09-04, Thong Chai Building, Singapore 169874

Contact : +65 8788 5345 | Email Address : admin@ty5group.com.sg

Our Services : Automotive Surveying | Vehicle Valuation
Motor Claims Investigation | Evaluation & Consultation

Reference : TY5/TA/10103/6831/TP/02.22

Date : 14 May 2022

Vehicle no : FBD 6831J

To: Liberty Credit Pte Ltd
c/o 25 Kaki Bukit Road 4
#01-69, Synergy @ Kaki Bukit
Singapore 417800

VEHICLE INSPECTION REPORT

Name of Workshop : CandyMotor Workshop Pte Ltd
Place of inspection : 25 Kaki Bukit Road 4 #01-69, Synergy @ Kaki Bukit, Singapore 417800
Date of Accident : 21 February 2022
Date of Inspection : 23 March 2022

VEHICLE PARTICULAR

Registration No.	: FBD 6831J	Chassis Frame No.	: JYARJ149000007747
Make / Model	: Yamaha FZ6S	Engine No.	: J514E061633
Year of Registration	: 2009	Odometer Reading	: 130,145 KM
Class / Type	: Motorcycle	Colour	: Black

VEHICLE CONDITION

General Condition	: Good	Steering	: Serviceable
Paintwork	: Good	Foot/ Parking Brake	: Serviceable

TYRE CONDITION

	<u>Size</u>	<u>Thread Balance</u>
Front :	BRIDGESTONE 120 / 70 ZR17	7mm
Rear :	BRIDGESTONE 180 / 55 ZR17	7mm

* The above is an estimate of the remaining life of the tyre thread in percentages

COST OF REPAIR

	Repairer S\$	Adjuster S\$
Parts	\$ 10,077.00	\$ 9,759.00
Labour	\$ 1,980.00	\$ 1,780.00
	<u>\$ 12,057.00</u>	<u>\$ 11,539.00</u>

TY5 Recommendation

Lump Sum Repair :

\$ 9,200.00

Estimated Repair Duration :

14

working days (excluding Sat, Sun & Public Holidays)

NOTE : The information contained in these documents may be privileged and confidential, and is intended for the exclusive use of the addressee designation. If you are not the addressee, any enclosure, reproduction, distribution or other dissemination or use of this communication is strictly prohibited.



TY5 CONSULTANCY

(Registration No.: 53429875C)

Address : 50 Chin Swee Road #09-04, Thong Chai Building, Singapore 169874

Contact : +65 8788 5345 | Email Address : admin@ty5group.com.sg

Our Services : Automotive Surveying | Vehicle Valuation
Motor Claims Investigation | Evaluation & Consultation

Reference : TY5/TA/10103/6831/TP/02.22
Date : 14 May 2022
Vehicle no : FBD 6831J

ASSESSMENT SCHEDULE

<u>SN</u>	<u>Qty</u>	<u>Descriptions</u>	<u>Conditions</u>	<u>Repairer's Estimate</u>	<u>Surveyor's Revised</u>
<u>LIST ITEMS:-</u>					
1	1	front fender	cracked	\$ 157.00	\$ 157.00
2	1	front fork - set	bent	\$ 1,800.00	\$ 1,800.00
3	1	front rubber slider - set	scratched	\$ 186.00	\$ 186.00
4	1	handle bar	bent	\$ 207.00	\$ 207.00
5	1	handle bar end balancer - pair	scratched	\$ 64.00	\$ 64.00
6	1	handle bar grip - pair	unconfirmed	\$ 82.00	not affected
7	1	wing mirror - pair	scratched	\$ 190.00	\$ 190.00
8	1	r/h brake lever w/ brake reservoir	scratched	\$ 394.00	\$ 394.00
9	1	headlamp	broken	\$ 482.00	\$ 482.00
10	1	head fairing	broken	\$ 392.00	\$ 392.00
11	1	head fairing inner panel	deformed	\$ 221.00	\$ 221.00
12	1	front windshield	broken	\$ 257.00	\$ 257.00
13	1	instrumental panel	damaged	\$ 762.00	\$ 762.00
14	1	radiator	bent	\$ 929.00	\$ 929.00
15	1	fuel tank	buckled	\$ 957.00	\$ 957.00
16	1	r/h rider foot rest w/ bracket	broken	\$ 242.00	\$ 242.00
17	1	r/h foot brake pedal	bent	\$ 67.00	\$ 67.00
18	1	rear swingarm rubber slider - set	scratched	\$ 186.00	\$ 186.00
19	1	r/h rear signal lamp	scratched	\$ 47.00	\$ 47.00
20	1	r/h rear side fairing	scratched	\$ 220.00	\$ 220.00
				\$ 7,842.00	\$ 7,760.00
Less 10%					\$ 776.00
				\$ 7,842.00	\$ 6,984.00
<u>SPECIAL NETT ITEMS:-</u>					
21	1	front no. plate sticker	necessary	\$ 25.00	\$ 25.00
22	1	front wheel rim	distorted	\$ 450.00	\$ 900.00
23	1	front tyre @ 50% depreciation	scratched	\$ 360.00	\$ 180.00
24	1	rear wheel rim	distorted	\$ 450.00	\$ 900.00
25	1	rear tyre @ 50% depreciation	scratched	\$ 360.00	\$ 180.00
26	1	rear box w/ base bracket	scratched	\$ 590.00	\$ 590.00
				\$ 2,235.00	\$ 2,775.00
Total				\$ 10,077.00	\$ 9,759.00



TY5 CONSULTANCY

(Registration No.: 53429875C)

Address : 50 Chin Swee Road #09-04, Thong Chai Building, Singapore 169874

Contact : +65 8788 5345 | Email Address : admin@ty5group.com.sg

*Our Services : Automotive Surveying | Vehicle Valuation
Motor Claims Investigation | Evaluation & Consultation*

Reference : TY5/TA/10103/6831/TP/02.22
Date : 14 May 2022
Vehicle no : FBD 6831J

ASSESSMENT SCHEDULE

<u>SN</u>	<u>Qty</u>	<u>Descriptions</u>	<u>Conditions</u>	<u>Repairer's Estimate</u>	<u>Surveyor's Revised</u>
		B/F		\$ 10,077.00	\$ 9,759.00
27		To dismantle and repair damaged parts		\$ 1,100.00	\$ 1,000.00
28		To check wiring		\$ 60.00	\$ 50.00
29		To realign front fork		\$ 200.00	\$ 180.00
30		To remove and reinstall fuel tank		\$ 120.00	\$ 100.00
31		To putty and spray-paint of affected areas		\$ 500.00	\$ 450.00
				\$ 1,980.00	\$ 1,780.00

Total	\$ 12,057.00	\$ 11,539.00
-------	--------------	--------------



TY5 CONSULTANCY

(Registration No.: 53429875C)

Address : 50 Chin Swee Road #09-04, Thong Chai Building, Singapore 169874

Contact : +65 8788 5345 | Email Address : admin@ty5group.com.sg

Our Services : Automotive Surveying | Vehicle Valuation
Motor Claims Investigation | Evaluation & Consultation


Reference : TY5/TA/10103/6831/TP/02.22

Date : 14 May 2022

Vehicle no : FBD 6831J

ASSESSMENT SUMMARY

Damages sustained were consistent with the subject vehicle being involved in a collision with another vehicle and the impact of the collision was delivered Diagonally to the RH Side from front to rear; right to left; portion of the vehicle.

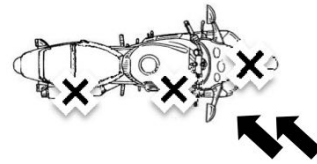

(Please refer to the list and survey photographs as attached for more information)

ASSESSMENT RECOMMENDATIONS

COST OF REPAIR

	Repairer S\$	Adjuster S\$
Parts	\$ 10,077.00	\$ 9,759.00
Labour	\$ 1,980.00	\$ 1,780.00
	<u>\$ 12,057.00</u>	<u>\$ 11,539.00</u>

TY5 Recommendation

Contract Lump Sum of \$ 9,200.00

Estimated Repair Duration : 14 working days
(excluding Sat, Sun & Public Holidays)

Enclosed No. Of Photograph : 100
(at the time of static inspection)

Our attached assessment schedule has been checked thoroughly by us against the actual damages sustained on the vehicle, and we recommend the replacement of parts and repair accordingly. We have adjusted the cost and the repairer has agreed to undertake the repair at the recommended sum to a acceptable quality and standards. We have not given authorization and instruction to the repairer to proceed with the repairs.

The survey was done on a **Without Prejudice Basis** and we are reverting the matter to you for a decision.

We thank you for engaging our services and we enclosed herewith our invoice no. 10103

TY5 CONSULTANCY

TERRENCE HONG
AUTOMOTIVE SURVEYOR

NOTE : *This revised estimate was from a visual inspection. Should there be any discrepancy or unseen items not listed in this survey, kindly notify the company via email only and follow up with a phone call, within Fourteen (14) days from the date hereof. Otherwise this revised amount shall be treated as valid.*



