

ASS. REC. BY:

REF:

C72/

F12
NumLk

Kenneth

ASSIGNMENT

From:

Date:

Estimated Cost:

OD/TP/WS/TPRES/ODRES/EVA/INV/MV

To Inspect Vehicle No:

at Workshop m/s

of

Insured:

Policy No.

Claims No.

Sum Insured:

Excess:

(Client's Record)

Make of Veh:

(Policy Condition)

Remark: The veh had commenced its
repair at the time of inspection.

Bal. or Market Value:

IDAC Accident Report:

Consistent? : Yes or No

GIA / PR Seen:

Consistent? : Yes or No

Est. Repairs:

28

Res.: Yes or No

Lum Sum:

1.B.1 %

3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date:

Person Contacted:

Vehicle: IN / OUT

Veh No:

GIBL 7433 B Yr Regn: 03.22

Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make:

Toy

Hase

c.c

2754

Colour:

Silver

A/C:

Insured / Std / NI / NA

Sp. Reading

T/Radio: Insured / Std / NI / NA

Eng/No:

C/No:

GADH 201.1067154

Gen. Cond: Good / Fair / Poor / Burnt

Steering: In order / Jammed / Leaked / Burnt or

Brake: In order / Jammed / Leaked / Burnt or

Modl: MIT / S/Rlm / STD A/Rlm or

Tyre Size:

F:

195/80R15

R:

BS / JUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /
TOYO / YOKO or

Front

R/Bal.

mm

L/Bal.

mm

D.O.A.

22/7/22

Rear

R/Bal.

mm

L/Bal.

mm

D.O.I.

16/11/2022

Survey held at

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or
& n/s body

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time

Action / Instruction

Date/Time, File Pass to?

☐

: Prell. Report

☐

: Final Report

1)

Date/Time, File Return to?

2)

Days Of Repair:

Resurvey No. of Trip:

Add Fee:

☐

: Site Insp (\$

☐

: Interview (\$

☐

Tech Invs (\$

☐

Weekend (\$

Survey Fee:

Transportation

S - RS. SI

P. 1/15

Others

Report Format :

Lump Sum / I.B.I: (\$

TOTAL

Estimate Repair

Ding Auto Pte Ltd
Sin Ming Industrial Est. Sec C, Blk
10, #01-20
575645

Insurer Reference:
Repairer Reference: 054533
Date calculated: 15/11/2022 1:35 PM



Full Report
Registration: GBL7433B
Printed: 15/11/2022 1:36 PM

Summary Information

Claim		Work Provider:	China Taiping Insurance
Location:	Singapore (SG)		(Singapore) Pte Ltd
Printed by:	Ding Auto	Currency:	SGD
Claim Reference:		Date of Incident:	22/07/22
Estimated Repair Time:	30	Hire Car Start:	
Actual Repair Days:	30	Hire Car End:	

Vehicle Details

Vehicle
Manufacturer: TOYOTA
Model: HIACE
Sub Model: BASE MODEL
Model Sheet Number: 70 E4 01
Registration: GBL7433B
VIN number:
Odometer: 0

Model Specs
2.8 LTR 130KW

WHEELBASE 2570MM

L/SLIDING DOOR

MALAYSIA VERSION

*Not Authorized
Repair Beyond
28 days*


Vehicle Condition

Vehicle Status

Pre-Accident Damage:
Date of Inspection:

Damage Areas

All ☐
Underbody ☐

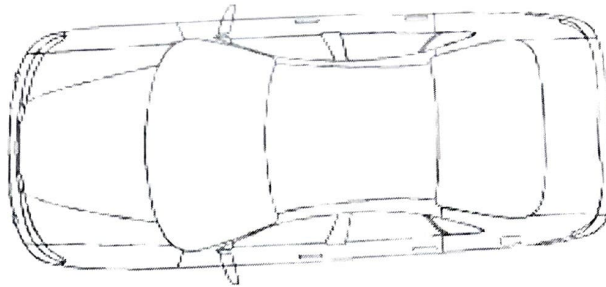

Tyres Condition

Tyre Brand	Tread (Left Middle), Tread (Left Outer), Tread (Left Inner), Tread (Right Inner), Tread (Right Outer), Tread (Right Middle), mm						Condition
	mm	mm	mm	mm	mm	mm	
Spare Tyre Brand	Tread (Spare), mm						

Labour

Code	Description	Time Base 10 WU/h	Price = 42.00 SGD/h	
			WU	Price SGD
B091	RENEW L/F WING (BUMPER AND HEADLAMP REMOVED) INCLUDES: R + R WING, CONVERT ATTACHED PARTS		7.0	29.40
B091	RENEW R/F WING (BUMPER AND HEADLAMP REMOVED) INCLUDES: R + R WING, CONVERT ATTACHED PARTS		2.0	8.40
B020)	RENEW FRONT BUMPER REINFORCEMENT		3.0	12.60
B020	RENEW FRONT BUMPER (RADIATOR GRILLE REMOVED) INCLUDES: FRONT BUMPER AND REQUIRED ATTACHED PARTS R + R		7.0	29.40
NO NUMBER	R + R L/F BUMPER MOUNTING		1.0	4.20
NO NUMBER	R + R R/F BUMPER MOUNTING		1.0	4.20
NO NUMBER	R + R CENTRE LOWER RADIATOR GRILLE		2.0	8.40
B030	R + R RADIATOR GRILLE		2.0	8.40
B040	R + R HEADLAMPS		4.0	16.80

Code	Description	WU	Price SGD
NO NUMBER 530051	(BUMPER REMOVED) INCLUDES: ADJUST HEADLAMPS R + R BONNET STAY RENEW BONNET INCLUDES: ASS ATTACHED PARTS AND IF NECE RENEW	1.0 3.0	4.20 12.60
B085	R + R COWL PANEL TRIM INCLUDES: WIPER ARMS REMOVE AND REFIT	2.0	8.40
B080 B085) B085) G010	R + R BONNET HINGE/S RENEW WINDSCREEN FRAME COVER (REMOVED) R + R WIPER MOTOR R + R WINDSCREEN	1.0 1.0 1.0 31.0	4.20 4.20 4.20 130.20
NO NUMBER B135 B125	INCLUDES: R + R WIPER ARMS, COWL GRILLE, A-PILLAR TRIMS, INSIDE MIRROR AND ALL NECESSARY ATTACHED PARTS RENEW WATER HOSE CONNECTION HOUSING RENEW FR/LWR CROSSMEMBER RENEW FRONT LOCK CARRIER	15.0 8.0 5.0 15.0	63.00 33.60 21.00 63.00
NO NUMBER 671351 NO NUMBER	RENEW L/FRT SIDE MEMBER RENEW R/FRT SIDE MEMBER R + R RIGHT FRONT DOOR SEAL RENEW L/A-PILLAR INCLUDES: R + R A-PILLAR TRIMS	15.0 4.0 62.0 62.0	63.00 16.80 260.40 260.40
NO NUMBER B194 B194 B235 B210	RENEW R/A-PILLAR INCLUDES: R + R A-PILLAR TRIMS RENEW L/STEP BOARD RENEW R/STEP BOARD RENEW L/OUTER B-PILLAR RENEW LEFT FRONT DOOR INCLUDES: R + R AND ALIGN LEFT FRONT DOOR, CONVERT ATTACHED PARTS, RENEW IF NECESSARY	10.0 11.0 63.0 23.0	42.00 46.20 264.60 96.60
B210	RENEW RIGHT FRONT DOOR INCLUDES: R + R AND ALIGN RIGHT FRONT DOOR, CONVERT ATTACHED PARTS, RENEW IF NECESSARY	23.0	96.60
(Ex: B210) B216	RENEW R/DOOR HINGES RENEW L/SLIDING DOOR INCLUDES: R + R AND ADJUST SLIDING DOOR, CONVERT ATTACHED PARTS, RENEW IF NECESSARY	1.0 18.0	4.20 75.60
NO NUMBER	RENEW L/R SIDE PANEL (REAR BUMPER REMOVED) INCLUDES: R + R TAILLAMP, FILLER NECK, ALL SEALS AND ALL TRIMS IN THE REPAIR SECTION	89.0	373.80
B380	R + R TAILGATE INCLUDES: ALIGN TAILGATE	11.0	46.20
B400 B400 B420	R + R L/TAILGATE HINGE R + R RIGHT TAILGATE HINGE RENEW REAR BUMPER INCLUDES: REAR BUMPER AND REQUIRED	1.0 1.0 5.0	4.20 4.20 21.00

Code	Description	WU	Price SGD
NO NUMBER	ATTACHED PARTS R + R		
B430	RENEW ROOF	173.0	726.60
B430)	R + R FRONT HEADLINING	7.0	29.40
B430)	R + R CENTRE HEADLINING	3.0	12.60
NO NUMBER	R + R REAR HEADLINING	3.0	12.60
M170	R + R ROOF GRAB HANDLE	2.0	8.40
M230	R + R UPPER STEERING COLUMN	7.0	29.40
	R + R INSTRUMENT PANEL	20.0	84.00
	INCLUDES: R + R STEERING WHEEL, COMBINATION SWITCH AND INSTRUMENT CLUSTER		
M230	R + R INSTRUMENT PANEL REINFORCER	7.0	29.40
M220)	RENEW HEATER BLOWER (REMOVED)	1.0	4.20
M220	R + R HEATER BLOWER	2.0	8.40
B440	R + R LEFT FRONT SEAT	3.0	12.60
M010)	R + R RADIATOR (BUMPER REMOVED)	15.0	63.00
	INCLUDES: INTERCOOLER AND ELECTRIC FAN CPL REMOVE AND REFIT. COOLING SYSTEM BLEED		
171021)	R + R AIR FILTER CPL	1.0	4.20
M150)	RENEW CHARGE AIR COOLER (REMOVED)	1.0	4.20
370011)	DETACH/REFIT PROPELLER SHAFT	4.0	16.80
370011)	R + R AXLE SHAFT	3.0	12.60
444401)	R + R POWER STEERING	7.0	29.40
	INCLUDES: BLEED POWER STEERING		
450251)	R + R LEFT TIE ROD END	1.0	4.20
450251)	R + R RIGHT TIE ROD END	1.0	4.20
420018)	R + R LEFT FRONT WHEEL	1.0	4.20
420018)	R + R RIGHT FRONT WHEEL	1.0	4.20
420018)	R + R LEFT AND RIGHT FRONT WHEEL	2.0	8.40
420091)	R + R R/F WHEEL/TYRE	2.0	8.40
430121)	R + R FRONT TORSION BAR SPRING	14.0	58.80
430121)	R + R L/F TORSION BAR SPRING	3.0	12.60
430121)	R + R R/F TORSION BAR SPRING	3.0	12.60
430011)	L/F UPP AXLE RADIUS ARM REMOVE AND REFIT	1.0	4.20
	INCLUDES: L/F LWR BALL JOINT R + R		
430011)	R/F UPP AXLE RADIUS ARM REMOVE AND REFIT	1.0	4.20
(Ex. ac	INCLUDES: R/F LWR BALL JOINT R + R		
430051)	R + R R/FR/LWR CONTROL ARM	2.0	8.40
430151)	R + R LEFT FRONT SHOCK ABSORBER	1.0	4.20
430151)	R + R RIGHT FRONT SHOCK ABSORBER	1.0	4.20
430011)	DETACH + REFIT L/F LOWER SUSPENSION ARM	2.0	8.40
430011)	DETACH + REFIT R/F LOWER SUSPENSION ARM	2.0	8.40
434211)	R + R FRONT STEERING KNUCKLE ASS WORK	2.0	8.40
434211)	R + R L/F STEERING KNUCKLE	2.0	8.40
434211)	R + R R/F STEERING KNUCKLE	4.0	16.80
420018)	R + R LEFT REAR WHEEL	4.0	16.80
420018)	R + R RIGHT REAR WHEEL	1.0	4.20
420018)	R + R REAR WHEEL	1.0	4.20
420091)	R + R RIGHT REAR TYRE/WHEEL	1.0	4.20
421051)	DETACH + REFIT REAR AXLE DRIVE SHAFT	3.0	12.60
421051)	L/R AXLE SHAFT/BEARING REMOVE AND REFIT	2.0	8.40
421051)	R/R AXLE SHAFT/BEARING REMOVE AND REFIT	6.0	25.20
480301)	DETACH + REFIT REAR SHOCK ABSORBER	6.0	25.20
		3.0	12.60

Code	Description	WU	Price SGD
480011)	R + R REAR LEAF SPRINGS (ADD/WORK)	1.0	4.20
004466)	BLEED REAR BRAKE SYSTEM	2.0	8.40
410011)	R + R REAR AXLE CPL	18.0	75.60
1004	INSTRUMENT PANEL DASHBOARD		250.00*
1007	ROOF PANEL ROOF		7 550.00*
Labour Cost			
Panel / Mechanical Labour		Hrs	WU
Fixed Rate		86.20	862.0
Total of Labour			3,620.40
			800.00
			4,420.40

Paint

Paint Work

SYSTEM AZT		Time Basis 10 WU/h	
Code	Description	WU	Price SGD
	BONNET NEW PART PAINTING	16.0	
	L/F WING NEW PART PAINTING	9.0	
	R/F WING NEW PART PAINTING	9.0	
	CTR FRT PANEL STRUT SURFACE PAINT	4.0	
	FRT PANEL C-MEMBER SURFACE PAINT	5.0	
	FRT LOCK CARRIER CPL SURFACE PAINT	4.0	
	L/F SIDE MEMBER CPL SURFACE PAINT	4.0	
	R/F SIDE MEMBER CPL SURFACE PAINT	4.0	
	WATER BOX SURFACE PAINT	4.0	
	FRT LWR CROSSMEMBER SURFACE PAINT	5.0	
	LEFT FRONT DOOR NEW PART PAINTING	14.0	
	RIGHT FRONT DOOR NEW PART PAINTING	14.0	
	L/R SLIDING DOOR NEW PART PAINTING	24.0	
	L/F STEP SURFACE PAINT	4.0	
	R/F STEP SURFACE PAINT	4.0	
	LEFT A-PILLAR NEW PART PAINTING	20.0	
	RIGHT A-PILLAR NEW PART PAINTING	20.0	
	L/OUTER B-PILLAR NEW PART PAINTING	14.0	
	L/INNER B-PILLAR SURFACE PAINT	4.0	
	ROOF NEW PART PAINTING	107.0	
	L/RR SIDE PANEL NEW PART PAINTING	43.0	
	L/CTR GUIDE RAIL NEW PART PAINTING	6.0	

Paint Material Per Part

Code	Description	Price SGD
471	BONNET NEW PART PAINTING	40.70
741	L/F WING NEW PART PAINTING	14.91
742	R/F WING NEW PART PAINTING	14.91
988	CTR FRT PANEL STRUT SURFACE PAINT	1.94
003	FRT PANEL C-MEMBER SURFACE PAINT	4.40
015	FRT LOCK CARRIER CPL SURFACE PAINT	2.64
001	L/F SIDE MEMBER CPL SURFACE PAINT	1.76
002	R/F SIDE MEMBER CPL SURFACE PAINT	1.76
11	WATER BOX SURFACE PAINT	2.64
20	FRT LWR CROSSMEMBER SURFACE PAINT	4.40
81	LEFT FRONT DOOR NEW PART PAINTING	33.45
82	RIGHT FRONT DOOR NEW PART PAINTING	33.45

Paint Material Per Part

Code	Description	Price SGD
1781	L/R SLIDING DOOR NEW PART PAINTING	66.90
2145	L/F STEP SURFACE PAINT	2.46
2146	R/F STEP SURFACE PAINT	2.46
2227	LEFT A-PILLAR NEW PART PAINTING	21.85
2228	RIGHT A-PILLAR NEW PART PAINTING	21.85
2277	L/OUTER B-PILLAR NEW PART PAINTING	10.93
2287	L/INNER B-PILLAR SURFACE PAINT	2.99
2351	ROOF NEW PART PAINTING	165.62
3481	L/RR SIDE PANEL NEW PART PAINTING	59.00
3697	L/CTR GUIDE RAIL NEW PART PAINTING	2.82

Labour Cost - Paint

Factor	42.00 SGD/h	Hrs	WU	Price SGD
Time Paint			338.0	
Preparation Main Work Metal		1.70	17.0	71.40
Total	10 WU/h	35.50	355.0	1,491.00

Material Cost - Paint

	Price SGD
New Part Painting	486.39
Surface-/Blend Paint	27.45
Material-constant Metal	18.10
Total	531.94

Spare Parts

Code	Description	Part Number	Part Source	prices as at 2015-06-01/01	Price SGD
0253	L/F BMPR BLANK CAP	53113 26060	Original	40.00	X
0254	R/F BMPR BLANK CAP	53112 26060	Original	40.00	
0257	FRONT NUMBER PLATE	KNPL3	Original	30.00	
0281	FRONT BUMPER	52119 26651	Original	280.00	
0293	L/F BUMPER COVER	52127 26120	Original	20.00	
0294	R/F BUMPER COVER	52127 26120	Original	20.00	
0317	L/F INNER COVER BRKT	52116 26170	Original	55.00	X
0318	R/F INNER COVER BRKT	52115 26170	Original	55.00	?
0331	FRT BUMPER SUPPORT	52131 26020	Original	185.00	
0341	FT BUMPER AIR GRILLE	53112 26070	Original	160.00	
0410	LWR RADIATOR GRILLE	53111 26510	Original	265.00	
0411	UPP RADIATOR GRILLE	53111 26500	Original	180.00	
0413	GRILLE BACKING	53112 26090	Original	285.00	
0431	GRILLE BADGE	90975 02086	Original	70.00	
0471	BONNET	53301 26080	Original	300.00	
0475	LEFT BONNET HINGE	53420 26040	Original	35.00	
0476	RIGHT BONNET HINGE	53410 26040	Original	35.00	
0493	BONNET LOCK	53510 0L010	Original	65.00	
0495	BONNET SUPPORT	53451 26050	Original	20.00	?
0561	LEFT HEADLAMP ASSY	81170 26731	Original	990.00	
0562	RIGHT HEADLAMP ASSY	81130 26731	Original	990.00	
0741	L/F WING	53802 26021	Original	80.00	
0742	R/F WING	53801 26011	Original	80.00	

F1
N

Code	Description	Part Number	Part Source	Price SGD
4331	INSTRUMENT PANEL	55300 26110B0	Original	580.00 ?
4411	LWR WARM AIR HOUSING	87130 26210	Original	1,950.00 ?
4931	INTERIOR MIRROR	87810 52041	Original	125.00 ✓
4933	L/SUN VISOR	74320 0L010B0	Original	95.00 x
4934	R/SUN VISOR	74310 0L010B0	Original	95.00 x
4957	HEADLINING 1	63310 0L010B0	Original	480.00 ✓
4958	HEADLINING 3	63313 26240B0	Original	990.00 ?
4959	HEADLINING 2	63312 26161B1	Original	420.00 ?
4961	FRONT ROOF LAMP	81240 12060P0	Original	50.00 x
5009	L/F ROOF GRAB HANDLE	74611 20030B8	Original	60.00 x
7049	L/UPPER CONTROL ARM	48067 29225	Original	320.00 ?
7050	R/UPPER CONTROL ARM	48066 29225	Original	320.00 ?
7054	R/LOWER CONTROL ARM	48068 26160	Original	180.00 ?
7081	L/F STEERING KNUCKLE	43212 29055	Original	280.00 ?
7082	R/F STEERING KNUCKLE	43211 29055	Original	280.00 ?
7087	L/FR SHOCK ABSORBER	48511 80107	Original	90.00 ?
7088	R/FR SHOCK ABSORBER	48511 80107	Original	80.00 ?
7202	R/FR WHEEL	42611 26152	Original	250.00 ✓
7228	R/FR TYRE	195/80 R 15 .. C	Original	300.00 ✓
7300	POWER STEERING	44200 26411	Original	1,580.00 ?
7358	INTERM FLANGE GEAR	45380 26061	Original	1,050.00 ?
7411	STEERING WHEEL COVER	45130 26390B0	Original	105.00 ?
7435	SLIP RING	84306 26120	Original	150.00 ✓
7761	RADIATOR	16400 11A40	Original	780.00 ✓
7767	FAN HOUSING	16712 75122	Original	185.00 ?
7768	FAN SHROUD	16711 30082	Original	125.00 ?
8391	AIR FILTER ASSY	17700 11A01	Original	350.00 ✓
8405	EXPANSION TANK	16470 75123	Original	90.00 ?
8739	HEAT EXCHANGER	17940 30051	Original	680.00 ?
9201	L/RR SHOCK ABSORBER	48531 80725	Original	90.00 ?
9202	R/RR SHOCK ABSORBER	48531 80725	Original	90.00 ?
9423	DIFFERENTIAL HOUSING	41101 35172	Original	5,200.00 ?
9425	REAR AXLE	42110 26510	Original	2,850.00 ?
9433	DRIVE FLANGE	41204 35082	Original	145.00 ?
9476	DRIVE SHAFT CPL	37110 26A70	Original	1,850.00 ?
9552	R/RR WHEEL	42611 26152	Original	250.00 ✓
9566	R/RR TYRE	195/80 R 15 .. C	Original	300.00 ✓
1000	DRIVER AIRBAG	AIRBAG	Original	1,250.00 ✓
1001	AIRBAG ECU	ECU	Original	920.00 ✓
1002	CONDENSOR ASSY CPL	CONDENSOR	Original	580.00 ✓
1003	HEAT EXCHANGER HSG	HEAT EXCHANGER	Original	110.00 ?
1005	FRT CROSSMEMBER	CROSSMEMBER	Original	1,390.00 ?
1006	H/LAMP HARNESS WIRE	WIRE	Original	580.00 ?
1008	SEAT BELT ASSY RH	SEAT BELT	Original	540.00 ✓
1009	SEAT BELT ASSY LH	SEAT BELT	Original	540.00 ✓

f: OEM Parts
n: Non-OEM Parts
u: Used parts

Savings	0.00
Subtotal	49,430.00
Total	49,430.00

Link Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer
Signature: _____
Date: _____

SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Actual Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT

Date of Submission	12/11/2022 11:56 (SGT)
Reported by	Driver
Date of Accident	22/07/2022 05:30 (SGT)
Exact Location of Accident	Singapore
Additional Location Information	SIMS WAY TOWARDS PIE AND KPE
Country/State of Loss	Singapore

DETAILS OF OWN VEHICLE

Vehicle Registration Number GBL7433B

INSURED/POLICYHOLDER

Is company?	Yes
Name Of Registered Owner	VAN-GO PTE LTD
Company Reg No	2XXXXX823E
Email Address	GARYONG66@ICLOUD.COM
Mobile Phone No	(Phone) +65-97458239
Alternative Phone No	-

VEHICLE PARTICULARS

Manufacturer	Toyota
Model	Hiace
Variant	-
Exact purpose for which vehicle was being used at time of accident	Employment
Are you claiming under your own insurance policy for repair to your vehicle?	Yes
Vehicle Category	Commercial vehicle
Transmission	Auto
CC	2754

INSURANCE COMPANY

Name of Insurance Company	China Taiping Insurance (Singapore) Pte. Ltd.
Policy Number / Cover Note Number	DMCVSNW00033502200

DRIVER

Name of Driver	MUHAMMAD RAFI BIN DAKIR
NRIC No	SXXXX156I
Date Of Birth	25/07/1986
Occupation	Outdoor

> Back to OneMotoring

Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars

Owner ID Type:

Owner ID:

Vehicle Details

Vehicle No.:

Vehicle to be Exported:

Intended Deregistration Date:

Vehicle Make:

Vehicle Model:

Primary Colour:

Manufacturing Year:

Engine No.:

Chassis No.:

Maximum Power Output:

Open Market Value:

Original Registration Date:

First Registration Date:

Transfer Count:

Actual ARF Paid:

Intended PARF Rebate Details

PARF Eligibility:

PARF Eligibility Expiry Date:

PARF Rebate Amount:

Intended COE Rebate Details

COE Expiry Date:

COE Category:

COE Period(Years):

QP Paid:

COE Rebate Amount:

Total Rebate Amount:

Company

823E

GBL7433B

Yes

22 Nov 2022

TOYOTA

HIACE DX 2.8 AUTO

Silver

2021

1GD8797941

GDH2011067154

-

\$33,880.00

09 Mar 2022

09 Mar 2022

0

\$1,694.00

No

-

\$0.00

08 Mar 2032

C - Goods Vehicle & Bus

10

\$44,001.00

\$35,200.00

\$35,200.00

The information contained herein is correct as at 16 Nov 2022

OK



SINGAPORE POLICE FORCE



T/20220725/7020

Police Station Of Origin:
Traffic Police
10 Ubi Avenue 3 SINGAPORE 408865
Tel No: 65470000

2 of 3

Report No. T/20220725/7020

CONTINUATION OF REPORT

Driver			
Name	MUHAMMAD RAFI BIN DAKIR	ID No.	S8620156I
Related Vehicle	GBL7433B (Van)	Contact No.	87893916
Hospital/Clinic	TAN TOCK SENG HOSPITAL	Class of Driving Licence & Expiry	Class: 2B,3,4 Date of Expiry: NIL
Date	20/07/2022	Date	25/07/2022
No. of Days granted Medical Leave	14	Degree of	Serious

Brief Details.

On the 20 July 2022@0530am,I was traveling below 45km/hr at Sims way towards PIE/KPE. There's a merging towards the PIE. I noticed a car emerging and I reacted swerve to the right to avoid collision. I hit the curb and that all I remember. I was coma for 11/2days due to the injury.

The Report

Signature Of Informant

The identity of the person making the report has been authenticated by Singapore Police Force.

Date

25/07/2022