





# TY5 CONSULTANCY

(Registration No.: 53429875C)

Address : 50 Chin Swee Road #09-04, Thong Chai Building, Singapore 169874

Contact : +65 8788 5345 | Email Address : admin@ty5group.com.sg

Our Services: *Automotive Surveying* | *Vehicle Valuation*  
*Motor Claims Investigation* | *Evaluation & Consultation*

Reference : TY5/TA/10149/3091/TP/10.22  
 Date : 20 October 2022  
 Vehicle no : PC 3091L

## ASSESSMENT SCHEDULE

<u>SN</u>	<u>Qty</u>	<u>Descriptions</u>	<u>Conditions</u>	<u>Repairer's Estimate</u>	<u>Surveyor's Revised</u>	
<u>LIST ITEMS:-</u>						
1	1 pc	rear bumper	deformed	\$ 372.50	\$ 372.50	
2	4 pcs	rear bumper support bracket @\$16.50	buckled	\$ 66.00	\$ 66.00	
3	2 pcs	rear bumper side retainer @\$38.00	necessary	\$ 76.00	\$ 76.00	
4	1 set	rear bumper clips	necessary	\$ 35.00	\$ 35.00	
5	1 pc	tailgate	buckled	\$ 1,694.20	\$ 1,694.20	
6	1 pc	tailgate logo emblem	necessary	\$ 67.10	\$ 67.10	
7	1 pc	tailgate inner lock	jammed	\$ 235.40	\$ 235.40	
8	1 pc	tailgate weatherstrip	cut	\$ 417.60	\$ 417.60	329.85
9	1 pc	tailgate outer garnish	unconfirmed	\$ 179.20	not affected	xnn
10	1 pc	rear windscreen moulding	necessary	\$ 165.00	\$ 165.00	
11	1 set	rear end panel - complete	buckled	\$ 1,337.15	\$ 1,337.15	xR
12	1 pc	rear floor panel	buckled	repair	repair	xR
13	1 pc	r/h taillamp	unconfirmed	\$ 297.20	not affected	xnn
14	1 pc	r/h taillamp filler panel	unconfirmed	\$ 69.70	not affected	xnn
		Less 25%		\$ 5,012.05	\$ 4,465.95	3040.75
					\$ 1,116.49	2280.56
				\$ 5,012.05	\$ 3,849.46	
<u>SPECIAL NETT ITEMS:-</u>						
15	1 set	reverse sensor	not working	\$ 300.00	\$ 250.00	200n
16	1 pc	tailgate "60 km/h" sticker	necessary	\$ 30.00	\$ 25.00	
17	1 pc	tailgate "emergency door" sticker	necessary	\$ 20.00	\$ 15.00	
18	1 pc	tailgate "pull to open" sticker	necessary	\$ 20.00	\$ 15.00	
19	1 roll	rear windscreen sealant	necessary	\$ 60.00	\$ 40.00	
20	1 roll	rear end panel sealant	necessary	\$ 60.00	\$ 40.00	xnn
				\$ 160.00	\$ 110.00	295
<b>Total</b>				<b>\$ 5,172.05</b>	<b>\$ 3,459.46</b>	



# TY5 CONSULTANCY

(Registration No.: 53429875C)

Address : 50 Chin Swee Road #09-04, Thong Chai Building, Singapore 169874

Contact : +65 8788 5345 | Email Address : admin@ty5group.com.sg

*Our Services : Automotive Surveying | Vehicle Valuation  
Motor Claims Investigation | Evaluation & Consultation*

Reference : TY5/TA/10149/3091/TP/10.22  
Date : 20 October 2022  
Vehicle no : PC 3091L

## ASSESSMENT SCHEDULE

<u>SN</u>	<u>Qty</u>	<u>Descriptions</u>	<u>Conditions</u>	<u>Repairer's Estimate</u>	<u>Surveyor's Revised</u>
		B/F		\$ 5,172.05	\$ 3,459.46
1		To panel beat and renewal of all necessary damaged body parts		\$ 1,400.00	\$ 1,200.00 700
2		To check wiring and rewire		\$ 60.00	\$ 50.00 30
3		To remove and reinstall tailgate components		\$ 80.00	\$ 60.00 /
4		To remove and reinstall rear windscreen		\$ 150.00	\$ 120.00 /
5		To remove and reinstall rear boot upholstery		\$ 120.00	\$ 100.00 60
6		To remove and reinstall reverse sensor		\$ 140.00	\$ 100.00 30
7		To remove and reinstall rear exhaust muffler		\$ 120.00	\$ 100.00 Xnn
8		To apply anti-rust		\$ 120.00	\$ 100.00 50
9		To putty and spray-paint of affected areas		\$ 1,000.00	\$ 800.00 600
				\$ 3,190.00	\$ 2,630.00 1650

**Total**      \$ 8,362.05      \$ 6,089.46



# TY5 CONSULTANCY

(Registration No.: 53429875C)

Address : 50 Chin Swee Road #09-04, Thong Chai Building, Singapore 169874

Contact : +65 8788 5345 | Email Address : admin@ty5group.com.sg

Our Services : *Automotive Surveying* | *Vehicle Valuation*  
*Motor Claims Investigation* | *Evaluation & Consultation*


Reference : TY5/TA/10149/3091/TP/10.22

Date : 20 October 2022

Vehicle no : PC 3091L

## ASSESSMENT SUMMARY

Damages sustained were consistent with the subject vehicle being involved in a collision with another vehicle and the impact of the collision was delivered Squarely to the Rear portion of the vehicle.

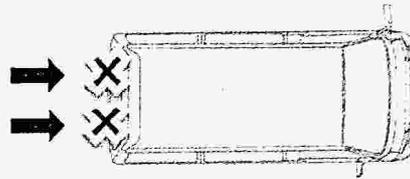

( Please refer to the list and survey photographs as attached for more information )

## ASSESSMENT RECOMMENDATIONS

### COST OF REPAIR

	Repairer S\$	Adjuster S\$
Parts	\$ 5,172.05	\$ 3,459.46
Labour	\$ 3,190.00	\$ 2,630.00
	<u>\$ 8,362.05</u>	<u>\$ 6,089.46</u>

### TY5 Recommendation

Contract Lump Sum of \$ 4,850.00

Estimated Repair Duration : 7 working days  
( excluding Sat, Sun & Public Holidays )

Enclosed No. Of Photograph : 44  
(at the time of static inspection )

Our attached assessment schedule has been checked throughly by us against the actual damages sustained on the vehicle, and we recommend the replacement of parts and repair accordingly. We have adjusted the cost and the repairer has agreed to undertake the repair at the recommended sum to a acceptable quality and standards. We have not given authorization and instruction to the repairer to proceed with the repairs.

The survey was done on a Without Prejudice Basis and we are reverting the matter to you for a decision.

We thank you for engaging our services and we enclosed herewith our invoice no. 10149

TY5 CONSULTANCY

-----  
TERRENCE HONG  
AUTOMOTIVE SURVEYOR

2280.56  
295  
1650  
-----  
4225.56  
1/3 \$ 3400  
= 6 days  
✗

NOTE: This revised estimate was from a visual inspection. Should there be any discrepancy or unseen items not listed in this survey, kindly notify the company via email only and follow up with a phone call, within Fourteen (14) days from the date hereof. Otherwise this revised amount shall be treated as valid.