



## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

### TAX INVOICE

LONPAC INSURANCE BHD  
300 BEACH ROAD  
#17-04/07 THE CONCOURSE  
SINGAPORE 199555

INV No. AC2304895  
INV Date 01/08/2023  
Reference CC4/LPC22011977/Rpa3q2  
Code LPC2

#### PROFESSIONAL SERVICE FEE

Vehicle No. SNG 8106Z  
Insured Veh. SJG 1824C  
Claim No. 2/22/22/VP05/026638  
Policy No. Z22VP05031578  
Accident Date 28/11/2022  
Inspection Date 02/12/2022

Description	Total
Third Party Express Settlement	400.00
<b>Subtotal</b>	<b>400.00</b>
<b>GST (8%)</b>	<b>32.00</b>
<b>Grand Total</b>	<b>432.00</b>

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

**LKM**



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

## Affiliated to Federation Internationale Des Experts En Automobile

LONPAC INSURANCE BHD

300 BEACH ROAD

#17-04/07 THE CONCOURSESINGAPORE 199555

Ref: CC4/LPC22011977/Rpa3q2

Date: 01/08/2023

Code: LPC2

### 1. Policy Particulars :- THIRD PARTY CLAIM

<b>Insured Veh.</b>	SJG 1824C	<b>Veh. Inspected</b>	SNG 8106Z
<b>Policy No.</b>	Z22VP05031578	<b>Coverage (\$)</b>	0.00
<b>Claim No.</b>	2/22/22/VP05/026638	<b>Excess (\$)</b>	0.00
<b>Assign From</b>	CHARMAINE KONG	<b>Assign Date</b>	29/11/2022

### 2. Vehicle Particulars & Condition

<b>Make &amp; Model</b>	B.M.W. X1 SDRIVE 18I LED HL	<b>c.c</b>	1499
<b>Engine No.</b>	HIDDEN	<b>Year of Reg.</b>	2022
<b>Chassis No.</b>	WBA32AA0905U97755	<b>Colour</b>	BLACK
<b>Odometer</b>	02013 KM	<b>Steering</b>	IN ORDER
<b>Brakes</b>	IN ORDER	<b>Modification</b>	SPORTS RIM
<b>General</b>	FAIR		

### 3. Conditions of Tyres

	Size	Make	Balance
<b>R/H Front Tyre</b>	225/50 R18	BRIDGESTONE	6 mm
<b>L/H Front Tyre</b>	225/50 R18	BRIDGESTONE	6 mm
<b>R/H Rear Tyre</b>	225/50 R18	BRIDGESTONE	6 mm
<b>L/H Rear Tyre</b>	225/50 R18	BRIDGESTONE	6 mm

### 4. Description of Damages

THE VEHICLE SUSTAINED DAMAGES AT THE REAR N/S PORTION.  
DAMAGES SEE DETAILS.

### 5. General Information

<b>Accident Date</b>	28/11/2022	<b>Inspection Date</b>	02/12/2022
<b>Survey held at</b>	PERFORMANCE MOTORS LTD 303 ALEXANDRA ROAD SINGAPORE 159941		

### 5a. Remarks

A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS.  
B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.

### 5b. Estimate Days of Repair

ESTIMATED NORMAL PERIOD FOR REPAIR: **6 Working Days**



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

## ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SNG 8106Z

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
<b>REPLACEMENT OF PARTS</b>				
1	SUNDRIES (SN)	NECESSARY	150.00	150.00
1	RR SILENCER CLAMPING BUSH (SN)	NECESSARY	64.35	64.35
1	TAILPIPE TRIM BRIGHT CHROME (SN)	NOT NECESSARY	125.55	-
1	REAR SILENCER (SN)	BENT	1,108.15	1,108.15
1	RP PETROL PARTICULATE FILTER (RDE) (SN)	BENT	2,235.50	2,235.50
1	REAR BUMPER TRIM PANEL (X LINE) (SN)	SCRATCHED	231.70	231.70
1	REAR LH BUMPER MOUNT (SN)	NOT NECESSARY	166.90	-
1	REAR RH BUMPER MOUNT (SN)	NOT NECESSARY	166.90	-
1	RR BUMPER CARRIER (SN)	NOT NECESSARY	523.75	-
1	MOUNTING SMART OPENER (SN)	NOT NECESSARY	47.00	-
1	REAR BUMPER PANEL PRIMED (SN)	TO REPAIR SEE LABOUR	926.75	-
1	REAR BUMPER MIDDLE TRIM PANEL (PDC) (SN)	DEFORMED	272.45	272.45
1	REAR BUMPER TOWING EYE COVER (SN)	NOT NECESSARY	37.70	-
1	GASKET RING (SN) (ADDITIONAL)	NECESSARY	31.05	31.05
1	V BAND CLAMP (SN) (ADDITIONAL)	NECESSARY	44.40	44.40
1	HOLDER EXHAUST SYSTEM (SN) (ADDITIONAL)	NECESSARY	30.30	30.30
1	RP CATALYTIC CONVERTER NEAR ENGINE (SN) (ADDITIONAL)	BENT	2,113.30	2,113.30
1	STEERING BOX HEAT RESISTANT PLATE (SN) (ADDITIONAL)	NECESSARY	66.65	66.65
1	REAR TRIM UNDERRIDE PROTECTION (X L) (SN) (ADDITIONAL)	SCRATCHED	151.10	151.10
15	EXPANDING RIVET BLACK (SN) (ADDITIONAL)	NECESSARY	21.00	21.00
			<b>8,514.50</b>	<b>6,519.95</b>
<b>LABOUR</b>				
TO REPLACE RP PETROL PARTICULATE FILTER INCLUDE ALIGNMENT OF SYSTEM AND CONDUCTING CHECKS FOR HARMFUL POLLUTENTS.(ADDITIONAL)			631.00	631.00
TO REPLACE RP CATALYTIC CONVERTER NEAR ENGINE INCLUDE ALIGNMENT OF SYSTEM AND CONDUCTING CHECKS FOR LEAK.(ADDITIONAL)			504.00	504.00



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	TO REPLACE REAR BUMPER AND MAKE GOOD TAIL END PANEL.INCLUSIVE OF THE REPAIR OF REAR BUMPER PANEL PRIMED .		3,400.00	1,700.00
	TO RESPRAY REAR BUMPER AND TAIL END PANEL.		1,781.00	986.00
	TO CARRY OUT BODY CAVITY PRESERVATION (PER PANEL).	NOT NECESSARY	118.00	-
	TO REMOVE OLD PDC ASSEMBLY ,REPLACE DAMAGED PARTS AND RECONNECT TO NEW BUMPER INCLUDING CONDUCT CHECK FOR PROPER FUNCTION.		177.00	168.00
	TO CHECK ELECTRICAL WIRING.		177.00	168.00
	TO REPLACE REAR EXHAUST SILENCER INCLUDING ALIGNMENT SYSTEM AND CONDUCT CHECK FOR LEAK.		531.00	504.00
	TO REPLACE FRONT EXHAUST SILENCER INCLUDING ALIGNMENT SYSTEM AND CONDUCT CHECK FOR LEAK.	NOT NECESSARY	531.00	-
			7,850.00	4,661.00
	<b>GRAND TOTAL</b>		<b>16,364.50</b>	<b>11,180.95</b>
<b>RECOMMENDED COST OF REPAIRS</b>				<b>11,180.95</b>

Report Ref No. CC4/LPC22011977/Rpa3q2

MOHAMMED RASUL BIN MOHD YUNUS

Automotive Assessor

HO LEONG CHUAN

Automotive Assessor

**DISCLAIMER OF LIABILITY TO THIRD PARTIES:-** This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



# LKK Auto Consultants Pte Ltd



51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

## PHOTOGRAPHS FOR VEHICLE NO. SNG 8106Z

## INSPECTION

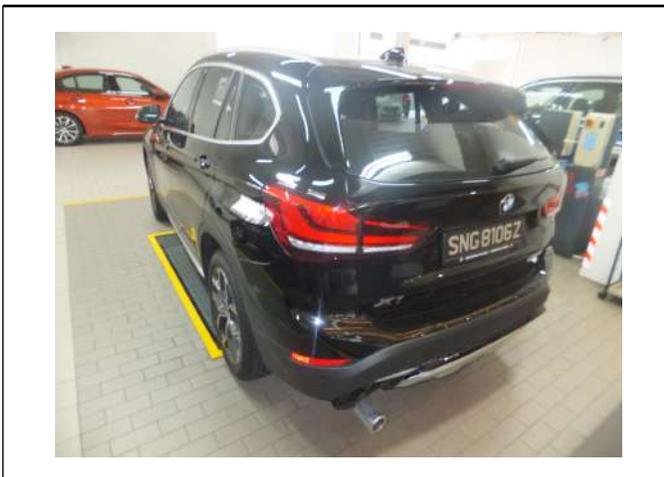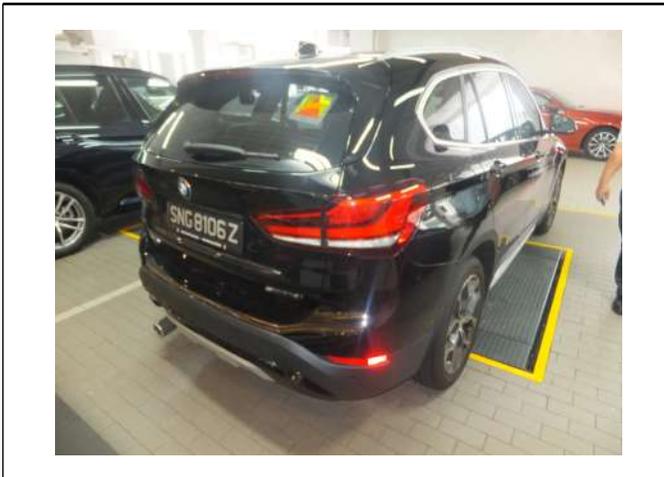



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

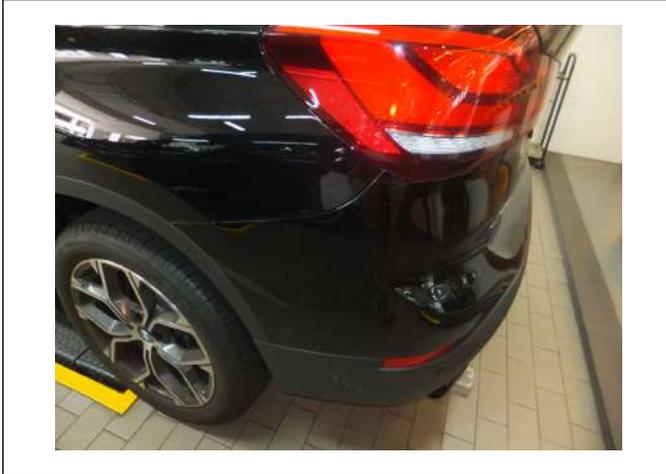



## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





# LKK Auto Consultants Pte Ltd





51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SNG 8106Z

RE-INSPECTION

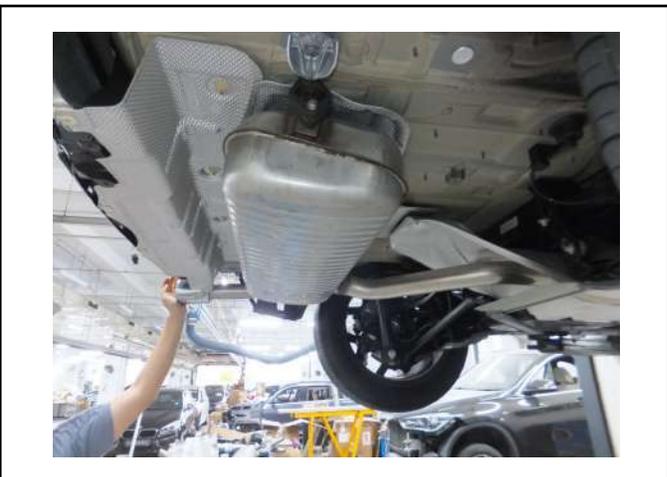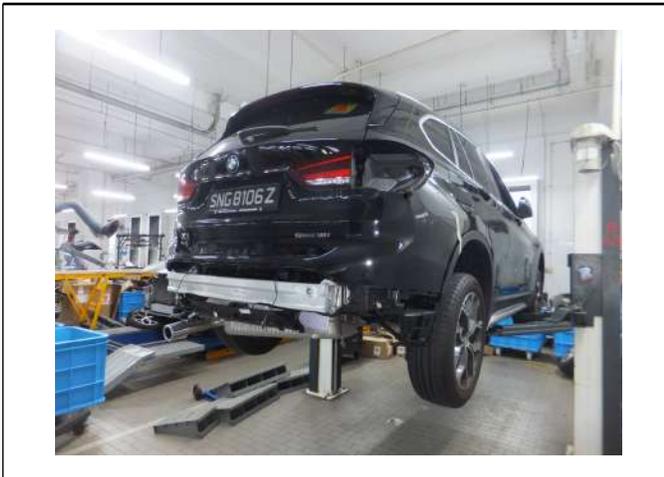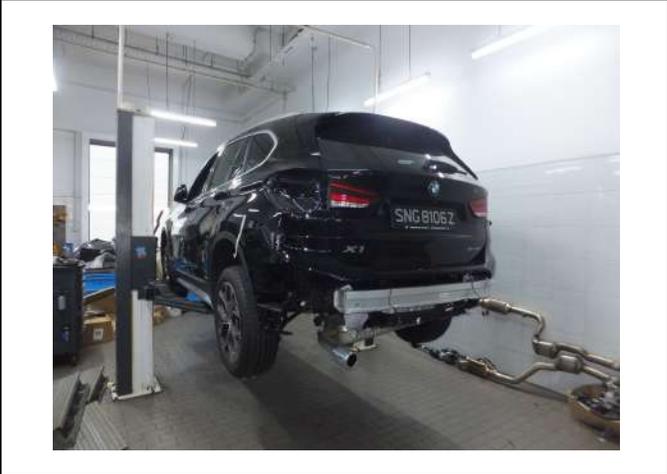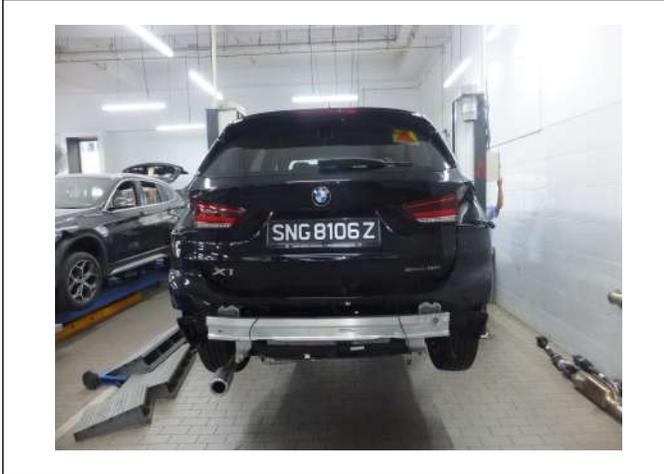




# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

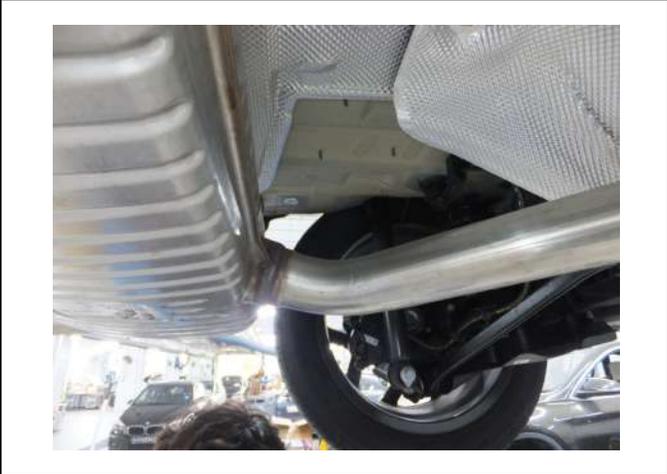



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

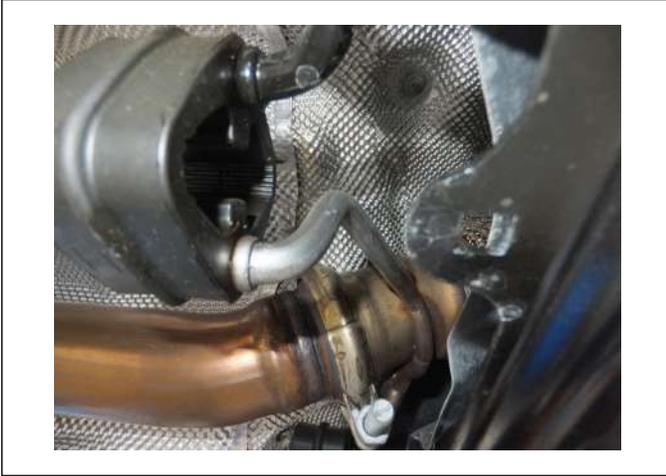



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





# LKK Auto Consultants Pte Ltd


51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

## PHOTOGRAPHS FOR VEHICLE NO. SNG 8106Z

## RE-INSPECTION

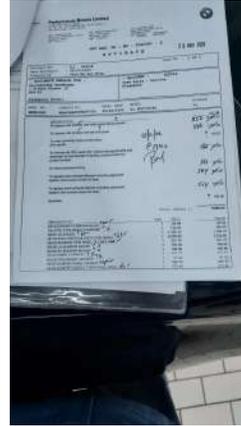



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

