

ASS. REC. BY:

REF:

TH 1/22012002/KCP

C

Kenneth

ASSIGNMENT

From: _____ Date: _____

Estimated Cost: _____

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No: _____

at Workshop m/s _____

of _____

Insured: _____

Policy No. _____

Claims No. _____

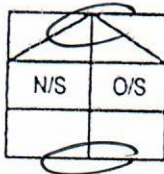
Sum Insured: _____

Excess: _____

(Client's Record)

Make of Veh: _____

(Policy Condition)

Remark: The veh had commenced its
repair at the time of inspection.

Bal. or Market Value: _____

IDAC Accident Rpt: _____

Consistent? : Yes or No

GIA / PR Seen: _____

Consistent? : Yes or No

Est. Repairs: _____

3

days

Res.: _____

Yes or No

Lum Sum: _____

1-B.1

%

3 Val.: _____

Yes or No

CA / REV / REP. / 24 HRS

Date: _____

Person Contacted: _____

Vehicle: IN / OUT

Veh No: _____

SHC 56596

Yr Regn: _____

08, 21

Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Traller or

Make: _____

Toyota Prius

c.c

1798

Colour _____

M.P. White / Red

A/C: _____

Insured / Std / NI / NA

Sp. Reading _____

223245

T/Radio: _____

Insured / Std / NI / NA

Eng/No: _____

C/No: _____

JTDKB 3FU 903092450

Gen. Cond: Good / Fair / Poor / Burnt

Steering: In order / Jammed / Leaked / Burnt or

Brake: In order / Jammed / Leaked / Burnt or

Modi: Nil / S/Rlm / STD A/Rlm or

Tyre Size: _____

Greenlander 195/65R15

R: Sailun

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or

Front

Rear

R/Bal. _____

9

mm

R/Bal. _____

9

mm

L/Bal. _____

9

mm

L/Bal. _____

9

mm

D.O.A. _____

27/11/22

D.O.I. _____

30/11/2022

Survey held at _____

Des. of Damages: Frt / Rear / O/S / N/S / UIC / Rooftop or

& 1st

The UIC / Chassis frame / Body Structure affected due to collision.

Date / Time

Action / Instruction

1 Got BZ

6/12

85537-10 Cabri

Date/Time, File Pass to?



: Prel. Report

1)



: Final Report

Date/Time, File Return to?

Days Of Repair: _____

Resurvey No. of Trip: _____

Survey Fee: _____

Transportation: _____

S - RS. SI

Fees

Others

TOTAL

Report Format :

Lump Sum / I.B.I. (\$) _____

Add Fee: _____



: Site Insp (\$ _____)



: Interview (\$ _____)



: Tech Invs (\$ _____)



: Weekend (\$ _____)

Trans-cab Auto Services Pte Ltd

No. 2 Ang Mo Kio Street 63 Singapore 569111

Tel No. : 6287 6666 Fax No. : 6257 1330

CO./GST Reg. No. 201019626G

SHC5659G*Not Notified
Permy B4 paint***85537.10****AAD2211-**

Vehicle No.:

Chassis No.:

Co UEN:

Vehicle Make:

Vehicle Model:

Date of Accident :

Third Party Insurer :

Date of Registration:

30 NOV 2022**SHC5659G**

JTDKB3FU903092450

200303878K

TOYOTA

PRIUS **GEN 4**

27/11/2022

SMV6264X/III

31/08/2021

	PART
1	COVER, REAR BUMPER
1	REINFORCEMENT SUB-ASSY, REAR BUMPER
1	COVER, REAR BUMPER, LOWER
1	GUARD, REAR BUMPER, CENTER
1	RETAINER, REAR BUMPER SIDE, LH
1	RETAINER, REAR BUMPER SIDE, RH
1	REFLECTOR ASSY, REFLEX, LH
1	REFLECTOR ASSY, REFLEX, RH
1	PANEL SUB-ASSY, BACK DOOR
1	PLATE, LUGGAGE COMPARTMENT DOOR NAME, NO.2
1	PLATE, BACK DOOR NAME, NO.1
1	ORNAMENT SUB-ASSY, BACK DOOR
1	GARNISH SUB-ASSY, BACK DOOR, OUTSIDE
1	BOARD ASSY, BACK DOOR TRIM
1	WEATHERSTRIP, BACK DOOR
1	COVER, FLOOR UNDER, NO.1 LH
1	COVER, FLOOR UNDER, NO.2 RH
1	COVER, REAR FLOOR CTR
1	COVER, DECK TRIM, REAR
1	PANEL SUB-ASSY, BODY LOWER BACK
1	STAY ASSY, BACK DOOR, LH
1	STAY ASSY, BACK DOOR, RH
1	HINGE ASSY, BACK DOOR, LH
1	HINGE ASSY, BACK DOOR, RH
1	COVER, FRONT BUMPER
1	COVER, FRONT BUMPER HOLE, LH
1	COVER, FRONT BUMPER HOLE, RH

	LIST
\$	Bu 485.60 ✓
\$	Bu 332.70 ✓
\$	mis 22.00 ✓
\$	Bu 374.50 ✓
\$	Bu 132.60 X
\$	Bu 132.60 X
\$	Bu 39.00 X
\$	Bu 39.00 X
\$	R 1,147.80 X
\$	ru 54.60 X
\$	ru 54.60 X
\$	ru 47.90 X
\$	Bu 913.60 X
\$	Bu 259.20 X
\$	Bu 372.30 X
\$	Bu 175.10 X
\$	Bu 241.90 X
\$	CM 229.90 ✓
\$	Bu 126.70 X
\$	R 651.00 X
\$	Bu 242.50 X
\$	Bu 242.50 X
\$	R 61.00 X
\$	R 61.00 X
\$	Bu 521.00 ✓
\$	mis 30.20 ✓
\$	mis 30.20 ✓

Trans-cab Auto Services Pte Ltd

No. 2 Ang Mo Kio Street 63 Singapore 569111

Tel No. : 6287 6666 Fax No. : 6257 1330

CO./GST Reg. No. 201019626G

SHC5659G

- 1 MOULDING, FRONT BUMPER SIDE, RH
- 1 MOULDING, FRONT BUMPER SIDE, LH
- 1 UNIT ASSY, HEADLAMP, LH
- 1 UNIT ASSY, HEADLAMP, RH
- 1 CLEANER ASSY, AIR
- 1 HOOD SUB-ASSY
- 1 HINGE ASSY, HOOD, LH
- 1 HINGE ASSY, HOOD, RH
- 1 LOCK ASSY, HOOD
- 1 BRACKET, FRONT BUMPER EXTENSION MOUNTING
- 1 REINFORCEMENT SUB-ASSY, FRONT BUMPER
- 1 ABSORBER, FRONT BUMPER ENERGY
- 1 CONDENSER ASSY, COOLER
- 1 GRILLE SUB-ASSY, RADIATOR
- 1 GRILLE, RADIATOR, LOWER NO.1
- 1 EMBLEM ASSY, MOULDING
- 1 EMBLEM ASSY, RADIATOR GRILLE

\$	Rn	95.60	X
\$	Rn	95.60	X
\$	Rn	2,637.60	X
\$	my cm	2,637.60	2
\$	Rn	1,147.00	X
\$	Rn	983.10	X
\$	Rn	58.90	X
\$	Rn	58.90	X
\$	Rn	135.00	X
\$	Rn	110.50	X
\$	Rn	716.60	✓
\$	Rn	80.20	X
\$	Rn	1,783.20	X
\$	dist Rn	422.50	✓
\$	Rn	178.60	X
\$	Rn	160.50	X
\$	Rn	105.80	X
TOTAL	\$	18,428.20	
25%	\$	4,607.05	
	\$	13,821.15	

Special Nett

- 1SET PARKING AID
- 1SET REAR BUMPER CLIP
- 2 WINDSCREEN SEALANT
- 1 WINDSCREEN MOULDING
- 1 WINDSCREEN INNER SPONGE SEAL
- 1 REAR TAILGATE STICKER "Trans-Cab"
- 1 REAR TAILGATE STICKER "6555-3333"
- 1 REAR BUMPER PROTECTOR
- 1SET REAR BUMPER RETAINER CLIP
- 1 END PANEL TRIM CLIP
- 1SET BUMPER CLIP FRT
- 1 FRONT NUMBER PLATE WITH MOULDING
- 1 REAR NUMBER PLATE WITH MOULDING
- 1SET FRNT BUMPER RETAINER CLIP

\$	Rn	700.00	X
\$	Rn	95.00	60sn
\$	Rn	150.00	X
\$	Rn	200.00	X
\$	Rn	130.00	X
\$	Rn	80.00	X
\$	Rn	80.00	X
\$	Rn	180.00	X
\$	Rn	85.00	X
\$	Rn	65.00	X
\$	Rn	95.00	60sn
\$	Rn	200.00	45sn
\$	Rn	200.00	X
\$	Rn	85.00	X
TOTAL	\$	2,345.00	

Trans-cab Auto Services Pte Ltd

No. 2 Ang Mo Kio Street 63 Singapore 569111

Tel No. : 6287 6666 Fax No. : 6257 1330

CO./GST Reg. No. 201019626G

SHC5659G**AAD2211-****TOTAL PARTS \$ 16,166.15****LABOUR**

To Remove And Refit Rear Big and Small W/Screen Glass To Facilitate Bodywork Repair.	\$	nn 300.00 X
To remove and refit interior fittings, trimings, garnish, fittings and other, to enable repair.	\$	nn 380.00 X
Panel Beating, Knocking And Straightening The Necessary Portion, Remove And Renewal Of Parts, Adjust And Realign The Same	\$	2,200.00 500
To transfer of rear end panel fittings, attachment and perform water seepage test.	\$	nn 380.00 X
To transfer of Tailgate fittings, attachments and perform water seepage test.	\$	z 180.00 X
To remove and refit electrical wiring, battery and other necessary items to facilitate bodywork repair.	\$	h 480.00 X
To transfer of Fender fittings, attachments and perform water seepage test.	\$	h 480.00 X
To dismantle and refit aircon assy and attachment, vacuum and charge-in-gas.	\$	h 380.00 X
Labour charge to mount and dismount vehicle on jig bench, to facilitate repair.	\$	h 380.00 X
To check steering geometry and computer wheel alignment	\$	h 220.00 X
To Rust-Proofing and apply undercoat Of The Affected Areas.	\$	nn 250.00 X

Trans-cab Auto Services Pte Ltd

AAD2211-

No. 2 Ang Mo Kio Street 63 Singapore 569111

Tel No. : 6287 6666 Fax No. : 6257 1330

CO./GST Reg. No. 201019626G

SHC5659G

Towing Fees	\$	nn	150.00	X
Putty And Spray Painting Of The Affected Portion.	\$		2,200.00	4401
To reinstall rear bumper parking sensor.	\$		170.00	501
To Check Electrical Lighting Concerned.	\$		170.00	301
To transfer of luggage floor panel fittings, attachment and perform water seepage test.	\$	nn	380.00	X
To transfer of tire, rim and on wheel balancing.	\$	nn	220.00	X
To replace, refix and top up coolant for radiator	\$	nn	170.00	X
To conduct and perform a comprehensive vehicle diagnostic check and reset vehicle warning indicators.	\$	nn	380.00	X

TOTAL \$ 9,470.00**Over All Total** \$ 25,636.15**(PART-BY-PART) Repair Days** 3 DAYS

- LKK Auto Consultants** hence notify the Repairer of the following:
- To resurvey before/alter spray painting
 - To display damaged part(s) during resurvey
 - Parts prices are subject to confirmation
 - Third party survey is on a "Without Prejudice" basis
 - No illegal modification(s) is allowed
 - Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

> Back to OneMotoring

Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars

Owner ID Type:

Company

Owner ID:

878K

Vehicle Details

Vehicle No.:

SHC5659G

Vehicle to be Exported:

Yes

Intended Deregistration Date:

28 Nov 2022

Vehicle Make:

TOYOTA

Vehicle Model:

PRIUS 5DR HATCHBACK (AUTO)

Primary Colour:

Red

Manufacturing Year:

2020

Engine No.:

2ZR2H09480

Chassis No.:

JTDKB3FU903092450

Maximum Power Output:

90.0 kW (120 bhp)

Open Market Value:

\$26,807.00

Original Registration Date:

31 Aug 2021

First Registration Date:

31 Aug 2021

Transfer Count:

0

Actual ARF Paid:

\$7,030.00

Intended PARF Rebate Details

PARF Eligibility:

Yes

PARF Eligibility Expiry Date:

30 Aug 2029

PARF Rebate Amount:

\$5,272.00

Intended COE Rebate Details

COE Expiry Date:

30 Aug 2029

COE Category:

A - Car up to 1600cc & 97kW (130bhp)

COE Period(Years):

8

PQP Paid:

\$37,087.00

COE Rebate Amount:

\$29,669.00

Total Rebate Amount:

\$34,941.00

Message

Please note that the 8-year COE for this vehicle cannot be further renewed. The vehicle must be de-registered upon COE expiry or when the vehicle reaches its statutory lifespan (if applicable), whichever is earlier.

The information contained herein is correct as at 28 Nov 2022

OK