

08/11/13) Wef
ASS. REC. BY: PM

REF: CS/AIS 22012022/Rwy3

3110

ASSIGNMENT

From: _____ Date: _____

Estimated Cost: _____

☒ OD / ☐ TP / ☐ WS / ☐ TP RES / ☐ OD RES / ☐ EVA / ☐ INV / ☐ MV

To inspect Vehicle No: XE 3164E

at Workshop n/s SNH MH TEC

of PIONEER RD RD NORTH

Insured: AB

Policy No. _____

Claims No. _____


Sum Insured: _____ Excess: 1500

(Client's Record)

Make of Veh: _____

(Policy Condition)

Remark: The veh had commenced its
repair at the time of inspection.

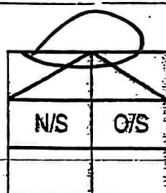

Bal. or Market Value: 89K

IDAC Accident Report: _____ Consistent? : Yes or No

GIA / PR Seen: _____ Consistent? : Yes or No

Est. Repairs: _____ days Res.: Yes or No

Lump Sum: _____ % 3 Val.: Yes or No

CA / ☒ REV / REP. / 24 HRS

Date: _____ Person Contacted: _____

Vehicle: IN / OUT

Date / Time Action / Instruction

REPAIR LIMIT - 82K

Veh No: XE 3164E Yr Regn: 2017 July

Type: ☐ M/Car / ☐ M/Cycle / ☐ Bus / ☐ Van / ☐ Lorry / ☐ Taxi / ☐ Prime Mover /

☒ Truck / ☐ Trailer or

Make: MITSUBISHI FUSO FFS180 cc 11967

Colour: ORANGE A/C: ☐ Insured / ☐ Std / ☐ Nil / ☐ NA

Sp. Reading: _____ T/Radio: ☐ Insured / ☐ Std / ☐ Nil / ☐ NA

Eng No: _____

C/No: PPS18DA 20198

Gen. Cond: ☒ Good / ☐ Fair / ☐ Poor / ☐ Burnt

Steering: ☒ In order / ☐ Jammed / ☐ Leaked / ☐ Burnt or

Brake: ☒ In order / ☐ Jammed / ☐ Leaked / ☐ Burnt or

Modi: ☒ M / ☐ S/Rim / ☐ STD A/Rim or

Tyre Size: F: 295/80R22.5
R: _____

BS / ☐ DUN / ☐ EXNOVA / ☐ GY / ☐ FS / ☐ LIZA / ☐ MIC / ☐ OHTSU / ☐ PIR / ☐ SUMI /

TOYO / YOKO or

LIH LONG

Front

R/Bal: 8 mm R/Bal: 8/8 mm

L/Bal: 8 mm L/Bal: 8/8 mm

D.O.A. 23/11/22

D.O.I. 01/12/22

Survey held at SNH MH TEC

Des. of Damages: ☒ Fnd / ☐ Rear / ☐ O/S / ☐ N/S / ☐ U/C / ☐ Rooftop or

The U/C / Chassis frame / Body Structure affected due to collision.

Date/Time, File Pass to?

☐ : Prefi. Report

☐ : Final Report

1) _____
Date/Time, File Return to?

2) _____

Days Of Repair: _____

Resurvey No. of Trip: _____

Survey Fee: _____

Transportation: _____

S + RS _____ \$

Photos _____

Others _____

Add Fee: ☐ : Site Insp (\$ _____)

☐ : Interview (\$ _____)

☐ : Tech. Invs (\$ _____)

☐ : Weekend (\$ _____)

Report Format : _____

Lump Sum / I.B.I.: (\$ _____)

Sng Ah Tee Motor & Panel Service Pte Ltd (Co.Reg.No:200810440N)

Blk 3 Pioneer Road North, #01-18

Singapore 628457

Tel: 6268 6183 Fax: 6268 1429 Email: sngahtee@singnet.com.sg; darren@sngahtee.com; janice@sngahtee.com

INSURER: Allianz Insurance Singapore Pte. Ltd. (HQ)**PARTICULARS OF CLAIM**

Claim Type:	OD (OWN DAMAGE)	Ref. No:	
Policy No:	SPCM1000000828	Date of Loss:	23/11/2022
Vehicle Reg. No.:	XE3164E	Driveable?	
Driver Age/Info:	30 / MALE	Party At Fault:	UNKNOWN
TP Injury Involved?	NO	Third Party Involved?	YES
Insured/Claimant:	DYNA-LOG SINGAPORE PTE. LTD.	Contact No:	+6596662345
Driver:	LOW JOON JIANG, ADRIAN		

Make/Model:	mitsubishi fuso, 12.0 D FP51SDR3VDEA (M)	Vehicle Reg. Date:	05/07/2017
Vehicle Colour:	WHITE	Chassis No:	FP51SDA20198
Engine No:	OM457332835		
Odometer:	5 KM		

Paint Type:	
Total Loss?	NO
Est. Duration of Repair (day)	25

Description of Accident/Loss	ON 23/11/2022 @
Present Location:	SNG AH TEE MOTOR & PANEL SERVICE PTE LTD (PIONEER)

COST OF CLAIMS	Amount
Parts	95,337.40
Miscellaneous Items	0.00
Labour	7,660.00
Paintwork Labour	0.00
Towing	0.00
Gross Total (\$\$)	102,997.40
+ GST 7.00% (\$\$)	7,209.82
Nett Amount (\$\$)	110,207.22

This claim is handled by: JANICE CHANG SIEW YIN

Generated using Merimen e-Claims Internet Estimation & Adjusting System

REPAIR DETAILS

Reference

Part Source:	(Last Synchronised: 01 Dec 2022)	
Parts:	N/A	MITSUBISHI FUSO 12.0 D FP51SDR3VDEA (M) (Model not available in database)
Labour:	Repairer's	(Price-denominated Standard List)
Print Code:	(Unsubmitted, no print-code for XE3164E)	
Validity:	These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page	
Further Info:	Items/values not in reference catalogue are prefixed with an asterisk *.	

Estimates on Parts

No.	Qty	Part No.	Particulars	%Disc	%Depr	Amount
1	1		*FRT PANEL <i>buc</i>	0.00	0.00	*2,800.00 F
2	2		*FRT PANEL HINGE <i>bro</i>	0.00	0.00	*410.00 F
3	1		*FRT PANEL GRILLE TOP <i>cm</i>	0.00	0.00	*225.00 F
4	1		*FRT PANEL GRILLE BOTTOM <i>dis</i>	0.00	0.00	*230.00 F
5	1		*FRT PANEL FUSO STICKER <i>re</i>	0.00	0.00	*120.00 F
6	1		*FRT PANEL AIR GUIDE	0.00	0.00	*75.00 F
7	1		*FRT PANEL LOCK (CTR) <i>bt</i>	0.00	0.00	*170.00 F
8	1		*FRT PANEL LOCK CABLE	0.00	0.00	*200.00 F
9	1		*FRT PANEL LOCK HANDLE	0.00	0.00	*145.00 F
10	2		*FRT PANEL LOCK (SIDE) <i>bt</i>	0.00	0.00	*290.00 F
11	2		*FRT PANEL LOCK LATCH <i>bt</i>	0.00	0.00	*80.00 F
12	1		*FRT PANEL LOCK LATCH (CTR) <i>bt</i>	0.00	0.00	*55.00 F
13	2		*FRT PANEL LIFTER <i>bt</i>	0.00	0.00	*360.00 F
14	1		*FRT WIPER PANEL <i>bt</i>	0.00	0.00	*270.00 F
15	2		*FRT WIPER PANEL HANDLE	0.00	0.00	*320.00 F
16	1		*FRT WIPER LINKAGE ASSY <i>bt</i>	0.00	0.00	*420.00 F
17	1		*FRT WIPER MOTOR	0.00	0.00	*480.00 F
18	3		*FRT WIPER ARM	0.00	0.00	*480.00 F
19	3		*FRT WIPER BLADE	0.00	0.00	*84.00 F
20	1		*FRT WINDSCREEN <i>bro</i>	0.00	0.00	*1,900.00 F
21	1		*FRT WINDSCREEN RUBBER <i>re</i>	0.00	0.00	*580.00 F
22	1		*ERP BRACKET STICKER <i>re</i>	0	0.00	*10.00 FS
23	1		*ERP BRACKET <i>re</i>	0.00	0.00	*40.00 F
24	1		*FRT WINDSCREEN PILLAR(LH) <i>repair</i>	0.00	0.00	*680.00 F
25	1		*FRT WINDSCREEN PILLAR INNER TRIM(LH) ?	0.00	0.00	*130.00 F
26	1		*FRT WINDSCREEN INNER PILLAR ?	0.00	0.00	*750.00 F
27	1		*FRT CORNER PANEL (LH) <i>mis</i>	0.00	0.00	*650.00 F
28	1		*FRT CORNER PANEL LAMP (LH) <i>mis</i>	0.00	0.00	*220.00 F
29	1		*FRT CORNER PANEL BRACKET (LH) <i>bt</i>	0.00	0.00	*150.00 F
30	1		*FRT CORNER PANEL SEAL (LH) <i>re</i>	0.00	0.00	*120.00 F
31	1		*SIDE MIRROR ROUND LH <i>mis</i>	0.00	0.00	*120.00 F
32	1		*SIDE MIRROR ARM LH <i>repair</i>	0.00	0.00	*385.00 F
33	1		*FRT CORNER PANEL (RH) <i>cm</i>	0.00	0.00	*650.00 F
34	1		*FRT CORNER PANEL BRACKET (RH) ?	0.00	0.00	*150.00 F
35	1		*FRT CORNER PANEL SEAL (RH) <i>re</i>	0.00	0.00	*120.00 F
36	1		*FRT HEADLAMP RH	0.00	0.00	*1,700.00 F
37	1		*FRT HEADLAMP BRACKET RH	0.00	0.00	*400.00 F
38	1		*FRT STEP GARNISH TOP	0.00	0.00	*320.00 F
39	1		*FRT WHEEL ARCH GARNISH RH <i>dis/cm</i>	0.00	0.00	*470.00 F
40	1		*FRT WHEEL ARCH PROTECTOR RH <i>dis</i>	0.00	0.00	*250.00 F
41	1		*FRT DOOR RH <i>repair</i>	0.00	0.00	*2,200.00 F
42	1		*FRT DOOR TRIMBOARD RH ?	0.00	0.00	*350.00 F
43	2		*FRT DOOR HINGE RH	0.00	0.00	*260.00 F
44	1		*FRT DOOR CHECKER RH	0.00	0.00	*85.00 F
45	1		*FRT DOOR RUBBER RH <i>re</i>	0.00	0.00	*190.00 F

Report was unsubmitted during this print-out.
Generated using Merimen e-Claims IEAS

No.	Qty	Part No.	Particulars	%Disc	%Depr	Amount
46	1		*FRT DOOR INNER MOULDING RH <i>2 X</i>	0.00	0.00	*180.00 F
47	1		*FRT DOOR GLASS REGULATOR RH <i>X</i>	0.00	0.00	*270.00 F
48	1		*FRT DOOR INNER LOCK RH <i>?</i>	0.00	0.00	*255.00 F
49	1		*FRT STEP GARNISH LH <i>crn</i>	0.00	0.00	*320.00 F
50	1		*FRT STEP GARNISH BRACKET LH <i>bt</i>	0.00	0.00	*390.00 F
51	1		*FRT STEP ALLOY CTR (LH) <i>X</i>	0.00	0.00	*145.00 F
52	1		*FRT STEP ALLOY TOP (LH) <i>su</i>	0.00	0.00	*150.00 F
53	1		*FRT WHEEL ARCH GARNISH LH <i>crn</i>	0.00	0.00	*470.00 F
54	1		*FRT WHEEL ARCH PROTECTOR LH <i>turn</i>	0.00	0.00	*250.00 F
55	1		*FRT DOOR COMPLETE ASSY LH <i>buc</i>	0.00	0.00	*4,600.00 F
56	1		*FRT DOOR INNER MOULDING <i>?</i>	0.00	0.00	*180.00 F
57	1		*FRT WHEEL ARCH PANEL LH <i>di</i>	0.00	0.00	*650.00 F
58	1		*FRT WHEEL SCUFF PLATE LH <i>?</i>	0.00	0.00	*195.00 F
59	1		*FRT WHEEL MUDGUARD LH <i>?</i>	0.00	0.00	*490.00 F
60	1		*FRT DOOR REAR PANEL LH <i>buc</i>	0.00	0.00	*1,450.00 F
61	1		*FRT DOOR REAR PANEL INNER TRIM <i>?</i>	0.00	0.00	*350.00 F
62	1		*ENGINE INSULATOR LH <i>X</i>	0.00	0.00	*290.00 F
63	1		*ENGINE INSULATOR REAR <i>X</i>	0.00	0.00	*240.00 F
64	1		*FRT INNER PANEL <i>bt</i>	0.00	0.00	*850.00 F
65	1		*FRT INNER PANEL REINFORCEMENT <i>bt</i>	0.00	0.00	*2,300.00 F
66	1		*FRT SUPPORT PANEL <i>bt</i>	0.00	0.00	*370.00 F
67	1		*FRT WASHER TANK <i>X</i>	0.00	0.00	*290.00 F
68	1		*COOLANT TANK <i>?</i>	0.00	0.00	*320.00 F
69	1		*COOLANT SECONDARY TANK <i>?</i>	0.00	0.00	*300.00 F
70	1		*COOLANT HOSE <i>?</i>	0.00	0.00	*150.00 F
71	1		*COOLANT RETURN HOSE <i>?</i>	0.00	0.00	*90.00 F
72	6		*BRAKE HOSE <i>?</i>	0.00	0.00	*600.00 F
73	6		*BRAKE HOSE CONNECTOR <i>?</i>	0.00	0.00	*240.00 F
74	1		*FRT CABIN SUPPORT BEAM <i>?</i>	0.00	0.00	*2,820.00 F
75	2		*FRT CABIN SUPPORT BEAM BRACKET <i>?</i>	0.00	0.00	*4,200.00 F
76	2		FRT CABIN SUPPORT BRACKET <i>?</i>			
77	2		*FRT CABIN AIR BELLOW <i>?</i>	0.00	0.00	*800.00 F
78	2		*FRT CABIN SHOCKABSORBER <i>bt</i>	0.00	0.00	*540.00 F
79	2		*FRT CABIN SHOCKABSORBER BUSH <i>?</i>	0.00	0.00	*90.00 F
79	1		*FRT CABIN HYDRAULIC LIFTER <i>?</i>	0.00	0.00	*2,900.00 F
80	1		*FRT CABIN HYDRAULIC LIFTER BRACKET <i>?</i>	0.00	0.00	*140.00 F
81	2		*FRT CABIN TOP BRACKET <i>?</i>	0.00	0.00	*1,100.00 F
82	2		*FRT HORN <i>su</i>	0.00	0.00	*160.00 F
83	1		*AIRCON COOLING COIL ASSY <i>?</i>	0.00	0.00	*1,600.00 F
84	1		*AIRCON BLOWER ASSY <i>?</i>	0.00	0.00	*900.00 F
85	1		*AIRCON HEATER COIL ASSY <i>?</i>	0.00	0.00	*1,300.00 F
86	1		*AIRCON CONNECT DUCT <i>?</i>	0.00	0.00	*300.00 F
87	1		*AIRCON BLOWER OUTER TRIM <i>?</i>	0.00	0.00	*220.00 F
88	1		*AIRCON COOLING COIL OUTER TRIM <i>?</i>	0.00	0.00	*210.00 F
89	1		*AIRCON SUCTION HOSE <i>?</i>	0.00	0.00	*260.00 F
90	1		*AIRCON PRESSURE HOSE <i>?</i>	0.00	0.00	*295.00 F
91	1		*AIRCON CONDENSER <i>?</i>	0.00	0.00	*400.00 F
92	1		*TURBO INTER COOLER <i>?</i>	0.00	0.00	*4,500.00 F
93	1		*TURBO INTER COOLER INLET HOSE <i>?</i>	0.00	0.00	*350.00 F
94	1		*TURBO INTER COOLER OUTLET HOSE <i>?</i>	0.00	0.00	*355.00 F
95	1		*RADIATOR <i>bt</i>	0.00	0.00	*5,200.00 F
96	1		*RADIATOR TOP HOSE <i>?</i>	0.00	0.00	*270.00 F
97	1		*RADIATOR FAN COWLING <i>?</i>	0.00	0.00	*400.00 F
98	1		*RADIATOR FAN BLADE <i>?</i>	0.00	0.00	*495.00 F
99	1		*RADIATOR FAN CLUTCH <i>?</i>	0.00	0.00	*650.00 F
100	1		*RADIATOR FAN RING <i>?</i>	0.00	0.00	*330.00 F
101	1		*RADIATOR FAN COWLING SEAL <i>?</i>	0.00	0.00	*290.00 F
102	15		*COOLANT <i>he</i>	0	0.00	*300.00 FS
103	1		*FRT WIRE HARNESS <i>?</i>	0.00	0.00	*1,600.00 F

2/1/22, 1:52 PM

Estimate Report

No.	Qty	Part No.	Particulars	%Disc	%Depr	Amount
104	1		*REAR CABIN SUPPORT BEAM (TOP) ?	0.00	0.00	*780.00 F
105	1		*REAR CABIN BRACKET (BOTTOM) ?	0.00	0.00	*2,200.00 F
106	2		*REAR CABIN AIR BELLOW ?	0.00	0.00	*740.00 F
107	1		*REAR CABIN LOCK ?	0.00	0.00	*400.00 F
108	2		*REAR CABIN STOPPER ?	0.00	0.00	*180.00 F
109	2		*REAR CABIN STOPPER BRACKET ?	0.00	0.00	*480.00 F
110	1		*REAR WINDSCREEN X	0.00	0.00	*450.00 F
111	1		*REAR WINDSCREEN RUBBER X	0.00	0.00	*220.00 F
112	1		*REAR PANEL INNER TRIM X	0.00	0.00	*400.00 F
113	1		*DASHBOARD de / ?	0.00	0.00	*900.00 F
114	1		*DASHBOARD BEAM ?	0.00	0.00	*650.00 F
115	1		*DASHBOARD SPEEDOMETER ?	0.00	0.00	*2,000.00 F
116	1		*DASHBOARD SPEEDOMETER TRIM ?	0.00	0.00	*215.00 F
117	1		*DASHBOARD SPEEDOMETER TRIM COVER ?	0.00	0.00	*170.00 F
118	1		*RADIO ?	0	0.00	*280.00 FS
119	1		*RADIO OUTER TRIM ?	0.00	0.00	*200.00 F
120	1		*FUSE BOX ASSY ?	0.00	0.00	*520.00 F
121	1		*GEAR KNOB CONSOLE ?	0.00	0.00	*2,400.00 F
122	2		*GEAR ROD ?	0.00	0.00	*360.00 F
123	2		*GEAR BUSH ?	0.00	0.00	*50.00 F
124	1		*GEAR KNOB CONSOLE TRIM ?	0.00	0.00	*340.00 F
125	1		*STEERING UNDER COVER ?	0.00	0.00	*130.00 F
126	1		*STEERING COLUMN COVER ?	0.00	0.00	*270.00 F
127	1		*PASSENGER SEAT ASSY ?	0.00	0.00	*950.00 F
128	1		*FRT FLOOR MAT ASSY ?	0.00	0.00	*480.00 F
129	2		*AIRCON DUCT SIDE ?	0.00	0.00	*240.00 F
130	1		*AIRCON DUCT CTR ?	0.00	0.00	*165.00 F
131	1		*DASHBOARD WIRE HARNESS ?	0.00	0.00	*1,100.00 F

F=Franchise part. S=SpcNett.

Sub Total (\$\$)	86,724.00
+ Margin on L,N Items 10.00% (\$\$)	8,613.40
Total Parts (\$\$)	95,337.40

Report was unsubmitted during this print-out.
Generated using Merimen e-Claims IEAS

Estimates on Miscellaneous Items

There are no new miscellaneous items selected.

Estimates on Labour

No	Particulars	Lab.Type	Amount
<u>Labour Items</u>			
1	TO LIFT UP CABIN <i>photo?</i>	New	<i>300</i> 500.00
2	TO KNOCK, WELD, REMOVE & FIX ABOVE PARTS	New	<i>2100</i> 3,000.00
3	TO PUTTY & RESPRAY PAINTING ON AFFECTED AREA	New	<i>2000</i> 2,800.00
4	TO REMOVE & REPLACE DASHBOARD	New	<i>200</i> 280.00
5	TO REMOVE & FIX SEATS <i>photo</i>	New	<i>200?</i> 250.00
6	TO REMOVE & FIX FLOOR MAT	New	<i>80</i> 100.00
7	TO REMOVE TRIMS, CABIN INTERIORS	New	<i>100</i> 150.00
8	TO REMOVE & FIX FRT WINDSCREEN	New	120.00
9	TO REMOVE & FIX DOOR GLASS	New	80.00
10	TO CHECK WIRING	New	<i>80</i> 180.00
11	TO TOP UP AIRCON GAS	New	100.00
12	TO REMOVE & FIX REAR WINDSCREEN	New	100.00

Gross Labour Cost (\$\$) 7,660.00

Report was unsubmitted during this print-out.
Generated using Merimen e-Claims IEAS

< END OF ESTIMATES >

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

Same
Hp 90010068
12 days
L/S
01/12/22 @ 1650
EXCESS
1500
Reuter
Rog after repair

SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Actual Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT

Date of Submission	24/11/2022 11:50 (SGT)
Reported by	Driver
Date of Accident	23/11/2022 14:50 (SGT)
Exact Location of Accident	Tuas View Cres, Singapore
Additional Location Information	-
Country/State of Loss	Singapore

DETAILS OF OWN VEHICLE

Vehicle Registration Number	XE3164E
-----------------------------	---------

INSURED/POLICYHOLDER

Is company?	Yes
Name Of Registered Owner	DYNA-LOG SINGAPORE PTE. LTD.
Company Reg No	2XXXXX311D
Email Address	calvinlim@dyna-log.com.sg
Mobile Phone No	(Phone) +65-96662345
Alternative Phone No	(Office) +65-67779315

VEHICLE PARTICULARS

Manufacturer	Mitsubishi
Model	Fuso
Variant	FP51SDR3VDEA
Exact purpose for which vehicle was being used at time of accident	-
Are you claiming under your own insurance policy for repair to your vehicle?	Yes
Vehicle Category	Commercial vehicle
Transmission	Auto
CC	11967

INSURANCE COMPANY

Name of Insurance Company	Allianz Insurance Singapore Pte. Ltd.
Policy Number / Cover Note Number	SPCM1000000828

DRIVER

Name of Driver	LOW JOON JIANG, ADRIAN
NRIC No	SXXXX982Z
Date Of Birth	25/09/1992
Occupation	Outdoor

Date Of Driving Pass	27/06/2018
Driving experience	4 YEARS AND 5 MONTHS
Gender	Male
Mobile Number	(Phone) +65-91072387
Alt. Phone Number	-
Email Address	calvinlim@dyna-log.com.sg
Address	BLK 451A BUKIT BATOK WEST AVENUE 6 #12-703
Address complement	-
Postcode	651451
Is the driver the policyholder?	No
If No, Relationship of the Driver with the Insured	Employee
Does Driver Own Other Vehicles?	No
Vehicle Registration Number of Other Vehicle Owned by Driver	-
Insurance Company of Other Vehicle Owned by Driver	-

GENERAL INFORMATION OF THE ACCIDENT

Type of Accident	Collided into Parked Vehicle
Weather Conditions	Clear
Road Surface	Dry

OTHER INFORMATION

Was any foreign vehicle involved in the accident?	No
Number of vehicles involved in the accident	2
Was anybody injured in the Accident?	No
Was any injured conveyed to hospital by ambulance?	-
Was any other vehicle or property damaged?	Yes
Number of Passengers (Including Driver)	1
Has the driver been approached by unknown person(s) soliciting/offering accident claims assistance?	No
Translator's name	-
Translator's ID	-
Translator's phone number	-
Translator's email	-
Original language used in the statement	-

DETAILS OF POLICE ACTION

Was the accident reported to the police?	No
Was notice of intended Prosecution given?	No
If yes, against whom?	-

CIRCUMSTANCES OF ACCIDENT

ON 23/11/2022 @ ABT 1450HRS. I WAS DRIVING MY COMPANY PRIME MOVER WITH ENGAGE A 40FT TRAILER WITH EMPTY CONTAINER ALONG TUAS VIEW CRESCENT. THERE ARE A LOT OF EMPTY TRAILER/LOW BED WERE PARKER AT THE PARKING LOT. AS THE LOW BED IS BIG & HAD OVER THE PARKING LOT, SO I HAVE TO TRAVEL IN MIDDLE. WHEN I SAW THERE IS AN ONCOMING VEHICLE X FROM OPPOSITE DIRECTION, I THEN SWERVE MY VEHICLE TO LEFT TO AVOID THE COLLISION. AFTER THE VEHICLE X PASSBY, I THEN INTEND TO SWERVE MY VEHICLE TO RIGHT & CONTINUE MY JOURNEY. HOWEVER, WHEN I SWERVE MY VEHICLE TO RIGHT, I HAD ACCIDENTALLY KNOCKED ONTO THE PARKED LOW BED(TRA3817Y). THE IMPACT CAUSING MY VEHICLE BADLY DAMAGE AT FRONT PORTION. I AM LODGING THIS REPORT FOR INSURANCE CLAIM PURPOSE. THAT'S ALL.

ATTACHMENT(S)

Are accident photos available for attachment?	Yes
Was there any video captured by Car Camera?	No

DETAILS OF OTHER VEHICLE PROPERTY 1

Vehicle Registration Number	TRA3817Y
Vehicle Manufacturer	-

Vehicle Model	-
Vehicle Variant	-
Vehicle Colour	-
Vehicle Category	Commercial vehicle
Name of Driver	-
Contact Number	-
Address	-
Address complement	-
Postcode	-
Insurance Company Name	-
Nature Of Damage	-
Details of property damaged in accident	-
No. Of Passenger (Including Driver)	-

SKETCH PLAN

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Actual Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Traffic Police Department for investigation.
6. This report will be forwarded by the insurers to the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

8. Consent under the Personal Data Protection Act (PDPA)

I understand, acknowledge, agree and consent that:

- (a) My insurer, my workshop and the General Insurance Association of Singapore ("GIA") may/are permitted to collect, use, disclose and/or process my personal data/personal information set out in this (form) and any other personal information provided by me or possessed by my insurer (collectively the "Personal Information") and disclose and transfer such Personal Information to all insurer(s) who have insured vehicle(s) involved in this accident (all insurer(s) who have insured vehicle(s) involved in this accident shall be collectively referred to as the "Insurers"), the Insurers' lawyers/law firms, the Monetary Authority of Singapore and any relevant government agency/authority (such as the police), for the purpose(s) of:
- (i) processing, handling and/or dealing with my claims including the settlement of the claims and any necessary investigations relating to the claims;
- (ii) investigating the accident and/or my claims;
- (iii) carrying out and/or dealing with my instructions or responding to any enquiries by me;
- (iv) administering my claims (including the mailing of correspondence, statements, invoices, reports or notices to me, which could involve disclosure of certain personal data about me to bring about delivery of the same as well as on the external cover of envelopes/mail packages); and/or
- (v) complying with applicable law in administering, processing, handling and/or dealing with my claims.
- (collectively the "Purposes")
- (b) all insurer(s) who have insured vehicle(s) involved in this accident and the Insurers' lawyers/law firms, may/are permitted to collect, use, disclose and/or process my Personal Information for one or more of the above Purposes; and
- (c) my Personal Information may/can be disclosed by any of the Insurers and/or GIA to their third-party service providers or agents (including their lawyers/law firms), which may be sited outside of Singapore, for one or more of the above Purposes.



Policyholder's Signature / Date & Time

Actual Driver's Signature (if driver is not the policyholder) / Date & Time

Witnessed by Reporting Centre Personnel
(Name as in NRIC/ID card)

Sketch Plan

Tuan View Crescent

WL P: XE3164 E

VA P: TRA 3817 Y
(Luv Red)

1 Jun 2022

Describe Circumstance of the Accident

On 23/11/2022 @ abt 1450hrs I was driving my company prime mover with engage a 40ft trailer with empty container along Tuss View Crescent. There are a lot of empty trailer / low bed was parked at the parking lot. As the low bed is big & had over the parking lot, so I have to travel in middle. When I saw there is an oncoming vehicle X from opposite direction I then swerve my vehicle to left to avoid the collision. After the vehicle X passby, I then intend to swerve my vehicle to right & continue my journey. However, when I swerve my vehicle to right, I had accidentally knocked onto the parked low bed (TRASSIAY). The impact causing my vehicle badly damage at front portion. I am lodging this report for insurance claim purpose. That's all.

☐ Claim own policy
☐ Claim third party
☐ Claim OD / TP at other workshop
☐ For record purpose
 Policy No. SPCM1000000838
 Insurer Allianz Veh No. XE3164E

I AM AWARE THAT MY INSURER MAY HAVE A 14 DAYS TIMEFRAME FOR ME TO SUBMIT MY OWN DAMAGE CLAIM UNDER MY POLICY. I WILL CHECK MY POLICY FOR MORE DETAILS.

Declaration

I/We declare the foregoing particulars are true in every respect.



Policyholder's Signature Date & Time

Driver's Signature (if driver is not the policyholder) / Date & Time

Jan

SNG AN TEE MOTOR & PANEL SVC PTE LTD

Witnessed by Reporting Centre Personnel
(Name as in NRIC/ID card)

' > Back to OneMotoring

Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars

Owner ID Type:	Company
Owner ID:	311D

Vehicle Details

Vehicle No.:	XE3164E
Vehicle to be Exported:	No
Intended Deregistration Date:	30 Nov 2022
Vehicle Make:	MITSUBISHI
Vehicle Model:	FUSO FP51SDR3VDEA
Primary Colour:	White
Manufacturing Year:	2017
Engine No.:	OM457332835
Chassis No.:	FP51SDA20198
Maximum Power Output:	-
Open Market Value:	\$87,935.00
Original Registration Date:	05 Jul 2017
First Registration Date:	05 Jul 2017
Transfer Count:	1
Actual ARF Paid:	\$4,397.00

Intended PARF Rebate Details

PARF Eligibility:	No
PARF Eligibility Expiry Date:	-
PARF Rebate Amount:	\$0.00

Intended COE Rebate Details

COE Expiry Date:	04 Jul 2027
COE Category:	C - Goods Vehicle & Bus
COE Period(Years):	10
PQP Paid:	\$13,791.00
COE Rebate Amount:	\$6,335.00
Total Rebate Amount:	\$6,335.00

The information contained herein is correct as at 24 Nov 2022

OK