



6 tampines st 73, #01-03, singapore 528825
 tel: 6746 2118 fax: 6746 1148
 reg no: 53058468m

Claim Reference : -
 Insured Vehicle No. : -
 Thirty Party Veh No. : -
 Officer-In-Charge : -

Our Reference : KAAS/TA/6439/9985/TP/07.22
 Date : 11 September 2022

To: Zhang Liang
 c/o 1 Bukit Batok Crescent
 #02-13/14, Wcega Plaza
 Singapore 658064

VEHICLE APPRAISAL REPORT

Name of Workshop : Garage Star Pte Ltd
 Place of inspection : 1 Bukit Batok Crescent #02-13/ 14, Wcega Plaza, Singapore 658064
 Date of Assignment : 01 August 2022
 Date of Accident : 30 July 2022
 Date of Inspection : 01 August 2022

PARTICULARS OF INSPECTED VEHICLE

Registration No. : **SNE 9985G** Chassis Frame No. : VF1RFB00655649392
 Make / Model : Renault Megane GT 1.6 TCE AT EU6 Engine No. (Logcard) : M5MB450N011154
 Year of Manufacture/Reg : 2017 Odometer Reading : 105,949 KM
 Colour : Blue
 Class / Type : Hatchback

CONDITION OF VEHICLE DURING SURVEY (Visual & Static Check Only)

General Condition : Very Good
 Paintwork : Very Good
 Market Value : -
 Scrap Value : -

Items indicated as nil mostly no damage seen from photos.

CONDITION OF TYRES ON VEHICLE

	Make/Size	Thread Balance
Front L	GOODYEAR 225 / 40 R18	7 mm
Front R	GOODYEAR 225 / 40 R18	7 mm
Rear L	GOODYEAR 225 / 40 R18	7 mm
Rear R	GOODYEAR 225 / 40 R18	7 mm

boot lock not given as condition. As Jan. 17

Jan then need to cut open. boot to open.

*The above is an estimate of the remaining life of the tyre thread in millimeters

The information contained in these documents may be privileged and confidential, and is intended for the exclusive use of the addressee designation. If you are not the addressee, any enclosure, reproduction, distribution or other dissemination or use of this communication is strictly prohibited. If you have received this survey report in error, please contact us immediately by phone so that we can arrange for its return.



6 tampines st 73, #01-03, singapore 528825
 tel: 6746 2118 fax: 6746 1148
 reg no: 53058468m

Our Reference : KAAS/TA/6439/9985/TP/07.22
 Vehicle Number : SNE 9985G

APPRAISEMENT SCHEDULE

S/N	Qty	Descriptions	Conditions	Repairer's Estimate	Revised Amount
LIST ITEMS:-					
1	1 pc	rear bumper	deformed	\$ 1,200.00	\$ 1,200.00
2	1 pc	rear bumper lower cover	broken	\$ 1,150.00	\$ 1,150.00
3	1 pc	rear bumper sponge	broken	\$ 320.00	\$ 320.00
4	1 pc	rear bumper reinforcement	buckled	\$ 720.00	\$ 720.00
5	1 pc	rear bumper tow hook cover	dislodged	\$ 85.00	reuse
6	1 pc	rear bumper ctr bracket	broken	\$ 285.00	\$ 285.00
7	2 pcs	rear bumper side bracket @\$285.00	necessary	\$ 570.00	\$ 570.00
8	2 pcs	rear bumper side retainer @\$76.00	necessary	\$ 152.00	\$ 152.00
9	1 set	rear bumper clips	necessary	\$ 35.00	\$ 35.00
10	4 pcs	reverse sensor @\$260.00 <i>185.w x 4</i>	not working	\$ 1,040.00	\$ 1,040.00
11	1 pc	reverse sensor wire harness	damaged	\$ 480.00	\$ 480.00
12	1 pc	l/h exhaust chrome	scratched	\$ 550.00	\$ 550.00
13	1 pc	tailgate	broken	\$ 2,400.00	\$ 2,400.00
14	1 pc	tailgate logo emblem	necessary	\$ 220.00	\$ 220.00
15	1 pc	tailgate "renault" emblem	necessary	\$ 180.00	\$ 180.00
16	1 pc	tailgate "sport" emblem	necessary	\$ 180.00	\$ 180.00
17	1 pc	tailgate "gt" emblem	necessary	\$ 120.00	\$ 120.00
18	1 pc	tailgate inner handle switch	not working	\$ 175.00	\$ 175.00
19	1 pc	tailgate inner lock	jammed	\$ 280.00	\$ 280.00
20	1 pc	tailgate inner trim board	unconfirmed	\$ 700.00	not affected
21	10 pcs	rear boot painted clips @\$15.00	necessary	\$ 150.00	\$ 150.00
22	1 pc	tailgate r/h lamp	broken	\$ 480.00	\$ 480.00
23	1 pc	tailgate weatherstrip	deformed	\$ 360.00	\$ 360.00
24	1 pc	l/h taillamp	cracked	\$ 580.00	\$ 580.00
25	1 pc	r/h taillamp	cracked	\$ 580.00	\$ 580.00
26	1 pc	rear end panel - outer	buckled	\$ 850.00	\$ 850.00
27	1 pc	rear end panel - inner	buckled	\$ 879.00	\$ 879.00
28	1 pc	rear end panel top garnish	deformed	\$ 320.00	\$ 320.00
29	1 pc	spare tyre panel	broken	\$ 1,800.00	\$ 1,800.00
		Less 10%		\$ 16,841.00	\$ 16,056.00
				\$ 16,841.00	\$ 14,450.40
SPECIAL NETT ITEMS:-					
30	1 pc	rear no. plate	buckled	\$ 60.00	\$ 50.00
31	1 pc	rear no. plate frame	deformed	\$ 35.00	\$ 35.00
				\$ 95.00	\$ 85.00
Sub - Total				\$ 16,936.00	\$ 14,535.40

Handwritten notes and corrections:
 ✓ 980.00
 ✓ 495.00
 ✓ 156.00
 ✓ 550.00
 ✓ 245.00
 ✓ 740.00
 ✓ 1392.00
 ✓ 162.00
 ✓ 145.00
 ✓ 145.00
 ✓ 180.00
 ✓ 112.00
 ✓ 883.00

Handwritten calculations:
 7720.w
 6948.w =

Handwritten calculation:
 45.w =

Handwritten note:
 345/-



6 tampines st 73, #01-03, singapore 528825
 tel: 6746 2118 fax: 6746 1148
 reg no: 53058468m

Our Reference : KAAS/TA/6439/9985/TP/07.22
 Vehicle Number : SNE 9985G

APPRAISEMENT SCHEDULE

S/N	Qty	Descriptions	Conditions	Repairer's Estimate	Revised Amount
		B/F		\$ 16,936.00	\$ 14,535.40
		LABOUR & OTHER CHARGES:-			
1		To panel beat and renewal of all necessary damaged body parts		\$ 1,600.00	\$ 1,400.00
2		To check wiring and rewire		\$ 60.00	\$ 50.00
3		To remove and reinstall tailgate components		\$ 80.00	\$ 60.00
4		To remove and reinstall rear windscreen		\$ 150.00	\$ 120.00
5		To remove and reinstall rear boot upholstery		\$ 120.00	\$ 100.00
6		To remove and reinstall reverse sensor		\$ 140.00	\$ 100.00
7		To apply anti-rust		\$ 100.00	\$ 80.00
8		To putty and spray-paint of affected areas		\$ 1,200.00	\$ 1,000.00
				\$ 3,450.00	\$ 2,910.00
			1970.00 =		
				45	8963.00
					7,100/-
					7 dgs.
		Sub - Total		\$ 20,386.00	\$ 17,445.40

800/-
 30/-
 ✓
 ✓
 800/-
 40/-
 40/-
 800/-




6 tampines st 73, #01-03, singapore 528825
 tel: 6746 2118 fax: 6746 1148
 reg no: 53058468m

Our Reference : KAAS/TA/6439/9985/TP/07.22
 Vehicle Number : SNE 9985G

ASSESSMENT SUMMARY

Damages sustained were consistent with the subject vehicle being involved in a collision with another vehicle and the impact was delivered **Squarely to the Rear** portion of the vehicle.

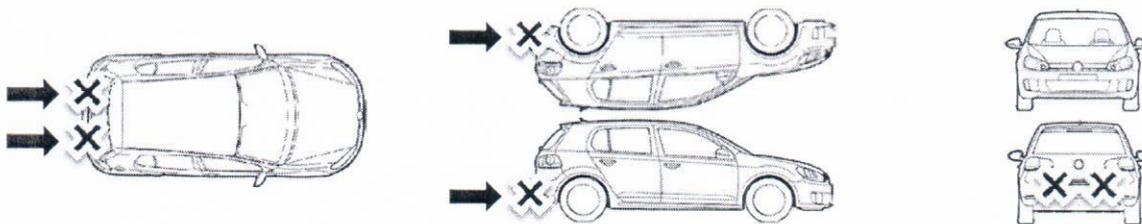

The general area of damages is at the **Rear portion**
 (Please refer to the parts list and photographs as attached for more information)

ASSESSOR'S RECOMMENDATIONS

The estimated repair costs submitted by Messrs **Garage Star Pte Ltd** is \$ 20,386.00 .
 We have adjusted the cost to \$ 17,445.40 and the repairer has agreed to undertake the repairs at a **Contract Lump Sum of \$ 14,000.00** to a acceptable quality and standards.

However, we have not given authorization and instruction to the repairer to proceed with the repairs.

The repairs should be completed within a reasonable period of **8** working days.

76 photographs were taken at the time of static inspection.

This report is strictly done in a **Without Prejudice Basis**.

We are reverting the matter to you a decision.

We enclose herewith our Invoice No. **6439** for our services rendered and we thank you for engaging our services.

KELVIN AUTOMOTIVE APPRAISING SERVICES

KELVIN TEO
 Licensed Automotive Appraiser
 Nitec in Automotive Technology
 Cert. Crash Investigation & Reconstruction
 Dip MS
 MSAAA, AM SAE-A

NOTE : This revised estimate was from a visual inspection. Should there be any discrepancy or unseen items not listed in this survey, kindly notify the company within Seven (7) days from the date hereof. Otherwise this revised amount shall be treated as valid.