



Claim Reference : -  
Insured Vehicle No. : -  
Thirty Party Veh No. : -  
Officer-In-Charge : -

Our Reference : KAAS/TA/6439/9985/TP/07.22  
Date : 11 September 2022

To: Zhang Liang  
c/o 1 Bukit Batok Crescent  
#02-13/14, Wcega Plaza  
Singapore 658064

## VEHICLE APPRAISAL REPORT

Name of Workshop : Garage Star Pte Ltd  
Place of inspection : 1 Bukit Batok Crescent #02-13/ 14, Wcega Plaza, Singapore 658064  
Date of Assignment : 01 August 2022  
Date of Accident : 30 July 2022  
Date of Inspection : 01 August 2022

### **PARTICULARS OF INSPECTED VEHICLE**

Registration No.	: SNE 9985G	Chassis Frame No.	: VF1RFB00655649392
Make / Model	: Renault Megane GT 1.6 TCE AT EU6	Engine No. ( Logcard )	: M5MB450N011154
Year of Manufacture/Reg	: 2017	Odometer Reading	: 105,949 KM
Colour	: Blue		
Class / Type	: Hatchback		

### **CONDITION OF VEHICLE DURING SURVEY (Visual & Static Check Only)**

General Condition : Very Good  
Paintwork : Very Good  
Market Value : -  
Scrap Value : -

### **CONDITION OF TYRES ON VEHICLE**

	<u>Make/Size</u>	<u>Thread Balance</u>
Front L	GOODYEAR 225 / 40 R18	7 mm
Front R	GOODYEAR 225 / 40 R18	7 mm
Rear L	GOODYEAR 225 / 40 R18	7 mm
Rear R	GOODYEAR 225 / 40 R18	7 mm

\*The above is an estimate of the remaining life of the tyre thread in millimeters

*The information contained in these documents may be privileged and confidential, and is intended for the exclusive use of the addressee designation. If you are not the addressee, any enclosure, reproduction, distribution or other dissemination or use of this communication is strictly prohibited. If you have received this survey report in error, please contact us immediately by phone so that we can arrange for its return.*

### APPRAISEMENT SCHEDULE


S/N	Qty	Descriptions	Conditions	Repairer's Estimate	Revised Amount
<b>LIST ITEMS:-</b>					
1	1 pc	rear bumper	deformed	\$ 1,200.00	\$ 1,200.00
2	1 pc	rear bumper lower cover	broken	\$ 1,150.00	\$ 1,150.00
3	1 pc	rear bumper sponge	broken	\$ 320.00	\$ 320.00
4	1 pc	rear bumper reinforcement	buckled	\$ 720.00	\$ 720.00
5	1 pc	rear bumper tow hook cover	dislodged	\$ 85.00	reuse
6	1 pc	rear bumper ctr bracket	broken	\$ 285.00	\$ 285.00
7	2 pcs	rear bumper side bracket @\$285.00	necessary	\$ 570.00	\$ 570.00
8	2 pcs	rear bumper side retainer @\$76.00	necessary	\$ 152.00	\$ 152.00
9	1 set	rear bumper clips	necessary	\$ 35.00	\$ 35.00
10	4 pcs	reverse sensor @\$260.00	not working	\$ 1,040.00	\$ 1,040.00
11	1 pc	reverse sensor wire harness	damaged	\$ 480.00	\$ 480.00
12	1 pc	l/h exhaust chrome	scratched	\$ 550.00	\$ 550.00
13	1 pc	tailgate	broken	\$ 2,400.00	\$ 2,400.00
14	1 pc	tailgate logo emblem	necessary	\$ 220.00	\$ 220.00
15	1 pc	tailgate "renault" emblem	necessary	\$ 180.00	\$ 180.00
16	1 pc	tailgate "sport" emblem	necessary	\$ 180.00	\$ 180.00
17	1 pc	tailgate "gt" emblem	necessary	\$ 120.00	\$ 120.00
18	1 pc	tailgate inner handle switch	not working	\$ 175.00	\$ 175.00
19	1 pc	tailgate inner lock	jammed	\$ 280.00	\$ 280.00
20	1 pc	tailgate inner trim board	unconfirmed	\$ 700.00	not affected
21	10 pcs	rear boot painted clips @\$15.00	necessary	\$ 150.00	\$ 150.00
22	1 pc	tailgate r/h lamp	broken	\$ 480.00	\$ 480.00
23	1 pc	tailgate weatherstrip	deformed	\$ 360.00	\$ 360.00
24	1 pc	l/h taillamp	cracked	\$ 580.00	\$ 580.00
25	1 pc	r/h taillamp	cracked	\$ 580.00	\$ 580.00
26	1 pc	rear end panel - outer	buckled	\$ 850.00	\$ 850.00
27	1 pc	rear end panel - inner	buckled	\$ 879.00	\$ 879.00
28	1 pc	rear end panel top garnish	deformed	\$ 320.00	\$ 320.00
29	1 pc	spare tyre panel	broken	\$ 1,800.00	\$ 1,800.00
				\$ 16,841.00	\$ 16,056.00
Less 10%					\$ 1,605.60
				<b>\$ 16,841.00</b>	<b>\$ 14,450.40</b>
<b>SPECIAL NETT ITEMS:-</b>					
30	1 pc	rear no. plate	buckled	\$ 60.00	\$ 50.00
31	1 pc	rear no. plate frame	deformed	\$ 35.00	\$ 35.00
				\$ 95.00	\$ 85.00
<b>Sub - Total</b>				<b>\$ 16,936.00</b>	<b>\$ 14,535.40</b>

### APPRAISEMENT SCHEDULE

S/N	Qty	Descriptions	Conditions	Repairer's Estimate	Revised Amount
		B/F		\$ 16,936.00	\$ 14,535.40
		<b>LABOUR &amp; OTHER CHARGES:-</b>			
1		To panel beat and renewal of all necessary damaged body parts		\$ 1,600.00	\$ 1,400.00
2		To check wiring and rewire		\$ 60.00	\$ 50.00
3		To remove and reinstall tailgate components		\$ 80.00	\$ 60.00
4		To remove and reinstall rear windscreen		\$ 150.00	\$ 120.00
5		To remove and reinstall rear boot upholstery		\$ 120.00	\$ 100.00
6		To remove and reinstall reverse sensor		\$ 140.00	\$ 100.00
7		To apply anti-rust		\$ 100.00	\$ 80.00
8		To putty and spray-paint of affected areas		\$ 1,200.00	\$ 1,000.00
				<b>\$ 3,450.00</b>	<b>\$ 2,910.00</b>
			<b>Sub - Total</b>	<b>\$ 20,386.00</b>	<b>\$ 17,445.40</b>

### ASSESSMENT SUMMARY

Damages sustained were consistent with the subject vehicle being involved in a collision with another vehicle and the impact was delivered **Squarely to the Rear** portion of the vehicle.

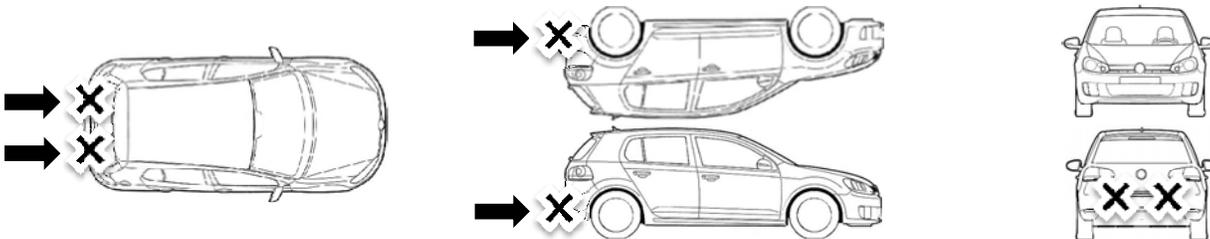

The general area of damages is at the **Rear portion**.  
( Please refer to the parts list and photographs as attached for more information )

### ASSESSOR'S RECOMMENDATIONS

The estimated repair costs submitted by Messrs **Garage Star Pte Ltd** is \$ 20,386.00 .  
We have adjusted the cost to \$ 17,445.40 and the repairer has agreed to undertake the repairs at a **Contract Lump Sum of \$ 14,000.00** to a acceptable quality and standards.

However, we have not given authorization and instruction to the repairer to proceed with the repairs.

The repairs should be completed within a reasonable period of **8** working days.

**76** photographs were taken at the time of static inspection.

This report is strictly done in a **Without Prejudice Basis**.

We are reverting the matter to you a decision.

We enclose herewith our Invoice No. **6439** for our services rendered and we thank you for engaging our services.

**KELVIN AUTOMOTIVE APPRAISING SERVICES**



**KELVIN TEO**  
*Licensed Automotive Appraiser*  
*Nitec in Automotive Technology*  
*Cert. Crash Investigation & Reconstruction*  
*Dip MS*  
*MSAAA, AM SAE-A*

**NOTE :** This revised estimate was from a visual inspection. Should there be any discrepancy or unseen items not listed in this survey, kindly notify the company within Seven (7) days from the date hereof. Otherwise this revised amount shall be treated as valid.



