

ASS. REC. BY:

REF:

TII / 22012413/kp

Kenneth

ASSIGNMENT

From: _____ Date: _____

Estimated Cost: _____

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No: _____

at Workshop m/s _____

of _____

Insured: _____

Policy No. _____

Claims No. _____

Sum Insured: _____

Excess: _____

(Client's Record)

Make of Veh: _____

(Policy Condition)

Remark: The veh had commenced its repair at the time of inspection.

N/S	O/S

Bal. or Market Value: 895k

IDAC Accident Report: _____

Consistent? : Yes or No

GIA / PR Seen: _____

Consistent? : Yes or No

Est. Repairs: 05 days

Res.: Yes or No

Lum Sum: 20 %

3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date: _____

Person Contacted: _____

Vehicle: IN / OUT

Veh No: SMN 625 UYr Regn: 07, 19

Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Traller or _____

Make: RenaultColour: M. SilverSp. Reading: 265495

Eng No: _____

C/No: VFIRFA 00262704546Gen. Cond: Good / Fair / Poor / BurntSteering: In order / Jammed / Leaked / Burnt orBrake: In order / Jammed / Leaked / Burnt orModl: NII / S/Rim / STD A/Rim or

Tyre Size: F: _____

R: _____

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI / TOYO / YOKO or

Front

R/Bal. 8 mmL/Bal. 8 mmD.O.A. 9/12/22

Survey held at _____

Des. of Damages: Frt / Rear / O/S / N/S / UIC / Rooftop or

The U/C / Chassis frame / Body Structure affected due to collision.

Rear

R/Bal. 5 mmL/Bal. 5 mmD.O.I. 13/12/2022

Date / Time

Action / Instruction

/

EM not ready

21/12

11 PM @ 4500L

Date/Time, File Pass to?

☐

: Prell. Report

☐

: Final Report

Date/Time, File Return to?

Days Of Repair: _____

Resurvey No. of Trip: _____

Survey Fee: _____

Transportation: _____

S - RS. SI

Fines

Others

TOTAL

Add Fee:

☐

: Site Insp (\$

☐

: Interview (\$

☐

: Tech Invs (\$

☐

: Weekend (\$

Report Format :

Lump Sum / I.B.I: (\$


Thiam Heng Huat Pte Ltd

176 Sin Ming Drive #05-14 Sin Ming Autocare Singapore 575721
 Mobile: 82636295 Email: thiamhenghuat@gmail.com

Make/Model: RENAULT GRAND SCENIC
 Engine/Chassis No.: VF1RFA00262704546
 Date of accident:
 Damaged area: O/S Front

Date: 13/12/2022
 Claim Type: TP
 VRN: SMN625U

Not Authorized
 1/Rep @ 4500p
 Resurvey After Repair
 5 days

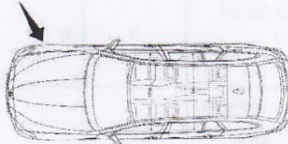

List items				
S/N	Parts description	QTY	UNIT PRICE	AMOUNT
1	Front Bumper inner support	1	\$ 298.00	\$ 298.00
2	Front Bumper	1	\$ 1,235.00	\$ 1,235.00
3	Front Bumper side retainer	2	\$ 65.00	\$ 130.00
4	Front Bumper reinforcement	1	\$ 450.00	\$ 450.00
5	Front Bumper lower grille	1	\$ 475.00	\$ 475.00
6	Headlamp o/s	1	\$ 2,442.00	\$ 2,442.00
7	Front foglamp o/s	1	\$ 278.00	\$ 278.00
8	Front foglamp cover o/s	1	\$ 189.00	\$ 189.00
9	Front fender o/s	1	\$ 918.00	\$ 918.00
10	Front fender inner cowling o/s	1	\$ 185.00	\$ 185.00
11	Front shock absorber o/s	1	\$ 489.00	\$ 489.00
12	Front lower arm o/s	1	\$ 377.00	\$ 377.00
13	Front endlink o/s	1	\$ 156.00	\$ 156.00
14	Front wheel knuckle o/s	1	\$ 545.00	\$ 545.00
15	Front Bumper lower moulding	1	\$ 316.00	\$ 316.00
16	Headlamp lower support o/s	1	\$ 187.00	\$ 187.00
17	Front foglamp chrome moulding o/s	1	\$ 165.00	\$ 165.00
18	Front door o/s	1	\$ 1,650.00	\$ 1,650.00
19	Front door lower hinge o/s	1	\$ 145.00	\$ 145.00
20	Front door lower chrome moulding o/s	1	\$ 198.00	\$ 198.00
21	Front bumper sensor holder o/s	2	\$ 21.00	\$ 42.00
Subtotal				\$ 10,870.00
List discount				10.00%
Total				\$ 9,783.00

Special nett items				
No.	Parts description	QTY	UNIT PRICE	AMOUNT
1	Front fender inner cowling clips o/s	8	\$ 5.50	\$ 44.00
2	Front Bumper clips	12	\$ 5.50	\$ 66.00
3	Front alloy wheel o/s	1	\$ 650.00	\$ 650.00

Repair Estimate

4	Front tyre o/s	1	\$ 450.00	\$ 450.00	X
5	Sundries	1	\$ 50.00	\$ 50.00	X
			Total	\$ 1,260.00	

Labour				
No.	Description	Work unit	Amount	
1	To dismantle / renew accident damaged portions. To panel beat, reshape, straighten, orientate and align repair / replacement parts.	7	\$	1,400.00
2	To disconnect front wire harness of electrical components to facilitate repairs, reconnect and check functions including focusing headlamps.	0.25	\$	50.00
3	To remove and replace front o/s tyre & rim. To perform tyre balancing.	0.25	\$	50.00
4	To remove and refit front o/s undercarriage for replacement of parts.	1	\$	200.00
5	To conduct 4 wheel computerized wheel alignment.	0.5	\$	100.00
6	Supply spray paint material and necessary items to respray affected area / panel.	6	\$	1,200.00
7	To rust proof all affected portions after repair.	0.5	\$	100.00
			Total labour	\$ 3,100.00

Estimate Grand Total	\$ 14,143.00
-----------------------------	---------------------

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature: