



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

LONPAC INSURANCE BHD

INV No. AC2303834

300 BEACH ROAD
#17-04/07 THE CONCOURSE
SINGAPORE 199555

INV Date 16/06/2023
Reference CC4/LPC22012443/Upa3q2
Code LPC2

PROFESSIONAL SERVICE FEE

Vehicle No. SLR 4880M
Insured Veh. GBB 5786Z
Claim No. 21/22/22/VC05/026698
Policy No. Z21VC05007815-001
Accident Date 11/12/2022
Inspection Date 21/12/2022

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (8%)	32.00
Grand Total	432.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
LONPAC INSURANCE BHD 300 BEACH ROAD #17-04/07 THE CONCOURSESINGAPORE 199555			Ref: CC4/LPC22012443/Upa3q2 Date: 16/06/2023 Code: LPC2	
1. Policy Particulars :- THIRD PARTY CLAIM				
	Insured Veh.	GBB 5786Z	Veh. Inspected	SLR 4880M
	Policy No.	Z21VC05007815-001	Coverage (\$)	0.00
	Claim No.	21/22/22/VC05/026698	Excess (\$)	0.00
	Assign From	CHARMAINE KONG	Assign Date	13/12/2022
2. Vehicle Particulars & Condition				
	Make & Model	KIA CERATO K3 (A)	c.c	1591
	Engine No.	HIDDEN	Year of Reg.	2017
	Chassis No.	KNAFZ411MJ5739490	Colour	WHITE
	Odometer	81516 KM	Steering	IN ORDER
	Brakes	IN ORDER	Modification	SPORTS RIM
	General	GOOD		
3. Conditions of Tyres				
		Size	Make	Balance
	R/H Front Tyre	215/45 R17	ROADSTONE	6 mm
	L/H Front Tyre	215/45 R17	ROADSTONE	6 mm
	R/H Rear Tyre	215/45 R17	ROADSTONE	6 mm
	L/H Rear Tyre	215/45 R17	ROADSTONE	6 mm
4. Description of Damages				
	THE VEHICLE SUSTAINED DAMAGES AT THE REAR PORTION. DAMAGES SEE DETAILS.			
5. General Information				
	Accident Date	11/12/2022	Inspection Date	21/12/2022
	Survey held at	NO.330 UBI ROAD 3 SINGAPORE 408650		
	Repairer	CYCLE & CARRIAGE KIA PTE LTD		
5a. Remarks				
	A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.			
5b. Estimate Days of Repair				
	ESTIMATED NORMAL PERIOD FOR REPAIR:		6 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SLR 4880M

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	C&C BADGE (SN)	NECESSARY	50.00	50.00
1	REAR NUMBER PLATE WITH CASIG (SN)	BENT	50.00	50.00
1	REAR REVERSE CAMERA LENS (SN)	NOT NECESSARY	350.00	-
1	SUNDRIES (SN)	NECESSARY	50.00	30.00
1	TRUNK LID PANEL ASSY (SN)	DENTED / BUCKLED	1,365.00	1,365.00
1	EMBLEM-CERATO (SN)	NECESSARY	31.00	31.00
1	EMBLEM K3 (SN)	NECESSARY	15.00	15.00
1	LATCH ASSY-TRUNK LID (SN)	NOT NECESSARY	112.00	-
1	W/STRIP-TRUNK LID OPNG (SN)	NOT NECESSARY	100.00	-
1	COVER-RR BUMPER (SN)	DENTED / DEFORMED	688.00	688.00
1	COVER-RR BUMPER, CTR (SN)	TORN	315.00	315.00
1	COVER-RR BPR UNDER (SN)	DEFORMED	42.00	42.00
4	ULTRASONIC SENSOR ASSY-P.A.S (SN)	SERVICEABLE	708.00	-
1	WIRING HARNESS-BWS EXT (SN)	NOT NECESSARY	216.00	-
10	CLIP (SN)	NECESSARY	20.00	20.00
1	BRACKET-RR BUMPER SIDE MTG, LH (SN)	NOT NECESSARY	29.00	-
1	BRACKET-RR BUMPER SIDE MTG, RH (SN)	NOT NECESSARY	29.00	-
1	BEAM-RR BUMPER (SN)	CRACKED	318.00	318.00
2	BRACKET-RR BEAM LWR MTG (SN)	NOT NECESSARY	10.00	-
1	BRACKET-RR BEAM LWR, CTR (SN)	NOT NECESSARY	5.00	-
1	BRACKET-RR RAIL UPR MTG, LH (SN)	NOT NECESSARY	3.00	-
1	BRACKET-RR RAIL UPR MTG, RH (SN)	NOT NECESSARY	3.00	-
1	STAY-RR BUMPER LH (SN)	BENT	120.00	120.00
1	STAY-RR BUMPER RH (SN)	BENT	120.00	120.00
1	BACK PANEL ASSY (SN)	TO REPAIR SEE LABOUR	324.00	-
1	BODY KIT (SN)	TORN	1,800.00	1,800.00
			6,873.00	4,964.00



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>LABOUR</u>			
	TO APPLY SEALANT KIT ON NEW PANEL.		240.00	80.00
	TO APPLY ANTI-CORROSION ON ACCIDENT AFFECTED AREAS.		200.00	100.00
	TO CHECK AND TEST REVERSE SENSOR.		100.00	100.00
	TO TRANSFER TRUNK LID COMPONENT AND MECHANISM PARTS.		640.00	320.00
	TO REMOVE AND REINSTALL TRIMMING AND CAPERTING TO GIVE WAY ACCESS REPAIR ON REAR ACCIDENT AFFECTED AREAS.		640.00	320.00
	TO REPLACE REAR BODY KIT.		640.00	320.00
	TO REPLACE TRUNK LID PNL, REAR BUMPER, REAR BEAM, ETC.		3,840.00	1,920.00
	-TO CUT & REWELD REAR END PANEL STRAIGHTEN, REFORM, ALIGN ON REAR ACCIDENT AFFECTED AREAS. INCLUSIVE OF THE REPAIR OF BACK PANEL ASSY.			
	SPRAY PAINTING ON REAR ACCIDENT AFFECTED AREAS.		3,850.00	1,925.00
	TO CONDUCT DIAGNOSTIC CHECK BY KDS AND CLEAR TROUBLE CODE.		280.00	280.00
	CHECK WIRING & ELECTRICAL SYSTEM.		100.00	80.00
			10,530.00	5,445.00
GRAND TOTAL			17,403.00	10,409.00
RECOMMENDED COST OF REPAIRS				10,409.00

Report Ref No. CC4/LPC22012443/Upa3q2

CHUA KANG SENG

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SLR 4880M

INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

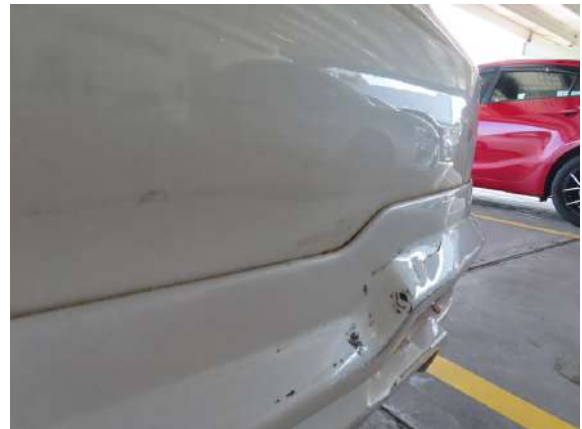





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

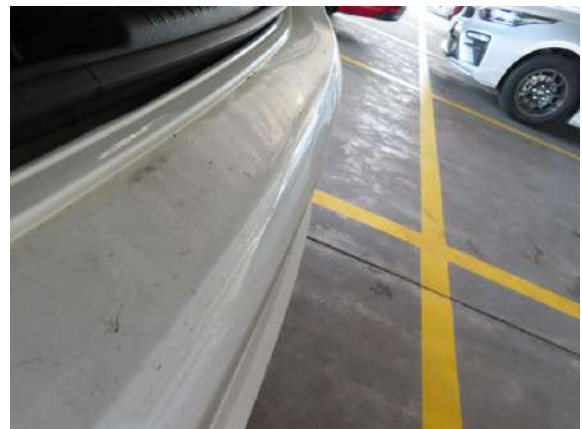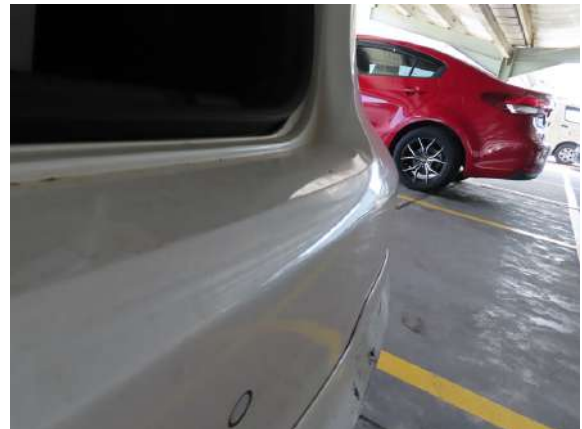




LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

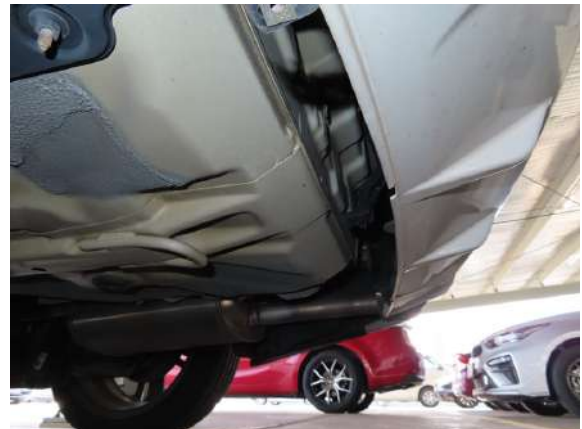



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SLR 4880M

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SLR 4880M

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SLR 4880M

RE-INSPECTION

