

ASSIGNMENT

From: _____ Date: _____
 Estimated Cost: _____
OD / TP / WS / TP RES / OD RES / EVA / INV / MV
 To Inspect Vehicle No: _____
 at Workshop m/s _____
 of _____
 Insured: _____
 Policy No. _____
 Claims No. _____
 Sum Insured: _____ Excess: _____
 (Client's Record)
 Make of Veh: _____

Veh No: SMD86724 Yr Regn: 2018 / Sept.
 Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /
 Truck / Trailer or _____
 Make: Mitsubishi Outlander G.C 1998
 Colour: white A/C: Insured / Std / NI / NA
 Sp. Reading: 54134 T/Radio: Insured / Std / NI / NA
 Eng/No: 4J11Y75839
 C/No: GFTW0402267
 Gen. Cond: Good / Fair / Poor / Burnt
 Steering: Inorder / Jammed / Leaked / Burnt or
 Brake: Inorder / Jammed / Leaked / Burnt or
 Modi: Nil (S/Rim / STD A/Rim or
 Tyre Size: F: 225 / 55 R18
 R: - " -

(Policy Condition)

Remark: The veh had commenced its repair at the time of inspection.

N/S	O/S

Bal. or Market Value: _____
 IDAC Accident Rpt: _____ Consistent?: Yes or No
 GIA / PR Seen: _____ Consistent?: Yes or No
 Est. Repairs: 5 days Res.: Yes or No
 Lum Sum: 20 % 3 Val.: Yes or No
 CA / REV / REP. / 24 HRS
 Date: _____ Person Contacted: _____
 Vehicle: IN / OUT

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /
 TOYO / YOKO or Toyo
 Front Rear
 R/Bal. 5 mm R/Bal. 5 mm
 L/Bal. 5 mm L/Bal. 5 mm
 D.O.A. 19/07/2022 D.O.I. 28/12/2022
 Survey held at trip lek sun Ming
 Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or
 The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time	Action / Instruction
	TP Physical Re-inspection
30/01/2023	To submit 4/5 3,100/- with 5 days of rep. (Red. \$ 5400, 64%)
	Damage to LH side. minor. Parts indicated how is photo show no damage or not consistent.

Date/Time, File Pass to? : Preli. Report
 : Final Report
 1) 30/1/23
 Date/Time, File Return to?
 2) _____

Days Of Repair: 5
 Resurvey No. of Trip: _____

Report Format: TR
 Lump Sum / I.B.I.: (\$ 3100)

Add Fee: : Site Insp (\$ _____)
 : Interview (\$ _____)
 : Tech. Invs (\$ _____)
 : Weekend (\$ _____)

Survey Fee:	<input type="text"/> <input type="text"/> <input type="text"/> <input type="text"/> <input type="text"/>
Transportation:	
S + RS _____ \$	
Photos	
Others	
TOTAL	

PAR Automotive Consultancy

Regn. No: 52986974L

Mailing Address : Blk 310 Shunfu Road #07-213, Singapore 570310. Tel : 645 31173

Report No: 0087-22-HL

04 November 2022

My Family Vet Clinic and Surgery Pte Ltd
c/o Hiap Lek Automobile Trading
160 Sin Ming Drive #05-17
Sin Ming Autocity
Singapore 575722

INVOICE No. **0087-22-HL**


Vehicle No. SMD8672H

<u>S/NO.</u>	<u>SERVICES RENDERED</u>	<u>Amount due</u>
1	Being accident vehicle appraisal services, transport, photographs and re-inspection (work in progress and post repair inspection).	\$830.00
	Total amount payable	<u>\$830.00</u>

Kindly cross your cheque in favour of "PAR Automotive Consultancy"

We thank you in anticipation for your prompt payment.

PAR Automotive Consultancy

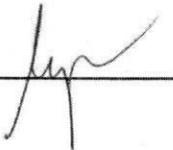

PAR Automotive Consultancy

Regn. No: 52986974L

Mailing Address : Blk 310 Shunfu Road #07-213, Singapore 570310. Tel : 645 31173

Report No: 0087-22-HL

04 November 2022

ACCIDENT VEHICLE SURVEY REPORT

My Family Vet Clinic and Surgery Pte Ltd
c/o Hiap Lek Automobile Trading
160 Sin Ming Drive #05-17
Sin Ming Autocity
Singapore 575722

VEHICLE INFORMATION:

<i>Vehicle Reg No.:</i>	SMD8672H	<i>Odometer:</i>	047739km
<i>Make & Model:</i>	Mitsubishi Outlander	<i>Colour:</i>	White
<i>Chassis number:</i>	6F7W0402267	<i>Date of accident:</i>	19/07/2022
<i>Year of Regn.:</i>	10/09/2018	<i>Date inspected:</i>	20/07/2022
<i>Repairer at:</i>	Hiap Lek Automobile Trading 160 Sin Ming Drive #05-17 Sin Ming Autocity Singapore 575722	<i>Date inspected (After Repair):</i>	02/08/2022

STATIC CHECKS, where applicable:

<i>Steering :</i>	serviceable
<i>Footbrake :</i>	serviceable
<i>Handbrake :</i>	serviceable
<i>Paintwork :</i>	Good
<i>General condition :</i>	Good

TIRE CONDITION:

	<u>LH / Make</u>	<u>RH / Make</u>	<u>Size</u>
<i>Front:</i>	5mm/Hankook	5mm/Hankook	225/45R18
<i>Rear:</i>	6mm/Yokohama	6mm/Yokohama	225/55/R18

POINT OF IMPACT AND DAMAGE, where applicable:

Impact on the rear and front portion.
Please see details as described in the Annex for parts and labour.

REMARKS:

We have inspected the above-mentioned vehicle on a "Without Prejudice" basis.

Parts and Labour Assessment

Report No: 0087-22-HL

Vehicle No: SMD8672H

Description of part	Qty	Condition as inspected	Repairer's estimate	Our adjustment	
Front knuckle arm RH	1	distorted	320.00	320.00	✓
Front knuckle arm hub bearing RH	1	dislodged	134.00	134.00	✓
Front lower arm RH	1	bent	239.00	239.00	✓
Front link arm RH	1	bent	23.00	23.00	✓
Front shock absorber RH	1	bent	389.00	389.00	✓
Front shock absorber top mounting RH	1	necessary/deformed	106.00	106.00	✓
Tie rod end RH	1	dislodged	169.00	169.00	✓
Front fender LH	1	repair	630.00	0.00	R
Front fender outer protector LH	1	abraded/fractured	179.00	179.00	✓
Front door LH	1	buckled	881.00	881.00	R
Front door black sticker	1	necessary	38.00	38.00	✓
Front door outer protector	1	deformed	171.00	171.00	✓
Front door glass outer moulding LH	1	necessary	129.00	129.00	✓
Front door mechanism lock LH	1	bent	290.00	290.00	✓
Front door outer handle	1	distorted	84.00	84.00	✓
Front door outer handle cover LH	1	distorted	25.00	25.00	✓
Front door weatherstrip LH	1	deformed	184.00	184.00	✓
Front door lower weatherstrip LH	1	deformed	48.00	48.00	✓
Rear door LH	1	buckled	860.00	860.00	R
Rear door black frame LH	2	necessary	76.00	76.00	✓
Rear door outer protector LH	1	deformed	148.00	148.00	✓
Rear door lock striker LH	1	repair	28.00	0.00	✓
Rear door mechanism lock LH	1	bent	290.00	290.00	✓
Rear door weatherstrip LH	1	deformed	157.00	157.00	✓
Rear fender inner shield LH	1	fractured	85.00	85.00	✓
Rear fender protector LH	1	abraded/fractured	148.00	148.00	✓
Rear tail lamp LH	1	fractured	563.00	563.00	✓
Rear bumper	1	abraded	872.00	872.00	✓
Rear bumper side retainer RH/LH	2	necessary	48.00	48.00	✓
Rear bumper clip	10	necessary	35.00	35.00	✓
<i>Subtotal before discount</i>			7,349.00	6,691.00	
<i>Percentage discount 0% and 10%</i>			0.00	669.10	
Sub-total 1			7,349.00	6,021.90	

1601.00

1440.90

PAR Automotive Consultancy

Front tyre sport rim RH	1	abraded	650.00	650.00	✓
Rear tyre sport rim LH	1	abraded	650.00	650.00	HH
		<i>Subtotal before discount</i>	1,300.00	1,300.00	
		<i>Percentage discount 0% and 0%</i>	0.00	0.00	
		Sub-total 2	1,300.00	1,300.00	
		Parts-total	8,649.00	7,321.90	

LABOUR

1. To straighten and panel beating front fender LH, rear and front frame members. To remove and refit above parts.			1,500.00	1,250.00	700/-
2. To putty, re-spray painting and polish affected areas.		<i>4 panel</i>	1,680.00	1,500.00	800/-
3. To check and rectify wiring system.			80.00	50.00	HH
4. To remove, refit and transfer rear and front door LH components.			250.00	200.00	HH
5. To remove and refit front suspension.		<i>1790.00</i>	400.00	350.00	250/-
6. To rust proof affected areas.			120.00	60.00	40/-
		Labour total	4,030.00	3,410.00	
		Parts & Labour total	12,679.00	10,731.90	

Results of inspection of the accident vehicle are as shown above.

We have taken into consideration the age and condition of the vehicle in our recommendation.

Hence, the recommended cost of repairs based on LUMP SUM repairs is : **\$8,500.00**
and the recommended number of working days for the repairs is : **12**

KL
B J Loi (1 Eng. MIMI, AIRTE)
Automotive Appraiser

3880.90
4/5 3,100/-
5 days.