

ASS. REC. BY:

REF:

7M1/

## ASSIGNMENT

From:

Date:

Estimated Cost:

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To inspect Vehicle No:

at Workshop m/s

of

Insured:

Policy No.

Claims No.

Sum Insured:


Excess:

(Client's Record)

Make of Veh:

(Policy Condition)

Remark: The veh had commenced its  
repair at the time of inspection.

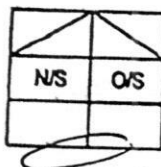

Bal. or Market Value:

IDAC Accident Report:

Consistent? : Yes or No

GIA / PR Seen:

Consistent? : Yes or No

Est. Repairs:

02 days

Res.: Yes or No

Lum Sum:

20 %

3 Val: Yes or No

CA / REV / REP. / 24 HRS

Date:

Person Contacted:

Vehicle: IN / OUT

Veh No:

S/H 09030

Yr Regn:

12, 17

Type: M. Car / M. Cycle / Bus / Van / Lorry / Prime Mover /

Truck / Trailer or

Make:

Renault Latitude

c.c.

1995

Colour

m White / Red

A/C:

Insured / Std / NI / NA

Sp. Reading

635868

T/Radio:

Insured / Std / NI / NA

Eng/No:

C/No:

VIFIABLISAUC 283407

Gen. Cond: Good / Fair / Poor / Burnt

Steering: In order / Jammed / Leaked / Burnt or

Brake: In order / Jammed / Leaked / Burnt or

Mod: N/A S/Rim / STD A/Rim or

Tyre Size:

F: 215/60R16

R: 215/60R16

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or

Front

Rear

R/Bal.

9

mm

R/Bal.

6

mm

L/Bal.

9

mm

L/Bal.

6

mm

D.O.A.

11/12/22

D.O.I.

13/12/2022

Survey held at

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time

Action / Instruction

21 Dec 2022 @ 02 days (Red \$10653.96 / 89%)

Date/Time, File Pass to?

☐

Prell. Report

☐

Final Report

1)

Date/Time, File Return to?

2)

Days Of Repair:

Resurvey No. of Trip:

Survey Fee:

Transportation:

S - RS - SI

Fees

Others

Add Fee:

☐

Site Insp (\$

☐

Interview (\$

☐

Tech Invs (\$

☐

Weekend (\$

TOTAL

|  |
|--|
|  |
|  |
|  |
|  |
|  |
|  |
|  |
|  |
|  |
|  |

Report Format:

Lump Sum / I.B.I. (\$)

**Trans-cab Auto Services Pte Ltd**

No. 2 Ang Mo Kio Street 63 Singapore 569111

Tel No. : 6287 6666 Fax No. : 6257 1330

CO./GST Reg. No. 201019626G

**SHD903D***Not Notified*  
*11 Pmg \$1250/h*

AAD2212-

Vehicle No.:

Chassis No.:

UEN No:

Vehicle Make:

Vehicle Model:

Date of Accident :

Third Party Insurer :

Date of Registration :

**13 DEC 2022****SHD903D**

VF1ABL15AUC283407

200303878K

RENAULT

LATITUDE

12/12/2022

**SML9437Y/TOKIO**

08/12/2017

**PART**

- 1 BUMPER COVER REAR
- 1 BUMPER LOWER REAR
- 1 BUMPER BRACKET CTR REAR
- 1 BUMPER BRACKET SIDE RH REAR
- 1 BUMPER RETAINER RH REAR
- 1 BUMPER BRACKET SIDE LH REAR
- 1 BUMPER RETAINER LH REAR
- 1 BUMPER BEAM REAR
- 1 OUTER PANEL REAR (End Panel)
- 1 OUTER PANEL REAR (End Panel)TRIM
- 1 BUMPER REFLECTOR LH
- 1 BUMPER REFLECTOR RH

**LIST**

|        |           |                 |          |
|--------|-----------|-----------------|----------|
| \$     | <i>Bu</i> | 561.70          | ✓        |
| \$     | <i>De</i> | 411.90          | ✓        |
| \$     | <i>Sm</i> | 98.10           | } X      |
| \$     | <i>Sm</i> | 82.10           |          |
| \$     | <i>Sm</i> | 59.80           |          |
| \$     | <i>Sm</i> | 80.80           |          |
| \$     | <i>Sm</i> | 54.20           |          |
| \$     | <i>Al</i> | 547.80          |          |
| \$     | <i>Al</i> | 745.80          |          |
| \$     | <i>Sm</i> | 404.56          |          |
| \$     | <i>Sm</i> | 16.60           |          |
| \$     | <i>Sm</i> | 16.60           |          |
| \$     |           | <b>3,079.96</b> |          |
| 10% \$ |           | <b>1,007.88</b> | 307.96   |
| \$     |           | <b>9,070.88</b> | 2,771.96 |

**Special Nett**

- 1SET PARKING AID
- 1SET REAR BUMPER CLIP
- 1SET BUMPER BRACKET SIDE CLIP RH RR
- 1SET BUMPER RETAINER RH CLIP RR
- 1SET BUMPER BRACKET SIDE CLIP LH RR
- 1SET BUMPER RETAINER CLIP LH RR
- 1SET BUMPER LOWER REAR CLIP
- 1 LICENSE PLATE WITH HOLDER REAR
- 2 WINDSCREEN SEALANT
- 1, RR Bumper Advertisement.

|    |           |        |      |
|----|-----------|--------|------|
| \$ | <i>Bu</i> | 700.00 | X    |
| \$ | <i>De</i> | 66.00  | ✓    |
| \$ | <i>nn</i> | 10.00  | X    |
| \$ | <i>nn</i> | 20.00  | X    |
| \$ | <i>nn</i> | 10.00  | X    |
| \$ | <i>nn</i> | 20.00  | X    |
| \$ | <i>nn</i> | 66.00  | ✓    |
| \$ | <i>Sm</i> | 120.00 | X    |
| \$ | <i>nn</i> | 150.00 | ✓    |
| \$ | <i>nn</i> | 100.00 | Scsm |

**Trans-cab Auto Services Pte Ltd**

No. 2 Ang Mo Kio Street 63 Singapore 569111

Tel No. : 6287 6666 Fax No. : 6257 1330

CO./GST Reg. No. 201019626G

**SHD903D**

AAD2212-

|                                |           |                  |         |
|--------------------------------|-----------|------------------|---------|
| 1 WINDSCREEN MOULDING          | \$        | 200.00           | X       |
| 1 WINDSCREEN INNER SPONGE SEAL | \$        | 130.00           | X       |
| <b>TOTAL</b>                   | <b>\$</b> | <b>1,752.00</b>  | 1592.00 |
| <b>TOTAL PARTS</b>             | <b>\$</b> | <b>10,822.88</b> | 4363.96 |

**LABOUR**

|                                                                                                                           |    |          |      |
|---------------------------------------------------------------------------------------------------------------------------|----|----------|------|
| To Remove And Refit Rear Big and Small W/Screen Glass To Facilitate Bodywork Repair.                                      | \$ | 300.00   | X    |
| Putty And Spray Painting Of The Affected Portion.                                                                         | \$ | 3,000.00 | 2201 |
| Panel Beating, Knocking And Straightening The Necessary Portion, Remove And Renewal Of Parts, Adjust And Realign The Same | \$ | 3,000.00 | 2001 |
| To Rust-Proofing Of The Affected Areas.                                                                                   | \$ | 170.00   | X    |
| To reinstall rear bumper parking sensor.                                                                                  | \$ | 170.00   | 601  |
| To transfer of bootlid fittings, attachments and perform water seepage test.                                              | \$ | 170.00   | X    |
| To transfer of rear end panel fittings, attachment and perform water seepage test.                                        | \$ | 170.00   | X    |
| To transfer of rear windscreen fittings and conduct water seepage test.                                                   | \$ | 170.00   | X    |
| To check steering geometry and computer wheel alignment                                                                   | \$ | 220.00   | X    |
| To Check Electrical Lighting Concerned.                                                                                   | \$ | 170.00   | X    |

**TOTAL \$**~~7,880.00~~

7540

Total

11903.96

**LKK Auto Consultants** hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature: