



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

CHINA TAIPING INSURANCE (S) PTE LTD	INV No.	AC2301475
3 ANSON ROAD #16-00	INV Date	13/03/2023
SPRINGLEAF TOWER	Reference	CC6/CTI22012624/Aya3q2
SINGAPORE 079909	Code	CTI

PROFESSIONAL SERVICE FEE

Vehicle No.	GBE 7422U
Insured Veh.	GBD 3734B
Claim No.	SNM22D208965
Policy No.	DMCVSNA00119432201
Accident Date	12/12/2022
Inspection Date	13/12/2022

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (8%)	32.00
Grand Total	432.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile			
CHINA TAIPING INSURANCE (S) PTE LTD 3 ANSON ROAD #16-00 SPRINGLEAF TOWERSINGAPORE 079909		Ref: CC6/CTI22012624/Aya3q2 Date: 13/03/2023 Code: CTI	
1. Policy Particulars :- THIRD PARTY CLAIM			
Insured Veh.	GBD 3734B	Veh. Inspected	GBE 7422U
Policy No.	DMCVSNA00119432201	Coverage (\$)	0.00
Claim No.	SNM22D208965	Excess (\$)	0.00
Assign From		Assign Date	13/12/2022
2. Vehicle Particulars & Condition			
Make & Model	NISSAN NV200	c.c	1461
Engine No.	HIDDEN	Year of Reg.	2016
Chassis No.	VSKYBAM20Z0121216	Colour	BLACK
Odometer	174496 KM	Steering	IN ORDER
Brakes	IN ORDER	Modification	NIL
General	GOOD		
3. Conditions of Tyres			
	Size	Make	Balance
R/H Front Tyre	175/70 R14C	TOURADOR	6 mm
L/H Front Tyre	175/70 R14C	TOURADOR	6 mm
R/H Rear Tyre	175/70 R14C	TOURADOR	6 mm
L/H Rear Tyre	175/70 R14C	TOURADOR	6 mm
4. Description of Damages			
THE VEHICLE SUSTAINED DAMAGES AT THE REAR PORTION. DAMAGES SEE DETAILS.			
5. General Information			
Accident Date	12/12/2022	Inspection Date	13/12/2022
Survey held at	T K LEE AUTOMOTIVE PTE LTD NO. 1 KAKI BUKIT AVE 6 #02-47 AUTOBAY SINGAPORE 417883		
5a. Remarks			
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.			
5b. Estimate Days of Repair			
ESTIMATED NORMAL PERIOD FOR REPAIR:		6 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. GBE 7422U

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
REPLACEMENT OF PARTS				
1	TAILGATE - LH	DENTED	1,560.90	1,469.00
1	TAILGATE LOGO	NECESSARY	79.90	79.90
1	TAILGATE EMBLEM 'NV200'	NECESSARY	124.20	124.20
1	TAILGATE OUTER GARNISH	CRACKED	351.50	351.50
1	TAILGATE WIPE MOTOR	DAMAGED	481.90	481.90
1	TAILGATE LOCK - LOWER	DAMAGED	186.10	186.10
1	TAILGATE LOCK STRIKER	NOT NECESSARY	110.50	-
1	TAILGATE LOCK - CTR	DAMAGED	289.30	289.30
1	TAILGATE LOCK ACTUATOR	NOT NECESSARY	441.50	-
1	TAILGATE LOCK - TOP	NOT NECESSARY	186.10	-
1	TAILGATE OPENING W/STRIP	CUT	261.90	261.90
1	TAILGATE CHECKER	NOT NECESSARY	138.10	-
2	TAILGATE HINGES @\$121.50	NOT NECESSARY	243.00	-
1	TAILGATE INNER TRIM	NOT NECESSARY	186.90	-
10	TAILGATE INNER TRIM CLIPS @\$5.50	NOT NECESSARY	55.00	-
1	TAILGATE - RH	DENTED	1,253.70	1,102.00
1	TAILGATE SEAL	NOT NECESSARY	126.20	-
2	TAILLAMPS - R/L @\$283.20	CRACKED	566.40	566.40
2	TAILLAMP FILLER PANELS - R/L @\$481.60	NOT NECESSARY	963.20	-
1	REAR BUMPER	DEFORMED	632.70	632.70
2	REAR BUMPER REFLECTOR @\$61.50	NOT NECESSARY	123.00	-
1	REAR BUMPER INNER FOAM	CRACKED	194.70	194.70
2	REAR BUMPER SIDE RETAINERS - R/L @\$48.90	DAMAGED	97.80	97.80
1	REAR END PANEL	DENTED	481.50	481.50
1	REAR END PANEL INNER MEMBER	TO REPAIR SEE LABOUR	899.60	-
1	REAR END PANEL TOP GARNISH	DEFORMED	138.10	138.10
10	REAR END PANEL TOP GARNISH CLIPS @\$5.50	NECESSARY	55.00	20.00
	LESS 10% DISCOUNT		-1,022.87	-647.70
			9,205.83	5,829.30

Report Ref No. CC6/CTI22012624/Aya3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
SPECIAL NETT ITEMS				
2	SET TAILGATE GLASS SEALANT - R/L (SN)	NECESSARY	120.00	80.00
2	SET TAILGATE GLASS FOAM TAPE - R/L (SN)	NECESSARY	120.00	80.00
1	REAR STICKER "70KM/H" (SN)	NECESSARY	10.00	10.00
1	REAR STICKER "6 PAX" (SN)	NECESSARY	10.00	10.00
1	SET REAR BUMPER CLIP (SN)	NECESSARY	45.00	30.00
1	SET REAR REVERSE SENSOR (SN)	DAMAGED	280.00	200.00
			585.00	410.00
LABOUR				
TO CHECK REAR ELECTRICAL WIRING.			80.00	30.00
TO REMOVE & REPLACE TAILGATE GLASS - R/L.			300.00	120.00
TO REMOVE & REFIX REAR INTERIOR TRIMS TO ASSIST REPAIR.			120.00	60.00
TO REMOVE & REPLACE EXHAUST SYSTEM.			100.00	-
TO REMOVE AND REPLACE REVERSE CAMERA & SENSORS.			80.00	80.00
TO TUFF KOTE.			180.00	80.00
TO PUTTY, SPRAY PAINT & POLISH AFFECTED PARTS.			1,500.00	800.00
TO PANEL BEAT, CUT, WELD, REMOVE & REPLACE DAMAGED PARTS. INCLUSIVE OF THE REPAIR OF REAR END PANEL INNER MEMBER.			1,500.00	800.00
			3,860.00	1,970.00
GRAND TOTAL			13,650.83	8,209.30
RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)				6,500.00

Report Ref No. CC6/CTI22012624/Aya3q2

ADRIAN LING WAI PING

B.Eng,AMSOE,AMIRTE,AMSAE-A,M.MATAI

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. GBE 7422U

INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

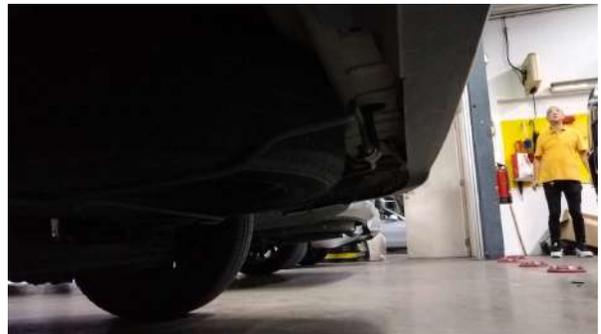



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. GBE 7422U

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. GBE 7422U

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

