

ASS. REC. BY:

REF:

AIG/22012733/kp

C

Kenneth

ASSIGNMENT

From:

Date:

Estimated Cost:

OD/TP/WS/TP RES/OD RES/EVA/INV/MV

To Inspect Vehicle No:

at Workshop m/s

of

Insured:

Policy No.

Claims No.

Sum Insured:


Excess:

(Client's Record)

Make of Veh:

(Policy Condition)

Remark: The veh had commenced its
repair at the time of inspection.

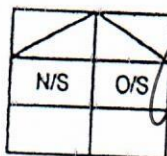

Bal. or Market Value:

IDAC Accident Rpt:

Consistent? : Yes or No

GIA / PR Seen:

Consistent? : Yes or No

Est. Repairs:

04

days

Res.: Yes or No

Lum Sum:

1.51

%

3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date:

Person Contacted:

Vehicle: IN / OUT

Veh No:

S110 9826J

Yr Regn:

01, 21

Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make:

Toy Prits

c.c

1798

Colour

M-P. White / Red

A/C:

Insured / Std / NI / NA

Sp. Reading

160302

T/Radio:

Insured / Std / NI / NA

Eng/No:

C/No:

JTDKB 3FU 7030 93659

Gen. Cond: Good / Fair / Poor / Burnt

Steering: In order / Jammed / Leaked / Burnt or

Brake: In order / Jammed / Leaked / Burnt or

Modi: Nil / S/Rlm / STD / Rlm or

Tyre Size:

Greenlander 195/65R15

R: Paitun

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /
TOYO / YOKO or

Front

Rear

R/Bal.

9

mm

R/Bal.

P

mm

L/Bal.

9

mm

L/Bal.

P

mm

D.O.A.

16/12/22

D.O.I.

19/12/2022

Survey held at

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

O/S body

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time

Action / Instruction

1 Got B2

4/1/23 85832.13 Carh

Date/Time, File Pass to?



: Prell. Report

1)

Date/Time, File Return to?



: Final Report

2)

Days Of Repair:

Resurvey No. of Trip:

Survey Fee:

Transportation:

S + RS. SI

F. ins

Others

Add Fee:



: Site Insp (\$



: Interview (\$



Tech Invs (\$



Weekend (\$

Report Format :

Lump Sum / I.B.I.: (\$

TOTAL

Trans-cab Auto Services Pte Ltd

No. 2 Ang Mo Kio Street 63 Singapore 569111

Tel No. : 6287 6666 Fax No. : 6257 1330

CO./GST Reg. No. 201019626G

SHD9826J*Not Ashish
Recovery B4 paint*

AAD2212-075.

B5832-13

Vehicle No.:

Chassis No.:

Vehicle Make:

Vehicle Model:

Date of Accident :

Third Party Insurer :

Date of Registration:

19 DEC 2022**SHD9826J**

JTDKB3FU703093659

TOYOTA

PRIUS GEN 4

16/12/2022

SJA1180H/AIG

29/01/2021

PART	LIST
1 PANEL SUB-ASSY, FRONT DOOR, RH	\$ <i>B</i> 1,300.70 ✓
1 FRAME SUB-ASSY, FRONT DOOR OUTSIDE HANDLE, RH	\$ <i>R</i> 193.50 X
1 HANDLE ASSY, FRONT DOOR, OUTSIDE RH	\$ <i>R</i> 390.60 X
1 MOTOR ASSY, POWER WINDOW REGULATOR, RH	\$ <i>Ja R</i> 926.00 ✓
1 WEATHERSTRIP, FRONT DOOR OPENING TRIM, RH	\$ <i>R</i> 321.10 X
1 HINGE ASSY, FRONT DOOR, LOWER RH	\$ <i>R</i> 110.60 X
1 HINGE ASSY, FRONT DOOR, UPPER RH	\$ <i>R</i> 97.50 X
1 REGULATOR SUB-ASSY, FRONT DOOR WINDOW, RH	\$ <i>R</i> 238.30 ✓
1 TAPE, BLACK OUT, NO.2 FRT RH	\$ <i>R</i> 43.50 ✓
1 TAPE, BLACK OUT, NO.1 FRT RH	\$ <i>R</i> 13.30 ✓
1 TAPE, BLACK OUT, NO.3 FRT RH	\$ <i>R</i> 26.30 ✓
1 PANEL SUB-ASSY, REAR DOOR, RH	\$ <i>R</i> 1,294.90 ✓
1 FRAME SUB-ASSY, REAR DOOR OUTSIDE HANDLE, RH	\$ <i>R</i> 193.50 X
1 HANDLE ASSY, REAR DOOR OUTSIDE, RH	\$ <i>R</i> 97.40 X
1 WEATHERSTRIP, REAR DOOR OPENING TRIM, RH	\$ <i>R</i> 293.00 X
1 MOTOR ASSY, POWER WINDOW REGULATOR, REAR RH	\$ <i>R</i> 926.00 X
1 REGULATOR SUB-ASSY, REAR DOOR WINDOW, RH	\$ <i>R</i> 206.70 X
1 TAPE, BLACK OUT, NO.2 REAR RH	\$ <i>R</i> 34.90 ✓
1 TAPE, BLACK OUT, NO.3 REAR RH	\$ <i>R</i> 15.40 ✓
1 TAPE, BLACK OUT, NO.1 REAR RH	\$ <i>R</i> 21.90 ✓
1 HINGE ASSY, REAR DOOR, LOWER RH	\$ <i>R</i> 87.10 ✓
1 HINGE ASSY, REAR DOOR, UPPER RH	\$ <i>R</i> 98.90 X
1 FENDER SUB-ASSY, FRONT RH	\$ <i>R</i> 977.80 ✓
1 EMBLEM, SIDE PANEL, RH	\$ <i>R</i> 54.60 ✓
1 LINER, FRONT FENDER, LH	\$ <i>R</i> 210.30 X
1 MIRROR ASSY, OUTER REAR VIEW, RH	\$ <i>R</i> 1436.6 X

Trans-cab Auto Services Pte Ltd

AAD2212-

No. 2 Ang Mo Kio Street 63 Singapore 569111

Tel No. : 6287 6666 Fax No. : 6257 1330

CO./GST Reg. No. 201019626G

SHD9826J

- 1 MOULDING ASSY, BODY ROCKER PANEL, RH

	\$	<i>Build</i> 594.80 ✓
TOTAL	\$	10,205.20
25%	\$	2,551.30
	\$	7,653.90

Special Nett

1	FRT FENDER LINER CLIP	\$	na	65.00	X
1	FRT BUMPER CLIP	\$	na	65.00	X
1	FRT BUMPER RETAINER CLIP	\$	na	75.00	X
1	DOOR STICKER TRANSCAB	\$	na	100.00	60sm
1	DOOR STICKER TEL. NO	\$	na	100.00	60sm
1	DOOR TRIM CLIP	\$	na	75.00	X
1	DOOR WEATHERSTRIP CLIP	\$	na	80.00	X
TOTAL		\$		560.00	
TOTAL PARTS		\$		8,213.90	

LABOUR

To Rust-Proofing and apply undercoat Of The Affected Areas.	\$	240.00 <i>900</i>
To remove and refit interior fittings, trimings, garnish, fittings and other, to enable repair.	\$	<i>na</i> 380.00 X
Panel Beating, Knocking And Straightening The Necessary Portion, Remove And Renewal Of Parts, Adjust And Realign The Same	\$	1,600.00 <i>5000</i>
To transfer of rear end panel fittings, attachment to facilitate bodywork repair.	\$	<i>na</i> 380.00 X
Putty And Spray Painting Of The Affected Portion.	\$	1,600.00 <i>8800</i>
To reinstall rear bumper parking sensor.	\$	<i>na</i> 170.00 X

Trans-cab Auto Services Pte Ltd

AAD2212-

No. 2 Ang Mo Kio Street 63 Singapore 569111

Tel No. : 6287 6666 Fax No. : 6257 1330

CO./GST Reg. No. 201019626G

SHD9826J

To transfer of tire, rim and on wheel balancing.	\$	<i>nn</i> 170.00 <i>X</i>
To Check Electrical Lighting Concerned.	\$	170.00 <i>201</i>
To check steering geometry and computer wheel alignment	\$	<i>nn</i> 220.00 <i>X</i>
To remove and refit of rear fender fittings, attachment and perform water seepage test.	\$	<i>nn</i> 170.00 <i>X</i>
TOTAL	\$	5,100.00
Over All Total	\$	13,313.90

(PART-BY-PART) Repair Days *04* Days**LKK Auto Consultants hence notify the Repairer of the following:**

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

> Back to OneMotoring

Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars

Owner ID Type:

Company

Owner ID:

878K

Vehicle Details

Vehicle No.:

SHD9826J

Vehicle to be Exported:

Yes

Intended Deregistration Date:

16 Dec 2022

Vehicle Make:

TOYOTA

Vehicle Model:

PRIUS 5DR HATCHBACK (AUTO)

Primary Colour:

Red

Manufacturing Year:

2020

Engine No.:

2ZR2H77928

Chassis No.:

JTDKB3FU703093659

Maximum Power Output:

90.0 kW (120 bhp)

Open Market Value:

\$26,807.00

Original Registration Date:

29 Jan 2021

First Registration Date:

29 Jan 2021

Transfer Count:

0

Actual ARF Paid:

\$7,030.00

Intended PARF Rebate Details

PARF Eligibility:

Yes

PARF Eligibility Expiry Date:

28 Jan 2029

PARF Rebate Amount:

\$5,272.00

Intended COE Rebate Details

COE Expiry Date:

28 Jan 2029

COE Category:

A - Car up to 1600cc & 97kW (130bhp)

COE Period(Years):

8

PQP Paid:

\$30,510.00

COE Rebate Amount:

\$23,323.00

Total Rebate Amount:

\$28,595.00

Message

Please note that the 8-year COE for this vehicle cannot be further renewed. The vehicle must be de-registered upon COE expiry or when the vehicle reaches its statutory lifespan (if applicable), whichever is earlier.

The information contained herein is correct as at 16 Dec 2022

OK